

August 8, 2003

LICENSEE: South Texas Project Nuclear Operating Company

FACILITY: South Texas Project, Unit 1

SUBJECT: SUMMARY OF THIRD MEETING WITH SOUTH TEXAS PROJECT NUCLEAR OPERATING COMPANY REGARDING SOUTH TEXAS PROJECT, UNIT 1, REACTOR VESSEL AND BOTTOM-MOUNTED INSTRUMENTATION PENETRATION INTERFACE LEAKAGE (TAC NO. MB8435)

On July 17, 2003, STP Nuclear Operating Company (STPNOC), the licensee for South Texas Project (STP), Units 1 & 2, met with the U. S. Nuclear Regulatory Commission (NRC) staff at the NRC Headquarters. The purpose of the meeting was for STPNOC to brief the NRC staff and management regarding STPNOC's concluding efforts to address the issues arising from the April 12, 2003, discoveries of indications of leakage from the STP, Unit 1, bottom mounted instrument (BMI) penetrations 1 and 46. There are 58 BMI penetrations at STP, Unit 1.

At the outset, the NRC staff informed the audience that the NRC staff would not be making any decisions at this meeting. The purpose of the meeting was to gather information to facilitate the NRC staff's comprehensive evaluation of the issues raised.

The STPNOC stated that it has documented its commitments to take follow up actions as outlined in its letter dated July 11, 2003. The NRC staff commented that the letter does not specifically state that the described actions are in fact licensee commitments. The licensee stated that it will provide a follow up in response to the comment.

A list of meeting attendees is included as Enclosure 1 to this summary. Enclosure 2 contains the licensee's presentation view-graphs .

The STPNOC outlined its desired meeting outcomes: (1) to keep NRC fully informed and ensure that NRC has sufficient information to complete its comprehensive assessment; (2) to explain the results of comprehensive nondestructive examination (NDE); and (3) to describe remaining future activities, i.e., to collect boat samples, perform nozzle remnants analyses, and submit a licensee event report supplement. The licensee then summarized its root cause analysis process and planned monitoring and inspection activities. The STPNOC provided answers to NRC questions and understood the remaining NRC needs for information. The STPNOC summarized that the residue found at BMI penetration no. 1 and penetration no. 46 was very small. It indicated a very small leak from the reactor bottom.

#### NDE Campaign

An extensive NDE campaign included ultrasonic testing (UT), enhanced visual examination of J-groove weld surface, volumetric interrogation of vessel base metal for wastage, eddy current testing (ET) of penetration tube inside diameter, ET of J-groove weld surface, profilometry, boroscope examination, Helium leak tests, metallurgical analysis of removed nozzle remnants, and future boat sample analysis.

The licensee stated that the results of the evaluation indicated that the observed leakage was caused by one axial crack in each of the two penetrations. Penetration no. 1 had three crack indications, with one leak path. Penetration no. 46 had two axial indications with one leak path.

### Nozzle Repairs

The condition was limited to two identified nozzles and the cracks identified were axial in orientation. Evaluation of stresses indicated that circumferential cracking was not likely to occur. The licensee selected the half-nozzle repair method. Repair of both of the leaking nozzles is complete.

### Root Cause Process

The licensee outlined that there were no circumferential indications, no cracks above or below the J-groove weld, and no material wastage was found. The STPNOC considered two possible causes of crack initiation: (1) The cracks were caused by primary water stress corrosion cracking (PWSCC), or (2) the cracks were caused by a fabrication flaw over-stress in the nozzle and/or weld. The cracks were either propagated by PWSCC or low-cycle fatigue. The licensee then deduced that the facts are not consistent with PWSCC. No cracks were identified in 56 out of 58 BMI nozzles. The cracks were about 4 years old, were about the same age, and did not initiate from the inside diameter of the tubes. The licensee concluded that for PWSCC to be the cause, the expectation would be to observe defects in approximately 20 percent of the penetrations. Hence, defects would be expected in 12 penetrations out of 58 examined, but only 2 penetrations with defects were found.

The residual stresses do not appear to show any correlation with the observed cracks. Penetration no. 1 and penetration no. 46 differ in residual stresses, and still they are the only penetrations showing crack indications and leakage. Furthermore, some cracks did not appear to be in contact with primary water. Based on the above rationale, the licensee concluded that the root cause of the BMI cracks was fabrication flaws.

The NRC staff commented that the licensee's hypothesis did not explain why the fabrication flaws occurred only in penetrations 1 and 46. The licensee responded that it would consider the NRC comment in further evaluation of the root cause.

### Monitoring and Inspection Plan

The licensee proposed that it will continue the bare metal inspections under its boric acid control program. It will perform UT and enhanced visual testing of the BMI instrumentation at the next Unit 1 vessel inservice inspection program inspection. It will also perform periodic UT of vessel base material around the repaired penetrations, and will perform volumetric examination of Unit 2 penetrations at the next refueling outage with the core barrel removed.

### Conclusions

The licensee concluded that: (1) the extent of the condition is known, (2) that STPNOC has identified the probable cause as understood at the time, (3) engineering work has been completed, (4) the condition has been corrected by the half-nozzle design repair, (5) the

licensee has confidence in the effectiveness of the repair, and (6) the plant staff is trained and is prepared for start up of the plant.

The NRC staff informed the STPNOC that its boric acid inspection program has been proactive, and that its response to the conditions of leakage in BMI penetrations 1 and 46 has been thorough. The staff asked how is it that STPNOC can perform the operations at STP, Units 1&2, in such a proactive and thoroughly responsive manner. The licensee responded that it is the policy of the STPNOC management to ensure that, when challenges are identified, the company mobilizes the best internal resources and the world's best contractors to support the resolution of the issues, and to eliminate the challenges.

The NRC staff then asked for public comments for the meeting attendees and the teleconference participants. No comments were offered. The meeting was then adjourned.

*/RA/*

Mohan C. Thadani, Senior Project Manager, Section 1  
Project Directorate IV  
Division of Licensing Project Management  
Office of Nuclear Reactor Regulation

Docket No. 50-498

Enclosures: 1. List of Attendees  
2. View-graphs (ADAMS Accession No.: ML032090144)

cc: see next page

licensee has confidence in the effectiveness of the repair, and (6) the plant staff is trained and is prepared for start up of the plant.

The NRC staff informed the STPNOC that its boric acid inspection program has been proactive, and that its response to the conditions of leakage in BMI penetrations 1 and 46 has been thorough. The staff asked how is it that STPNOC can perform the operations at STP, Units 1&2, in such a proactive and thoroughly responsive manner. The licensee responded that it is the policy of the STPNOC management to ensure that, when challenges are identified, the company mobilizes the best internal resources and the world's best contractors to support the resolution of the issues, and to eliminate the challenges.

The NRC staff then asked for public comments for the meeting attendees and the teleconference participants. No comments were offered. The meeting was then adjourned.

*/RA/*

Mohan C. Thadani, Senior Project Manager, Section 1  
Project Directorate IV  
Division of Licensing Project Management  
Office of Nuclear Reactor Regulation

Docket No. 50-498

Enclosures: 1. List of Attendees  
2. View-graphs (ADAMS Accession No.: ML032090144)

cc w/enclosure: See next page

DISTRIBUTION: See Next Page

Package No.: ML032090151

Handouts: ML032090144

ADAMS Accession No.: ML032090159

\*via e-mail

NRC-001

OFFICE	PDIV-1/PM	PDIV-1/LA	RIV	PDIV-1/SC
NAME	MThadani:sab	MMcAllister	WJohnson*	RGramm
DATE	8/08/2003	8/08/2003	8/08/2003	8/08/2003

OFFICIAL RECORD COPY

DISTRIBUTION FOR MEETING BETWEEN NRC AND STP NUCLEAR OPERATING  
COMPANY ON JULY 17, 2003.

Dated: August 8, 2003

DISTRIBUTION:

PUBLIC

PDIV-1 RF

RidsNrrAdpt (BSheron/MKotzalas)

RidsNrrDlpm (LMarsh/ELeeds)

RidsNrrDlpmLpdiv (HBerkow)

RidsNrrPMMThadani

RidsOgcRp

BBateman

TMensah

EReichelt

ESullivan

AHiser

SBurnell

WJohnson, RIV

RBywater, RIV

RidsNrrDssa (SBlack/MJohnson)

RidsRgn4MailCenter (AHowell)

RidsNrrDlpmLpdiv1 (RGramm)

RidsNrrLAMMcAllister

RidsAcrcAcnwMailCenter

MHartzman

EDO Contact, RIV

TPruett, RIV

BCullen

SCoffin

GCheruvenki

SBloom

JFoster

MEETING PARTICIPANTS  
FOR  
THIRD MEETING BETWEEN STPNOC AND NRC  
ON JULY 17, 2003

Licensee Participants

Tom Jordan  
Mark McBurnett  
Tim Bowman  
Wayne Harrison  
Bill Humble  
Michael Lashley  
Ulhas Patil  
Steve Thomas

NRC Participants

Headquarters

Brian Sheron  
Richard Barrett  
Robert Gramm  
Stephanie Coffin  
Ganesh Cheruvenki  
Scott Burnell  
Mark Hartzman  
Edmund Sullivan  
Herb Berkow  
Allen Hiser  
William Bateman  
Mel Fields  
Eric Reichelt  
Mohan Thadani  
William Cullen

Region IV

William Johnson  
Russell Bywater  
Troy Pruett

Other

David Lochbaum, Union of Concerned Scientists  
Al Gutterman, Morgan Lewis  
Jim Riley, NEI  
Paul Gunter, NIRS  
Kazuhiko Kishioka, JAPC  
Altheia Wyche, SERCH Licensing/Bechtel  
Randal Schmidt, PSEG Nuclear  
Joe Roarty, Def. Nuc. Fac. Safety  
Jim Osborn, Public  
Getachen Tesfaye, CEG  
Jon Kirkwood, CEG  
Robert Hermann, SIA

South Texas Project, Unit 1

cc:

Mr. Cornelius F. O'Keefe  
Senior Resident Inspector  
U.S. Nuclear Regulatory Commission  
P. O. Box 910  
Bay City, TX 77414

A. Ramirez/C. M. Canady  
City of Austin  
Electric Utility Department  
721 Barton Springs Road  
Austin, TX 78704

Mr. L. K. Blaylock  
Mr. W. C. Gunst  
City Public Service Board  
P. O. Box 1771  
San Antonio, TX 78296

Mr. C. A. Johnson/A. C. Bakken  
AEP Texas Central Company  
P. O. Box 289  
Mail Code: N5022  
Wadsworth, TX 77483

INPO  
Records Center  
700 Galleria Parkway  
Atlanta, GA 30339-3064

Regional Administrator, Region IV  
U.S. Nuclear Regulatory Commission  
611 Ryan Plaza Drive, Suite 400  
Arlington, TX 76011

D. G. Tees/R. L. Balcom  
Texas Genco, LP  
P. O. Box 1700  
Houston, TX 77251

Judge, Matagorda County  
Matagorda County Courthouse  
1700 Seventh Street  
Bay City, TX 77414

A. H. Gutterman, Esq.  
Morgan, Lewis & Bockius  
1111 Pennsylvania Avenue, NW  
Washington, DC 20004

Mr. T. J. Jordan, Vice President  
Engineering & Technical Services  
STP Nuclear Operating Company  
P. O. Box 289  
Wadsworth, TX 77483

S. M. Head, Manager, Licensing  
Nuclear Quality & Licensing Department  
STP Nuclear Operating Company  
P. O. Box 289, Mail Code: N5014  
Wadsworth, TX 77483

Environmental and Natural Resources  
Policy Director  
P. O. Box 12428  
Austin, TX 78711-3189

Jon C. Wood  
Matthews & Branscomb  
112 East Pecan, Suite 1100  
San Antonio, TX 78205

Arthur C. Tate, Director  
Division of Compliance & Inspection  
Bureau of Radiation Control  
Texas Department of Health  
1100 West 49th Street  
Austin, TX 78756

Brian Almon  
Public Utility Commission  
William B. Travis Building  
P. O. Box 13326  
1701 North Congress Avenue  
Austin, TX 78701-3326

cc:

Susan M. Jablonski  
Office of Permitting, Remediation  
and Registration  
Texas Commission on  
Environmental Quality  
MC-122  
P.O. Box 13087  
Austin, TX 78711-3087

Mr. Terry Parks, Chief Inspector  
Texas Department of Licensing  
and Regulation  
Boiler Division  
P. O. Box 12157  
Austin, TX 78711

Mr. Ted Enos  
4200 South Hulen  
Suite 630  
Ft. Worth, Texas 76109

Mr. James J. Sheppard  
President and Chief Executive Officer  
STP Nuclear Operating Company  
South Texas Project Electric  
Generating Station  
P. O. Box 289  
Wadsworth, TX 77483