

Long-Term Surveillance Plan for the Gas Hills North (UMTRCA Title II) Disposal Site Fremont County, Wyoming

December 2011



**U.S. DEPARTMENT OF
ENERGY**

**Legacy
Management**

This page intentionally left blank

**Long-Term Surveillance Plan
for the
Gas Hills North (UMTRCA Title II) Disposal Site
Fremont County, Wyoming**

December 2011

This page intentionally left blank

Contents

Abbreviations.....	iii
1.0 Introduction.....	1
1.1 Purpose.....	1
1.2 Legal and Regulatory Requirements.....	1
1.3 Role of the U.S. Department of Energy	2
2.0 Final Site Conditions	3
2.1 Site History	3
2.2 General Description of the Disposal Site Vicinity.....	5
2.3 Disposal Site Description.....	5
2.3.1 Site Ownership.....	5
2.3.2 Directions to the Disposal Site.....	5
2.3.3 Description of Surface Conditions.....	5
2.3.4 Permanent Site Surveillance Features.....	9
2.3.5 Site Geology.....	10
2.4 Tailings Impoundments Design	13
2.4.1 Encapsulation Design.....	13
2.4.2 Storm Water Drainage System.....	14
2.5 Groundwater Conditions.....	17
3.0 Long-Term Surveillance Program	21
3.1 General License for Custody and Long-Term Care.....	21
3.2 Requirements of the General License	21
3.3 Annual Site Inspections	22
3.3.1 Frequency of Inspections	22
3.3.2 Inspection Procedure.....	22
3.3.3 Inspection Checklist.....	24
3.3.4 Personnel.....	24
3.4 Annual Inspection Reports.....	24
3.5 Follow-Up Inspections.....	25
3.5.1 Criteria for Follow-Up Inspections.....	25
3.5.2 Personnel.....	26
3.5.3 Reports of Follow-Up Inspections	26
3.6 Routine Site Maintenance and Emergency Measures.....	26
3.6.1 Routine Site Maintenance	26
3.6.2 Control of Deep-Rooted Vegetation on Tailings Impoundments	27
3.6.3 Emergency Measures.....	27
3.6.4 Criteria for Routine Site Maintenance and Emergency Measures.....	27
3.6.5 Reporting Maintenance and Emergency Measures.....	27
3.7 Environmental Monitoring.....	28
3.7.1 Groundwater Monitoring	28
3.7.2 Land Use Monitoring.....	33
3.7.3 Vegetation Monitoring.....	33
3.8 Institutional Controls	33
3.9 Records	34
3.10 Quality Assurance.....	34
3.11 Health and Safety	34
4.0 References.....	35

Figures

Figure 1.	General Location Map of the Gas Hills North, Wyoming, Disposal Site.....	6
Figure 2.	Gas Hills North, Wyoming, Disposal Site Map.....	7
Figure 3.	Gas Hills North, Wyoming, Disposal Site Topographic Map	8
Figure 4.	Partial Stratigraphic Column of the Gas Hills North, Wyoming, Disposal Site.....	10
Figure 5.	Site Marker at the Gas Hills North, Wyoming, Disposal Site	11
Figure 6.	Warning Sign at Gas Hills North, Wyoming, Disposal Site.....	12
Figure 7.	Cross Section of the Engineered Covers on Tailings Impoundments 1, 2, and 2A at the Gas Hills North, Wyoming, Disposal Site	15
Figure 8.	Cross Section of the Engineered Covers on Solution Ponds 3, 3A, and 4 at the Gas Hills North, Wyoming, Disposal Site	16
Figure 9.	Approximate Groundwater Flow Direction at the Gas Hills North, Wyoming, Disposal Site	18
Figure 10.	Inspection Transects for the Gas Hills North, Wyoming, Disposal Site	23

Tables

Table 1.	Requirements of the LTSP and for the Long-Term Custodian of the Gas Hills North, Wyoming, Disposal Site	2
Table 2.	Transects Used During First Inspection of the Gas Hills North Site	22
Table 3.	DOE Criteria for Maintenance and Emergency Measures	28
Table 4.	ACLs, Groundwater Protection Standards, Modeled POE Concentrations, and Background Levels for Analytes at the Gas Hills North, Wyoming, Disposal Site	29
Table 5.	Long-Term Groundwater Monitoring Plan for the Gas Hills North, Wyoming, Disposal Site	31

Appendixes

Appendix A—Real Estate Information
Appendix B—Vegetation Management and Cover Performance
Appendix C—Field Photograph Log
Appendix D—Initial Site Inspection Checklist
Appendix E—Time-Concentration Plots of Historical Groundwater Monitoring Data from the Gas Hills North, Wyoming, Disposal Site

Supplemental Information

NRC Acceptance Documentation

Abbreviations

ACL	alternate concentration limit
BLM	Bureau of Land Management
CFR	<i>Code of Federal Regulations</i>
D ₅₀	median diameter
DOE	U.S. Department of Energy
EMS	environmental management system
EPA	U.S. Environmental Protection Agency
ft	feet, foot
LM	Office of Legacy Management
LTSP	Long-Term Surveillance Plan
m ²	square meters
mg/L	milligram(s) per liter
NPDES	National Pollutant Discharge Elimination System
NRC	U.S. Nuclear Regulatory Commission
pCi	picocurie
pCi/g	picocurie(s) per gram
pCi/L	picocurie(s) per liter
PMC	Pathfinder Mines Corporation
PMF	probable maximum flood
POC	point of compliance
POE	point of exposure
Ra	radium
ROW	right of way
s	seconds
TDS	total dissolved solids
Th	thorium
UMTRCA	Uranium Mill Tailings Radiation Control Act
USC	<i>United States Code</i>
WDEQ	Wyoming Department of Environmental Quality

This page intentionally left blank

1.0 Introduction

1.1 Purpose

This Long-Term Surveillance Plan (LTSP) explains how the U.S. Department of Energy (DOE) will fulfill general license requirements of Title 10 *Code of Federal Regulations* Part 40.28 (10 CFR 40.28) as the long-term custodian of the Gas Hills North disposal site (formerly known as the Pathfinder Mines Corporation [PMC] Lucky Mc uranium mill tailings disposal site) in Fremont County, Wyoming. The DOE Office of Legacy Management (LM) is responsible for the preparation, revision, and implementation of this LTSP, which specifies procedures for inspecting the site, monitoring, conducting maintenance, fulfilling annual and other reporting requirements, and maintaining records pertaining to the site.

1.2 Legal and Regulatory Requirements

The Uranium Mill Tailings Radiation Control Act (UMTRCA) of 1978 (Title 42, *United States Code*, Section 7901 [42 USC §7901]) as amended, provides for the remediation (or reclamation) and regulation of uranium mill tailings under either Title I or Title II of the act. Title I addresses former uranium millsites that were unlicensed as of January 1, 1978, and essentially abandoned. Title II addresses uranium millsites under specific license as of January 1, 1978. In both cases, the licensing agency for uranium production is the U.S. Nuclear Regulatory Commission (NRC) or, in the case of certain Title II disposal sites, an Agreement State. The Gas Hills North disposal site is regulated under Title II of UMTRCA. The State of Wyoming is not an Agreement State.

Federal regulations at 10 CFR 40.28 provide for the licensing, custody, and long-term care of uranium and thorium mill tailings sites closed (reclaimed) under Title II of UMTRCA.

A general license is issued by NRC for the custody and long-term care—including monitoring, maintenance, and emergency measures—necessary to ensure that uranium and thorium mill tailings disposal sites will be cared for in such a manner as to protect public health, safety, and the environment after closure (completion of reclamation activities).

The general license becomes effective when NRC or an Agreement State approves the site reclamation and terminates the operating license, and NRC accepts a site-specific LTSP (this document).

Requirements of the LTSP and general requirements for the long-term custody of the Gas Hills North disposal site specified in 10 CFR 40 are addressed in various sections of the LTSP as shown in Table 1.

The plans, procedures, and specifications in this LTSP are based on *Guidance for Implementing the Long-Term Surveillance Program for UMTRCA Title I and Title II Disposal Sites* (DOE 2001). Rationale and procedures in the guidance document are considered part of this LTSP.

Table 1. Requirements of the LTSP and for the Long-Term Custodian of the Gas Hills North, Wyoming, Disposal Site

Requirements of the LTSP		
	Requirement	LTSP Section
1.	Description of the final site conditions	Section 2.0
2.	Legal description of the site	Appendix A
3.	Description of the long-term surveillance program	Section 3.0
4.	Criteria for follow-up inspections	Section 3.5.1
5.	Criteria for maintenance and emergency measures	Section 3.6.3
Requirements for the Long-Term Custodian (DOE)		
	Requirement	LTSP Section
1.	Notification to NRC of changes to the LTSP	Section 3.1
2.	NRC permanent right-of-entry	Section 3.1
3.	Notification to NRC of significant construction, actions, or repairs at the site.	Sections 3.5 and 3.6

1.3 Role of the U.S. Department of Energy

In 1988, DOE designated the Grand Junction facility as the program office for managing long-term surveillance and maintenance of DOE disposal sites that contain regulated low-level radioactive materials and portions of sites that do not have a DOE mission after cleanup, as well as other sites (including Title II sites) as assigned, and to establish a common office for the security, surveillance, monitoring, and maintenance of those sites.

In December 2003, DOE formally established the LM office. The LM mission includes “implementing long-term surveillance and maintenance projects at sites transferred to LM to ensure sustainable protection of human health and the environment.” LM is responsible for implementing this LTSP after it is accepted by NRC and the site becomes regulated under the general license.

According to the objectives of DOE Order 450.1A, *Environmental Protection Program*, or current guidance, DOE sites must implement sound stewardship practices protective of the air, water, land, and other natural and cultural resources potentially affected by their operations. DOE Order 450.1A requires DOE sites to have an environmental management system (EMS) to implement these practices. The LM EMS incorporates federal mandates specified in Executive Order 13423, *Strengthening Federal Environmental, Energy, and Transportation Management* and DOE Order 430.2B, *Departmental Energy Renewable Energy and Transportation Management*.

2.0 Final Site Conditions

The Gas Hills North mill facility was decommissioned from 1993 to 1994 in accordance with the NRC-approved Decommissioning Plan (PMC 1992a). From 1996 to 1997, windblown contaminated soils were cleaned up according to the NRC-approved Reclamation Plan (PMC 1992b). A final completion report verifying and documenting the cleanup of the mill site was published in 1999 (ERG 1999). A final completion report verifying and documenting the construction of the mill tailings containment structures and reclamation of the disposal site was published in 2005 (PMC 2005). In 2006, NRC concluded that reclamation of the site was performed in accordance with UMTRCA requirements specified in Appendix A of 10 CFR 40 (NRC 2006). This section summarizes the site milling history, and the final cleanup and reclamation of the mill tailings disposal site.

2.1 Site History

Uranium milling at the Gas Hills North site was conducted from 1958 through 1988. The ore for the mill came from open pit and underground mines in the vicinity of the mill. A total of 12 million tons of ore was processed at the site. There, milling was accomplished using a sulfuric acid leaching process, counter current decantation, ion exchange, solvent extraction, precipitation, and yellowcake drying and packaging (NRC 1993).

During the milling period, depleted tailings were slurried into a series of tailings impoundments, or ponds, which were constructed at the head of a natural draw (Reid Draw) located directly north-northwest of the original millsite. The tailings system consists of a series of earthen embankments across Reid Draw, which extends some 3,500 meters down the draw. The upper portion of the tailings system consists of Tailings Impoundments 1, 2, and 2A, which are located immediately north of the former mill and contain all of the solid tailings that were generated at the site. The lower portion of the tailings system, which is downgradient and north of the solid tailings impoundments, consists of a series of three solution ponds that held the so-called barren solution (recoverable uranium had been removed) that was generally not recycled through the mill. This solution had low pH (2.0–3.0) and contained high concentrations of dissolved solids (including various heavy metals) and radionuclides such as thorium-230 (Th-230) and radium-226 (Ra-226). Solution Ponds 3, 3A, and 4 were used to contain these tailings solution liquids and constitute the lower portion of the tailings system (NRC 1993).

During early operations, from 1958 until 1960, excess tailings solution was routinely discharged down Reid Draw from Tailings Impoundment 1; this practice was considered acceptable at the time, as the site was routinely inspected by the U.S. Atomic Energy Commission (PMC 1998). The practice was discontinued after the construction of Tailings Impoundment 2 was completed in June 1960. The farthest downgradient containment embankment, Solution Pond 4 dam, was constructed in 1961 (and reconstructed in 1980, as discussed in Section 2.4). During a period of unusually rainy weather in June 1963, the capacity of Solution Pond 4 was taxed. Out of concern for the integrity of the dam in the event of an uncontrolled overtopping that appeared imminent, a relief overflow was cut into the dam and an estimated 23 million gallons of water was released down Reid Draw (diluted significantly by the precipitation runoff). The environmental assessment concluded that no significant health risks resulted from this intentional release from Solution Pond 4. Groundwater down gradient (north) of the site is considered by the State of Wyoming to be Class III—suitable for livestock. Therefore, the proposed “no action” alternative

for the affected portion of Reid Draw downgradient of Solution Pond 4 dam was accepted by NRC in consultation with the Wyoming Department of Environmental Quality (WDEQ). The "no action" alternative for Reid Draw was posted in the *Federal Register* on March 17, 1999, and subsequently reflected in License Condition No. 29 (PMC 1998, NRC 1999a, NRC 1999b, NRC 2008).

From approximately mid-1974 to late 1981, groundwater from mine dewatering operations was routinely discharged into Fraser Draw under a permit issued initially by the U.S. Environmental Protection Agency (EPA) and subsequently by WDEQ (EPA 1974, WDEQ 1978). This permit was issued in compliance with the National Pollutant Discharge Elimination System (NPDES). The average discharge rate was 940,000 gallons per day under these permits (un-permitted discharges had occurred down Fraser Draw since the late 1950s, prior to the creation of EPA and the NPDES program). The permits allowed the discharge of water with concentrations of uranium ranging up to a daily maximum of 4 milligrams per liter (mg/L), not to exceed a monthly average of 2 mg/L. Based on site records, the average uranium concentration in the permitted discharge waters was 0.77 mg/L, or 2.74 kilograms per day.

The uranium mill facilities were decommissioned from 1993 to 1994 according to the Mill Decommissioning Plan (PMC 1992a), as approved by NRC as License Condition No. 29 (NRC 2008). Some of the contaminated soils from Solution Ponds 3, 3A, and 4 were removed and placed in Tailings Impoundments 1, 2, and 2A according to the *Revised Solution Pond Area Reclamation Design* (Hydro-Engineering 2002a). The balance of the contaminated soils in Solution Ponds 3, 3A, and 4 were stabilized in place. Soils contaminated by windblown tailings were also disposed of in these ponds during site reclamation. The uranium mill facilities were razed, and the mill debris was placed in the tailings impoundments along with process residues.

Groundwater corrective action at the site began in 1980 when pumping was begun from a series of collection wells installed within the contaminate plume. Restoration continued through 1988, at which time the system was augmented with the addition of several more collection wells and two horizontal collection drains. In 1989, the groundwater corrective action was enhanced with upgradient fresh-water injection via a system that was placed in operation to drive the contaminated groundwater toward downgradient collection wells and therefore, more effectively collect the contaminated groundwater by flushing the affected area. The groundwater restoration program also included a tailings-dewatering component that was brought online in 1989 and was later expanded in 1992 (Hydro-Engineering 2002b). Recovered contaminated groundwater and tailings pore water were pumped into a lined evaporation pond (subsequently reclaimed in place). By the end of 2000, the groundwater corrective action had produced 187 million gallons from the aquifer system and 199 million gallons from the tailings-dewatering program. In addition, approximately 172 million gallons of fresh water was injected into the aquifer system as part of the groundwater corrective action (Hydro-Engineering 2002b). Because cleanup goals could not be achieved and simulated continued corrective action predicted no measurable change in groundwater contaminant concentrations, an application for alternate concentration limits (ACLs) was submitted to NRC (Hydro-Engineering 2002b). The groundwater corrective action program was terminated in 2002 upon approval of the ACL application by NRC.

2.2 General Description of the Disposal Site Vicinity

The Gas Hills North disposal site is located in the Gas Hills region of Fremont County, Wyoming, approximately 45 miles east of Riverton, Wyoming (Figure 1). The site encompasses approximately 1,276 acres (Figure 2). The elevation at the site ranges from about 6,200 to 6,500 feet (ft) above sea level (Figure 3). The topography in the immediate vicinity of the site is characterized by gently rolling hills.

The climate of the Gas Hills North area is semiarid, with annual precipitation of approximately 9 inches. More than half of the annual precipitation occurs during the spring months in the form of wet snow and rain (NRC 1993). The prevailing wind direction is from the south-southwest, and the mean annual wind speed is 12.8 miles per hour (<http://www.crh.noaa.gov>). The primary land uses in the immediate surrounding vicinity include cattle grazing (during the warmer months), minerals and oil and gas extraction, wildlife habitat, and hunting.

2.3 Disposal Site Description

2.3.1 Site Ownership

Upon completion of reclamation work and acceptance of the site under the NRC general license, the U.S. Government assumed ownership of the 1,276-acre Gas Hills North disposal site property. DOE has jurisdiction of the property, which has been withdrawn from public access. Real estate information is presented in Appendix A and includes a copy of the:

- Warranty deed.
- Public Land Order Notice of Permanent Withdrawal (Transfer of Public Land for the Gas Hills North, Wyoming, Uranium Repository).
- Legal description for the disposal site property.
- Pre-Transition Land Ownership and Use Map.

Access to the disposal site is from the west by way of unpaved road (i.e., Dry Creek Road; a "causal use" road); perpetual site access is assured under Wyoming mining law.

2.3.2 Directions to the Disposal Site

From Riverton, Wyoming, travel east on State Highway 136 approximately 45 miles to the terminus of State Highway 136, which is also the junction with Dry Creek Road. Turn left on Dry Creek Road, and proceed approximately 0.8 mile east to the site entrance, which is located on the north side of Dry Creek Road (Figure 1 and Figure 2).

2.3.3 Description of Surface Conditions

The former mill area (approximately 56 acres), combined with the stabilized tailings impoundments and solution ponds (approximately 291 acres), encompasses approximately 347 acres of the 1,276-acre disposal site property. Post-reclamation Tailings Impoundments 1, 2, and 2A encompass approximately 61, 77, and 82 acres, respectively, and post-reclamation Solution Ponds 3, 3A, and 4 encompass approximately 14, 18, and 39 acres, respectively, and are illustrated on Figure 2.

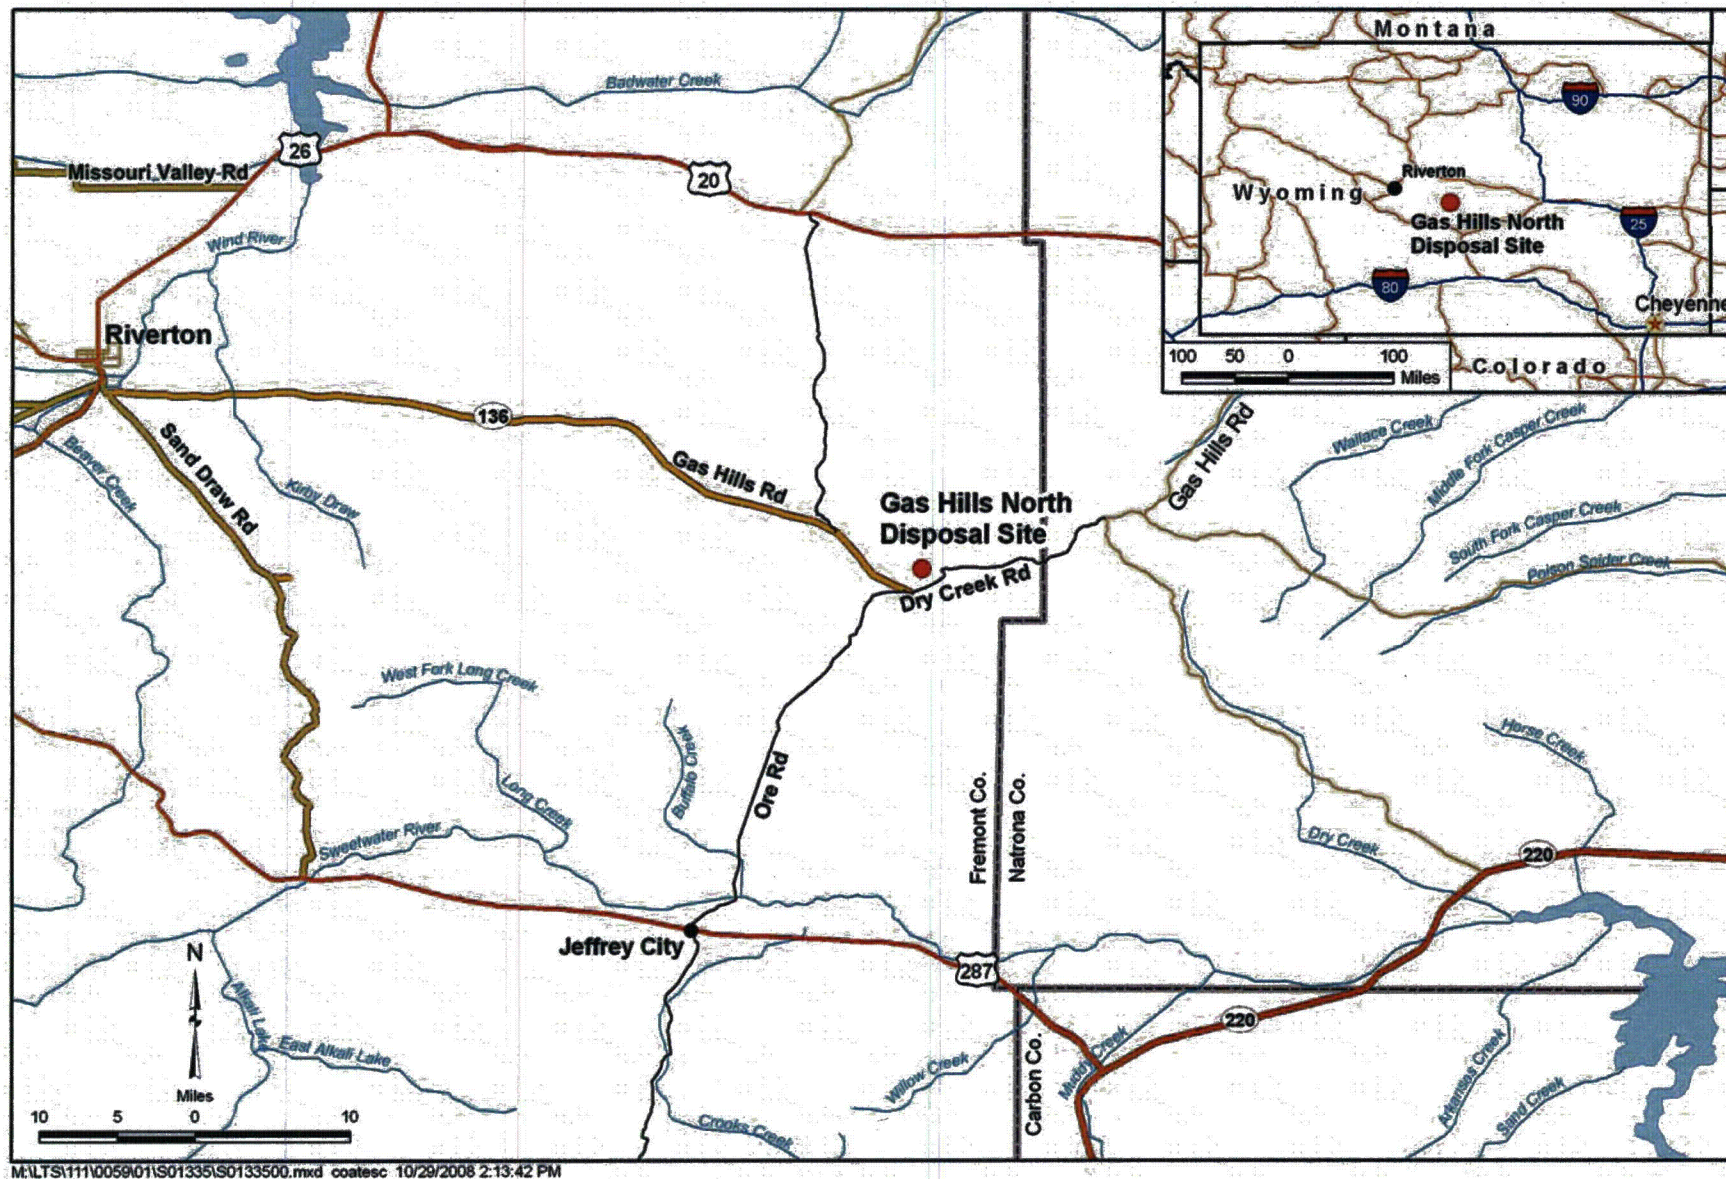


Figure 1. General Location Map of the Gas Hills North, Wyoming, Disposal Site

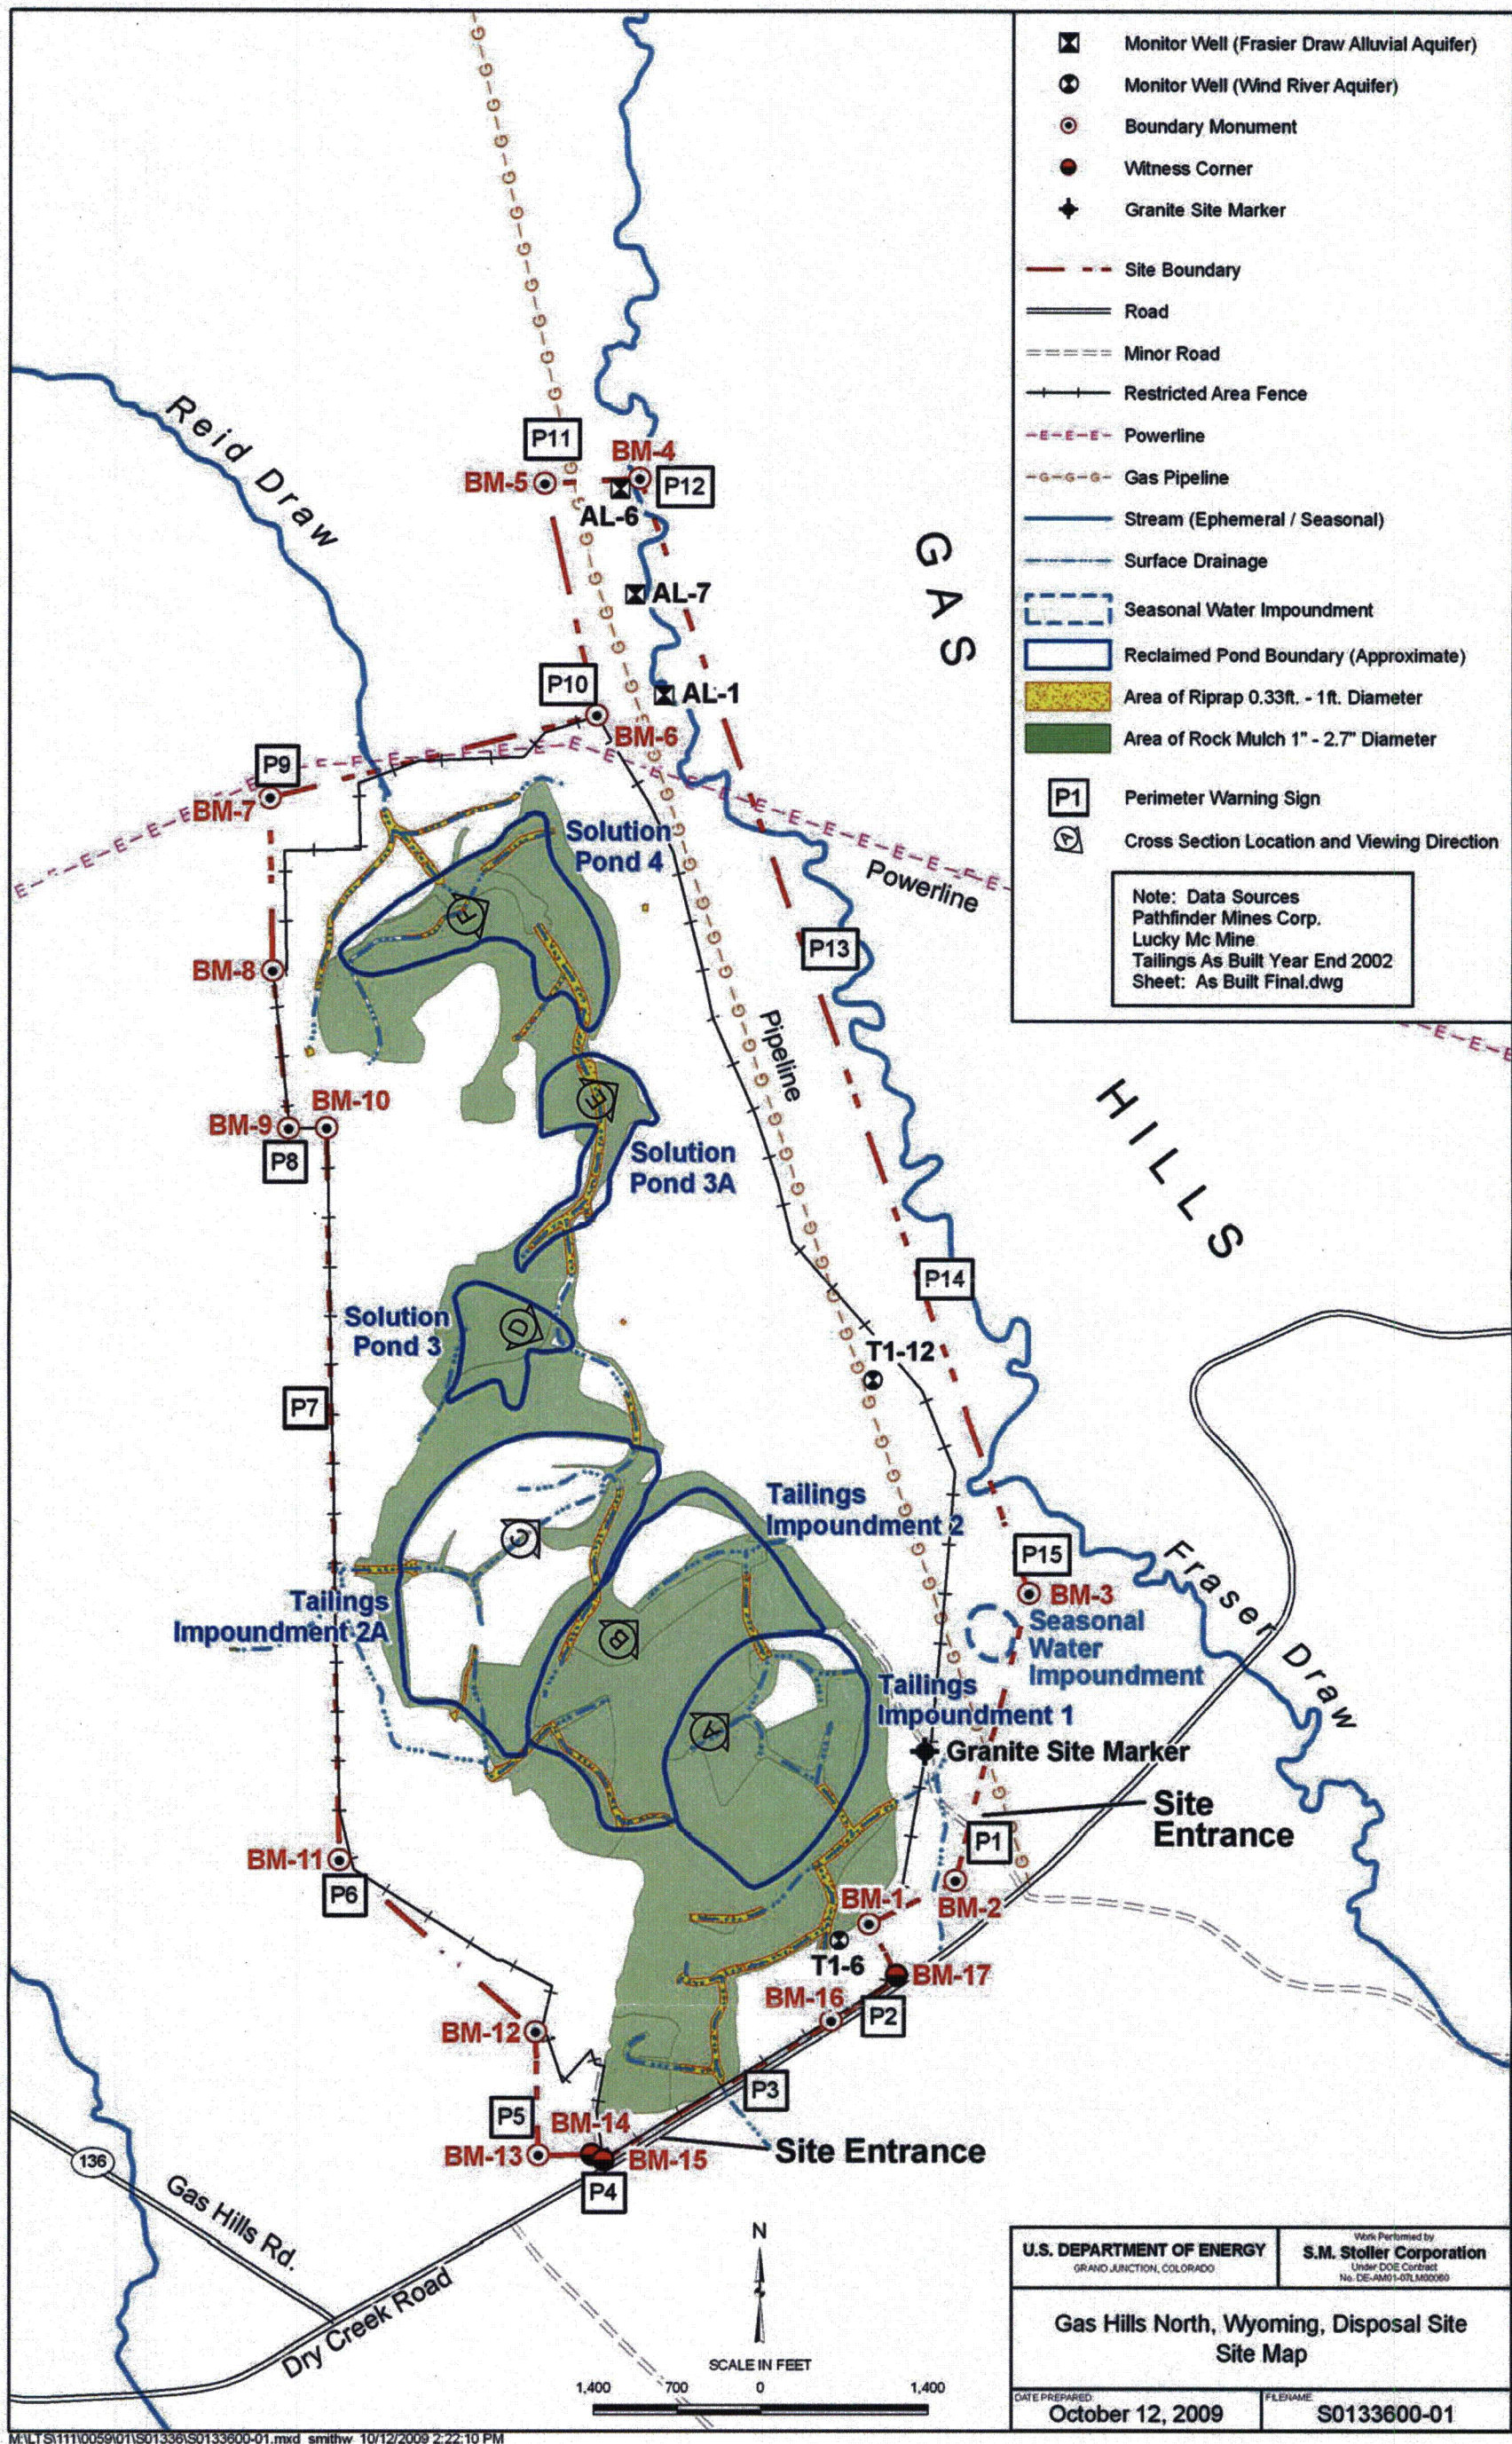


Figure 2. Gas Hills North, Wyoming, Disposal Site Map

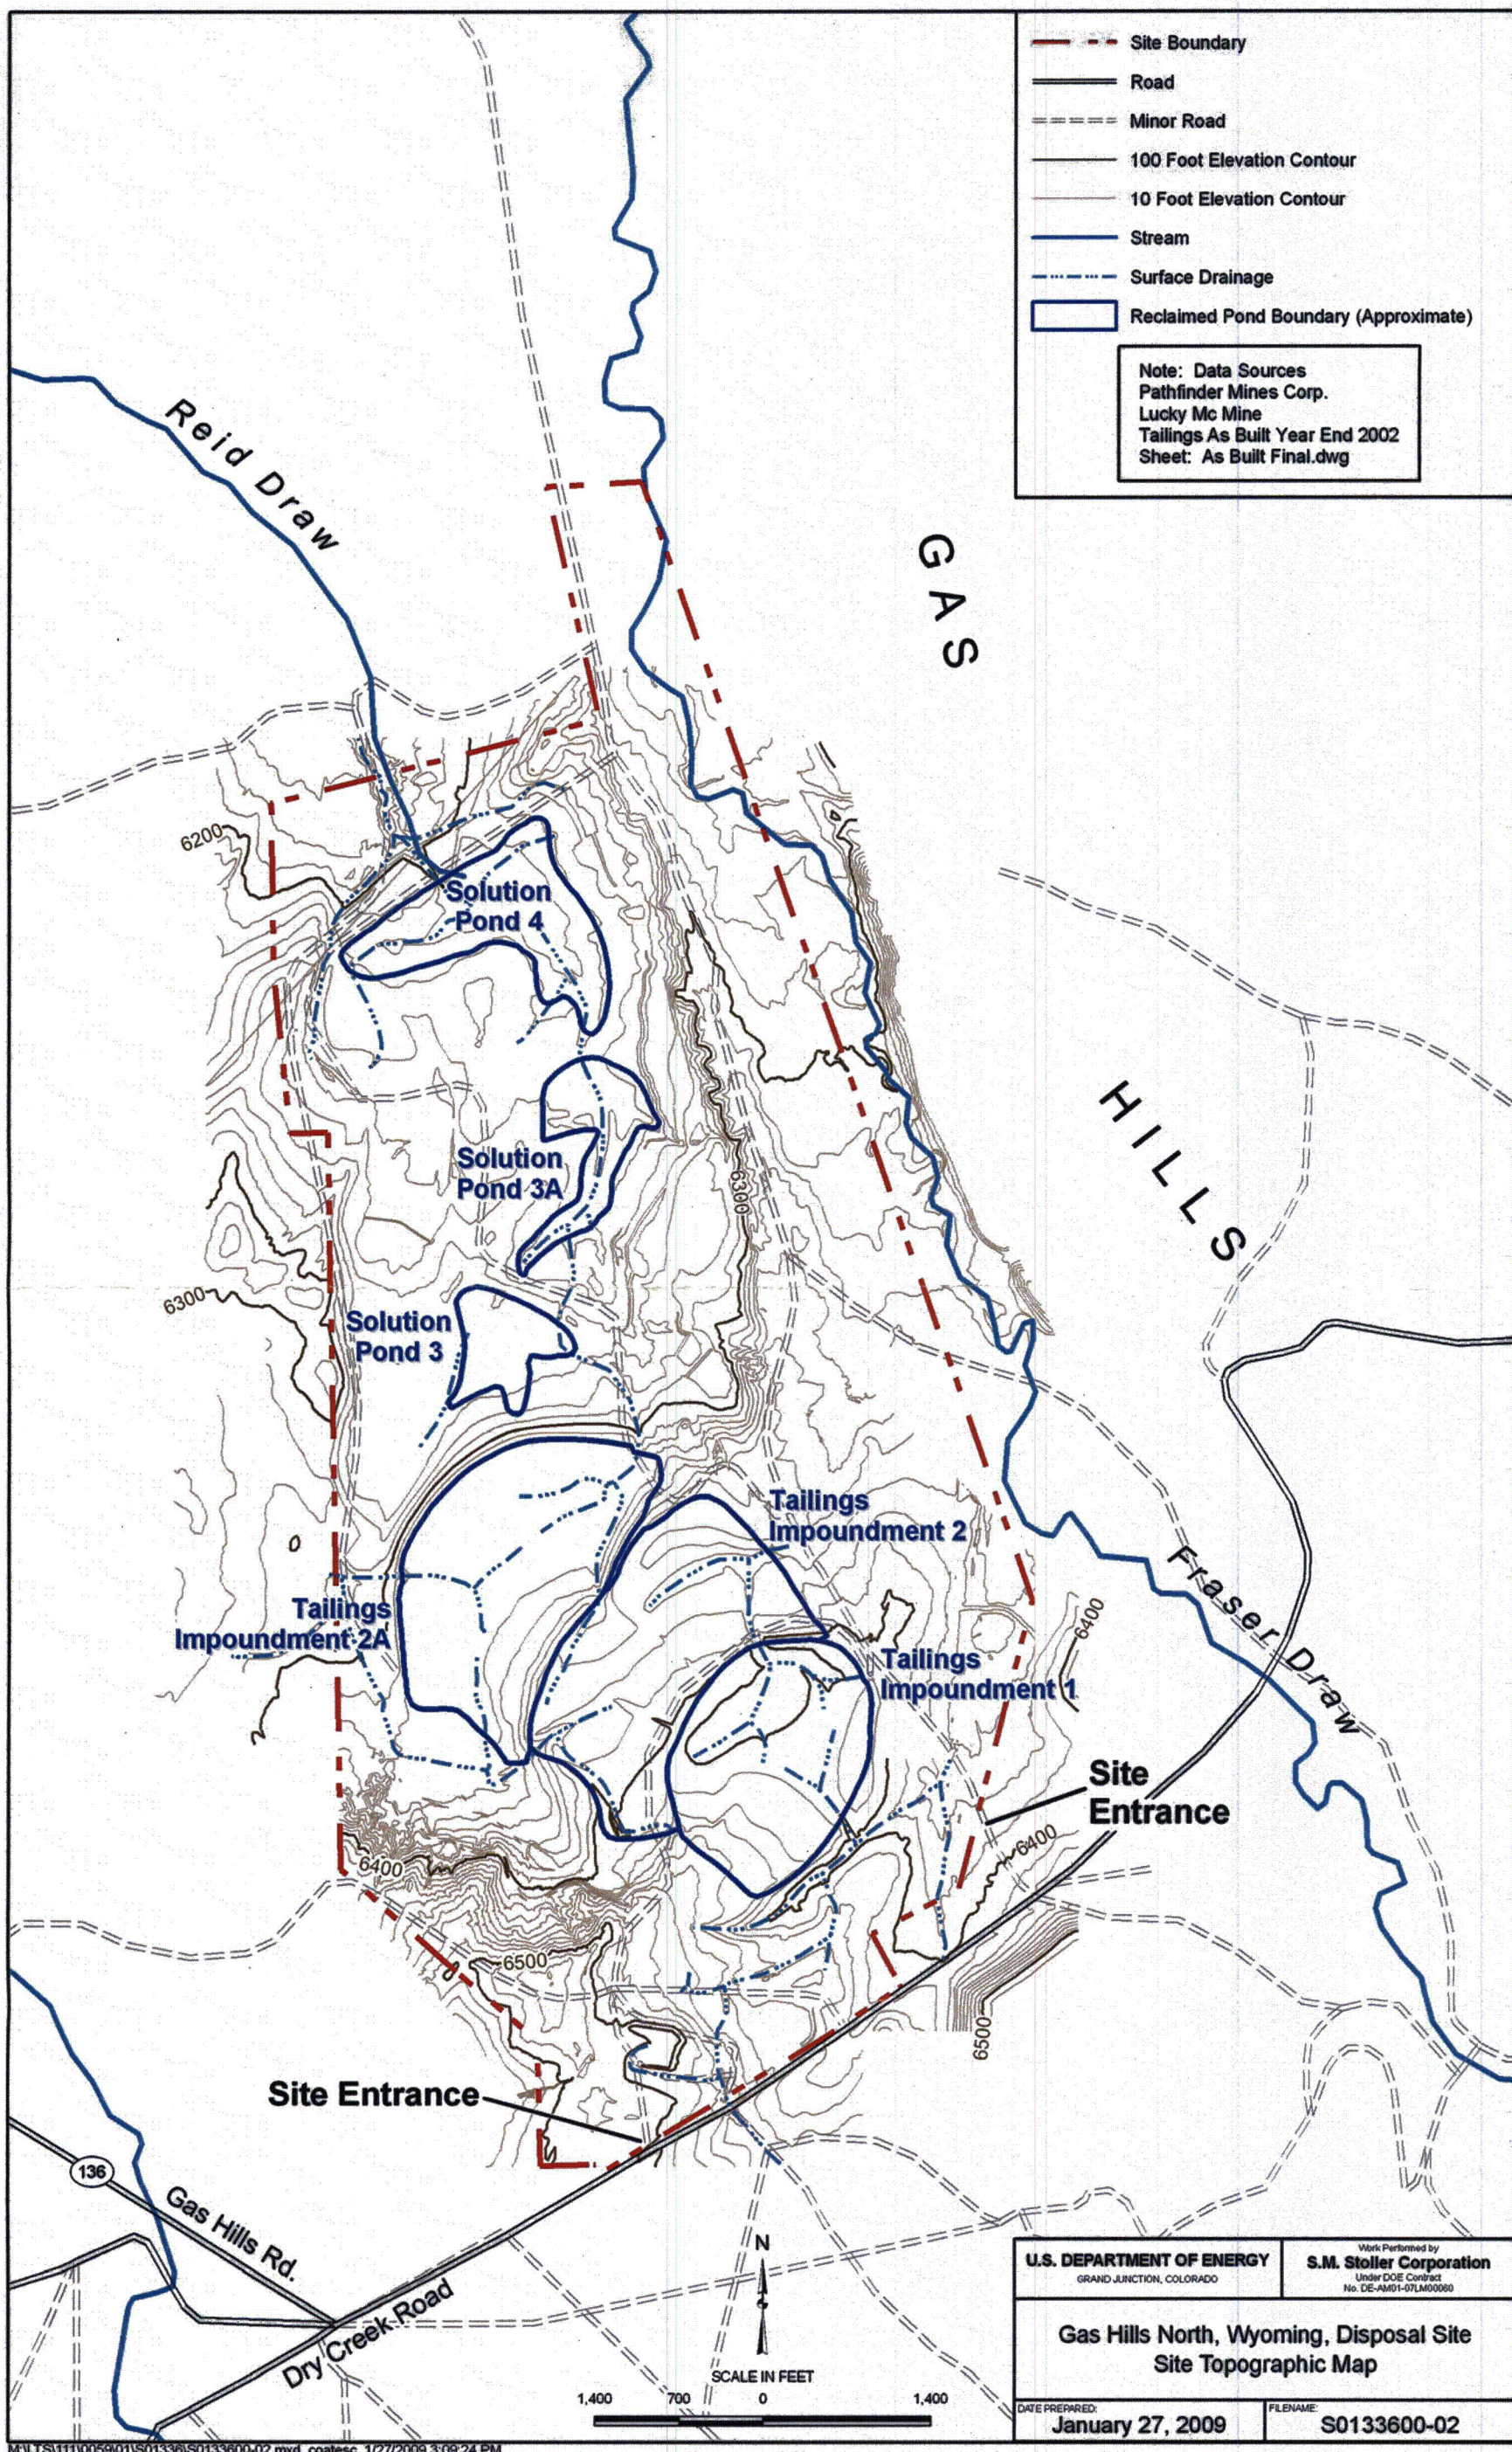


Figure 3. Gas Hills North, Wyoming, Disposal Site Topographic Map

The land surface at the Gas Hills North site was reclaimed to achieve gentle topography and a drainage pattern that distributes storm water away from the site. Tailings Impoundments 1, 2, and 2A were graded to achieve gentle top slopes and a 5H:1V slope for the dam-outslope area for Tailings Impoundment 2A (Hydro-Engineering 1999). Rock mulches were used on the top and side slopes of the tailings impoundments and on the outslope area of Tailings Impoundment 2A to provide long-term erosion protection to the reclaimed land surface. The reclaimed surface of Solution Ponds 3, 3A, and 4 is an extension of the cover that was placed over the tailings impoundments, also protected by riprap and rock mulch.

In accordance with the Soil Cleanup and Verification Plan (ERG 1999), surface soils that had Ra-226 concentrations exceeding the standard of 5 picocuries per gram (pCi/g) above background were removed and placed in the tailings impoundments. Subsurface soils (below 15 centimeters) with Ra-226 concentrations exceeding the standard of 15 pCi/g above background were also removed and placed in the tailings impoundments.

Drainage at the site was designed to decrease the peak runoff during storm events. To achieve this objective, the tailings disposal impoundments and solution pond areas were graded into 35 sub-basins. In addition, channel-control structures were used at the outlets to the sub-basins to further decrease peak discharges (Hydro-Engineering 1999). Various gradations of riprap were used in the drainages to protect against erosion.

The final surface at the Gas Hills North site combines grading and rock armoring to achieve the necessary surface water run-on and runoff control and erosion protection to satisfy the longevity design requirements.

All areas that were disturbed during construction, including cut and fill areas, were planted according to the specified seed mixture and covered with a dry mulch (Hydro-Engineering 1999). Additional revegetation was performed for those areas that did not succeed on the initial planting. Poor soils at the site (consisting primarily of clay) are attributed to the difficulty encountered in successfully establishing revegetation at the site.

There are five monitor wells at the Gas Hills North disposal site (Figure 2). The entire site property is encircled by a standard four-strand barbed-wire stock fence.

2.3.4 Permanent Site Surveillance Features

Boundary monuments, a site marker, and posted perimeter warning signs are the permanent surveillance features at the Gas Hills North disposal site. These features will be inspected and maintained as necessary as part of the passive controls for the site.

Seventeen survey monuments mark the site boundary. These boundary monuments are a combination of the standard UMTRCA disposal site aluminum-cap monuments (DOE 2001) placed by a licensed surveyor on behalf of the former site operator, PMC; brass-cap monuments placed by the U.S. General Land Office, BLM; previous PMC property boundary surveys; and three witness corners (which offset from the property boundary as a result of a physical obstruction).

One unpolished granite marker with an incised message identifying the site of the Gas Hills North disposal area is placed on site property just inside the main entrance gate. The message on the granite site marker is shown on Figure 5.

Fifteen warning signs displaying the DOE 24-hour telephone number (Figure 6) are placed along the site boundary, including one near the main entrance to the site as well as the secondary entrance.

The locations of the permanent site surveillance features are shown on Figure 2.

2.3.5 Site Geology

The Gas Hills North disposal site is located in the southeastern portion of the Wind River Basin along the western flank of the Dutton Basin Anticline—a northwest-plunging anticline exposing rocks of Precambrian through Tertiary ages. Northeast of the site are the Gas Hills; a series of hogbacks of steeply dipping shale and sandstone located along the north and west flanks of the anticline (NRC 1993).

Major bedrock units in the vicinity of the Gas Hills North site are the Wind River Formation (Eocene) and the Cody Shale (Upper Cretaceous). Figure 4 is a partial stratigraphic column showing the geologic units in the area. The Wind River Formation, which dips to the south and consists of mainly sand and clay lens sequences, exists primarily south of the site. The Cody Shale is the main surface geologic unit in the area from the tailings impoundments to the north. The Fraser Draw alluvium lies directly east of the site.

Generalized Section of the Geologic Formations					
Era	System	Series	Formation (thickness in ft)	Lithology	Occurrence of Groundwater
Cenozoic	Quaternary	Pleistocene	Fraser Draw Alluvial Deposits (0–65)	Fine to coarse sand intermixed with silt and clay.	Yields enough water for stock and domestic supplies; yields may vary depending on seasonal recharge. The quality of the water ranges from suitable for domestic supplies to unsuitable for stock.
	Tertiary	Eocene	Wind River Formation (0–8,000)	Interbedded siltstone, sandstone, and conglomerate containing some carbonaceous shale and thin coal seams.	Large supplies have been developed in the Riverton and Gas Hills areas and could be developed elsewhere, especially along the margin of the basin. Yields small supplies to many widely distributed stock and domestic wells. The quality of water ranges from good for
Mesozoic	Cretaceous	Upper Cretaceous	Cody Shale (3,000–5,000)	Shale containing some sandstone beds in upper half.	Yields only meager supplies of poor-quality water.

Modified after Whitcomb and Lowry (1968)

Figure 4. Partial Stratigraphic Column of the Gas Hills North, Wyoming, Disposal Site

GAS HILLS NORTH, WYOMING

DATE OF CLOSURE:



DECEMBER, 2004

TONS OF TAILINGS:

11,687,854

RADIOACTIVITY:

1,808 Curies Ra-226

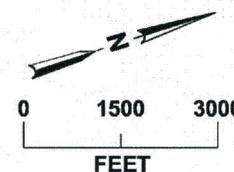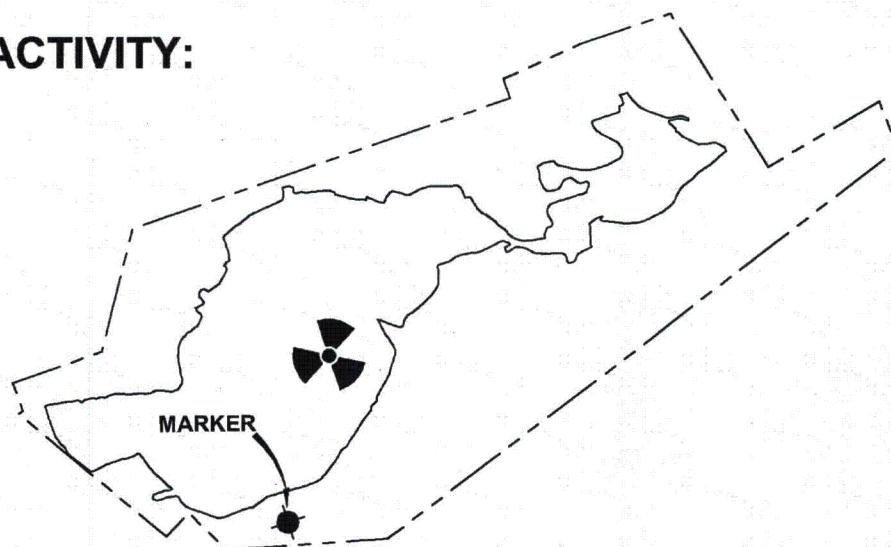

M: \LTS\111\0059\01\S01337\S0133700.DWG 05/09/07 07:54am j50191

Figure 5. Site Marker at the Gas Hills North, Wyoming, Disposal Site

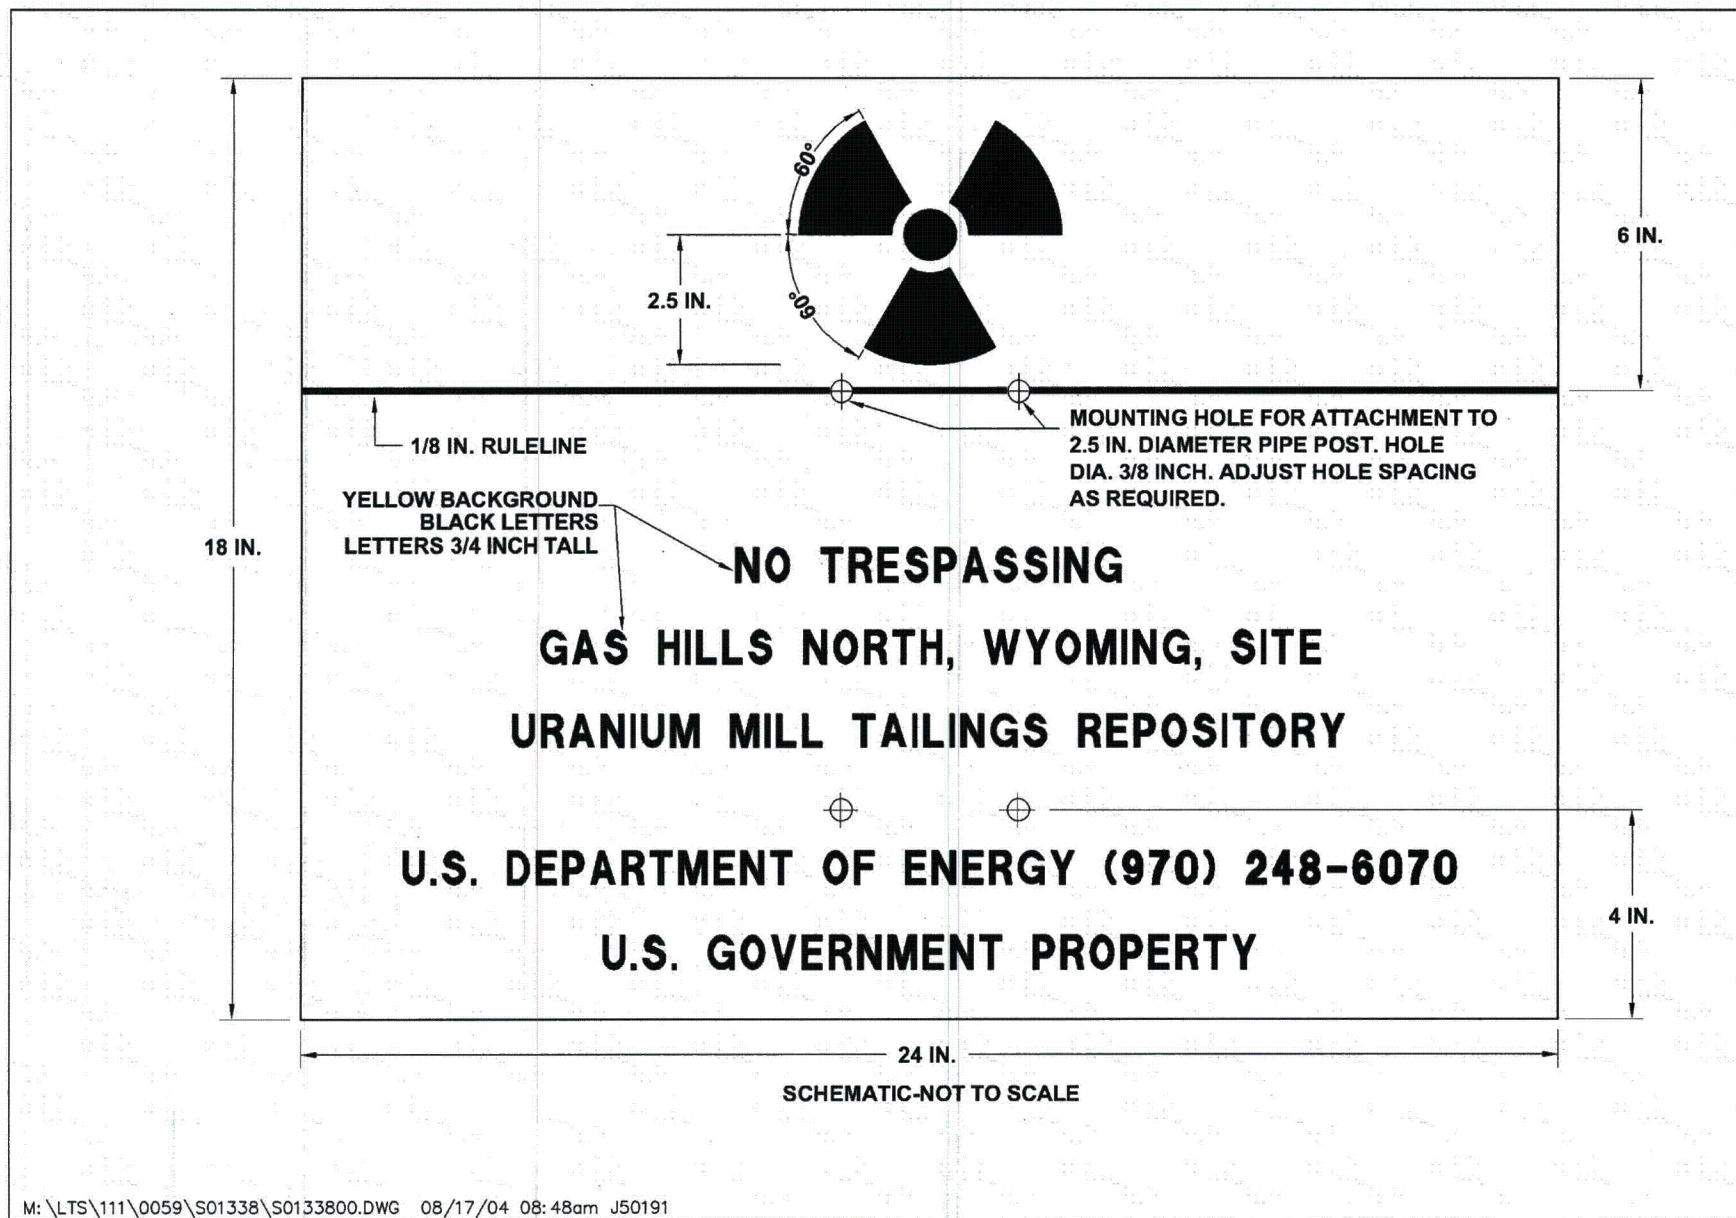


Figure 6. Warning Sign at Gas Hills North, Wyoming, Disposal Site

Near the site, the Wind River Formation consists of a lower member composed of fine-grained siltstones and mudstones with a maximum thickness of 130 ft (40 meters), and an upper member composed of coarser-grained sandstones and conglomerates with a maximum thickness of more than 600 ft (180 meters). The lower, fine-grained member is the geologic unit that underlies portions of the site, including the upper portions of the tailings retention system. The Cody Shale is a massively thick formation of shale with some sandstone layers that acts as an aquitard, which restricts groundwater movement (Hydro-Engineering 2002b). The Cody Shale forms bedrock for most of the tailings retention system (NRC 1993).

All of the economically important uranium deposits in the area occur in the Wind River Formation. The ore was produced from open pit mining operations in the immediate vicinity of the site, primarily directly to the south (Hydro-Engineering 2002b).

2.4 Tailings Impoundments Design

There are six impoundments at the Gas Hills North site. Three of the impoundments, Tailings Ponds 1, 2, and 2A, were used to contain all of the solid tailings generated at the site. Tailings were deposited hydraulically to these ponds. The finer-grained materials were typically carried to the pool area in the center of the ponds where they were deposited as slimes. The transition from coarse to fine-grained materials is gradual. The three remaining impoundments, Solution Ponds 3, 3A, and 4, were used to contain tailings solutions only. All of the impoundments were constructed as embankments across Reid Draw.

All six impoundments were reclaimed in place. A radon barrier, which was derived from Cody Shale and/or Lower Wind River claystone, was placed on Tailings Ponds 1 and 2 and a portion of Tailings Pond 2A, as well as on Solution Ponds 3, 3A, and 4. An engineered drainage channel system was designed and constructed to protect the stabilized tailings ponds from surface water runoff and run-on during catastrophic precipitation events (Hydro-Engineering 2002a).

During 1980 and 1981, Solution Pond No. 4 dam underwent a major reconstruction that entailed excavation down to Cody Shale in order to key the dam into impermeable material; the size of the dam was also expanded. The design of this reconstruction was intended to stop seepage from the impoundments from migrating farther down Reid Draw, acting as a failsafe containment structure for the entire tailings retention system (PMC 1998). Subsequent monitoring of the groundwater indicated no evidence of seepage through the reconstructed dam, based on data from piezometers and water quality from Point-of-Compliance (POC) Well R-2 located in Reid Draw (NRC 1999b). Monitoring of groundwater in Reid Draw was therefore terminated, and POC Well R-2 was decommissioned.

2.4.1 Encapsulation Design

The tailings impoundments were designed and constructed with the objective of isolating the uranium mill tailings and associated tailings solutions from the surrounding environment (PMC 1992b). This was accomplished for each impoundment through the construction of a dam across Reid Draw designed to contain the downgradient flow of waste materials, and a cover designed to reduce radon gas emission rates to below the regulatory standard of 20 picocuries per square meter per second ($\text{pCi}/\text{m}^2/\text{s}$). The cover was also designed to minimizing the infiltration of precipitation that could potentially leach contaminants into the subsurface, and to physically contain the contaminated materials and prevent dispersion.

The RAECOM model (Rogers et al. 1984) was used to design the thickness of the radon-barrier covers required to protect human health and the environment. Based on these results, it was determined that the thickness of the radon barrier would be variable, depending upon the source term of the underlying contaminated materials. Generally, the solid tailings within the impoundments exhibit diminishing radium-226 content from south to north. This is due to the fact that the southerly impoundments, Tailings Impoundments 1 and 2, received tailings from the processing of higher grade ores than did the northernmost impoundment, Tailings Impoundment 2A (Figure 2). The solution ponds and former mill site required less radon barrier material than the tailings impoundments. The final cover also varied in thickness depending upon design gradients for overland flow that occurred in different areas of the disposal system. Therefore, a 3-ft-thick cover was placed on Tailings Impoundments 1 and 2, a 2-ft-thick cover was placed on Tailings Impoundment 2A, and re-graded dam outslopes received a 1.5-ft-thick cover. The radon barrier for Solution Ponds 3, 3A, and 4 varies from 13 inches thick on top to 26 inches thick on the Pond 3 outslope. A 1-ft-thick cover was placed over the ore stockpile area, and a 2-ft-thick cover was placed over the mill area (Hydro-Engineering 1999).

Construction of the cover for both the tailings impoundments and the solution ponds consisted of: (1) a compacted soil layer, comprised of Cody Shale and Lower Wind River claystone obtained from borrow areas located directly east and west of the solution ponds, that was designed to control radon emanation and the minimize the infiltration of precipitation; (2) a filterbed layer, comprised of sand, that was designed as a drainage layer to shed precipitation-related water; and (3) a rock mulch layer, comprised of crushed limestone with a median diameter (D_{50}) ranging in size from 1 inch to 4 inches, that was designed to control erosion on the covered surfaces. Portions of the impoundment tops were also covered with topsoil and seeded with native species.

Deep-rooted vegetation has been allowed to established on the reclaimed tailings impoundments and solution ponds before transition of the site to DOE. The vegetation could change the performance of these disposal cell covers as designed (see Appendix B for additional information regarding potential impacts to conventional low-permeability covers). Maintenance of deep-rooted vegetation on the tailings impoundments and solution ponds is discussed in Section 3.6.2.

A cross section of Tailings Impoundments 1, 2, and 2A is provided as Figure 7, and a cross section of Solution Ponds 3, 3A, and 4 is provided as Figure 8. The surface location of each cross section is shown on Figure 2.

2.4.2 Storm Water Drainage System

The storm water drainage for the site was designed to reduce the surface area of tributary drainage basins in order to lower the potential of erosion by surface runoff. Major drainage areas were divided into smaller basins, and the discharge was routed off the tailings retention system in several directions to peripheral areas. This was accomplished through the construction of numerous riprap-armored channels located around and on top of the tailings impoundments (Figure 2). The Cody Shale borrow areas on either side of the solution ponds were incorporated into the drainage design by utilizing the depressions created as holding basins to dampen runoff events and to aid in diverting runoff away from the encapsulated tailings.

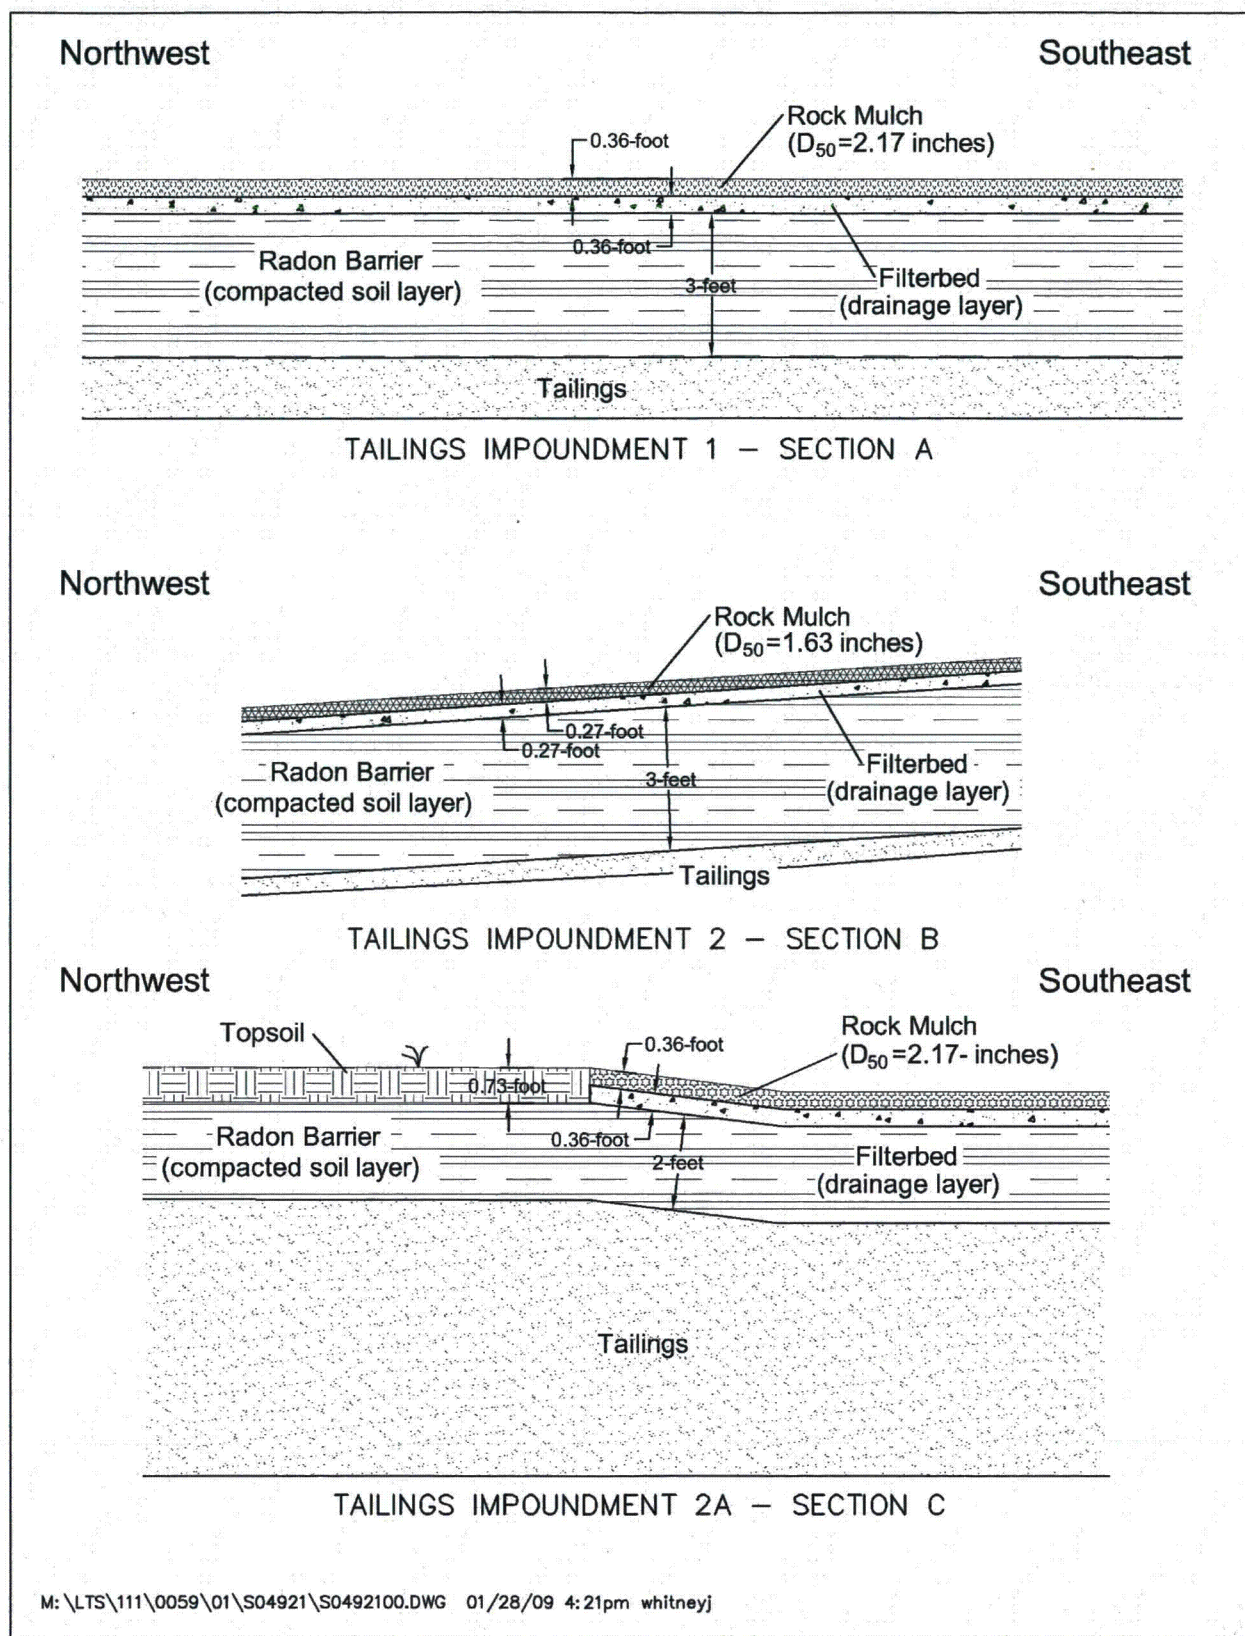


Figure 7. Cross Section of the Engineered Covers on Tailings Impoundments 1, 2, and 2A at the Gas Hills North, Wyoming, Disposal Site

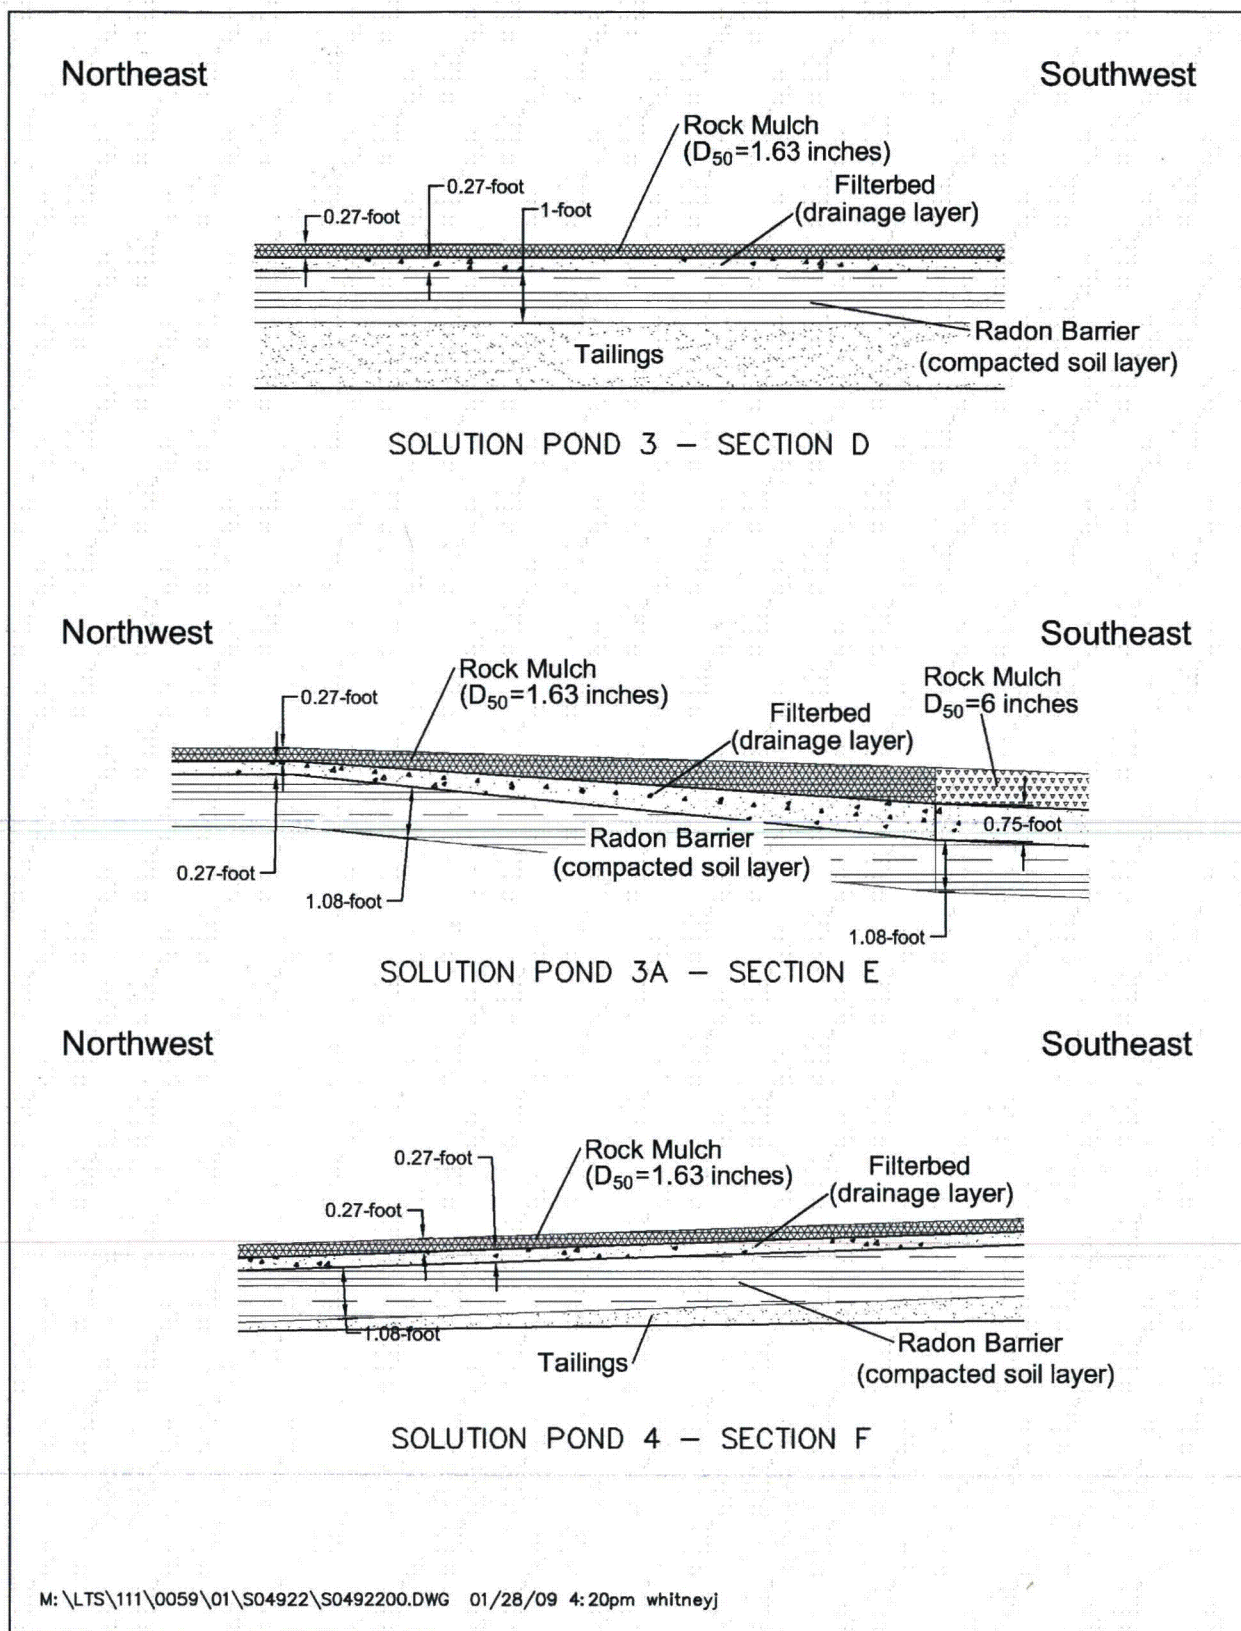


Figure 8. Cross Section of the Engineered Covers on Solution Ponds 3, 3A, and 4 at the Gas Hills North, Wyoming, Disposal Site

Slope grade, riprap-armoring, and the construction of diversion channels were the primary mechanisms for controlling erosion caused by surface water runoff (revegetation was also intended to provide additional erosion control). All riprap sizing was consistent with NRC staff guidance, and the rock utilized for the channels met NRC durability criteria. Riprap armoring was also placed on the steeper slopes and at flow-concentration points where design-flow velocities would have the potential to erode the tailings-encapsulation surfaces. The D_{50} of the riprap utilized on site ranged from 6 inch to 12 inch.

The design basis for the storm water drainage system was the probable maximum flood (PMF). A 1-hour, 1-square-mile storm with a precipitation of 9.70 inches was selected as the design PMF storm event (Hydro-Engineering 1999). Flow velocities and channel inundation profiles from this event were used as the basis for the riprap armoring of the drainage channels. Overland flow paths associated with this PMF storm event were used to design the rock mulch (Hydro-Engineering 1999).

2.5 Groundwater Conditions

The uppermost groundwater at the Gas Hills North disposal site is an unconfined, interconnected flow system composed of both the Wind River aquifer and the Fraser Draw alluvial groundwater system. The Wind River Formation south of the site is the groundwater aquifer that feeds this collective groundwater system.

Both the Wind River Formation and the Cody Shale underlie the tailings retention system; the Wind River Formation underlies the upper portion of the system, and Cody Shale underlies the remaining majority of the system. The Wind River Formation consists mainly of sand and clay-lens sequences. A lower member of the Wind River Formation is composed mainly of clay, the upper surface of which is considered the base of the Wind River aquifer (Hydro-Engineering 2002b). The Cody Shale is a massively thick formation of shale, with some sandstone layers, that acts as an aquitard—restricting vertical groundwater movement (Hydro-Engineering 2002b).

Because of topographic and stratigraphic variability in the vicinity of the site, wells in the monitoring network sample both the Wind River aquifer and Fraser Draw alluvial groundwater system. However, these two units collectively make up the uppermost aquifer at the site and function as a single hydrologic unit referred to as the “Lucky Mc Aquifer” in the ACL application (Hydro-Engineering 2002b). Based on cross sections included in the ACL application for the site, the aquifer material can be as much as 45 ft thick in the vicinity of the site, though only a portion of this is saturated.

In the vicinity of the site, the Wind River aquifer and the Fraser Draw alluvium are bounded laterally by bedrock highs composed of Cody Shale. Channels eroded through the buried highs in the bedrock permit groundwater from the main aquifer south of the site to flow into the adjacent formation, creating relatively isolated occurrences of groundwater. One such occurrence of groundwater, present in the Wind River Formation, underlies the upper portion of the tailings retention system. Groundwater beneath the upper portion of the tailings retention system then flows east through another eroded-bedrock channel and into the Fraser Draw alluvial system, which flows north (Figure 9). However, it is anticipated that over time, as the pore water within the upper portion of the tailings retention system dissipates and the associated groundwater mound is reduced, the groundwater level will drop below the elevation of this eroded subsurface channel in the Cody Shale and cause the flow of seepage from this portion of the tailings retention system into the Fraser Draw alluvial system to discontinue.

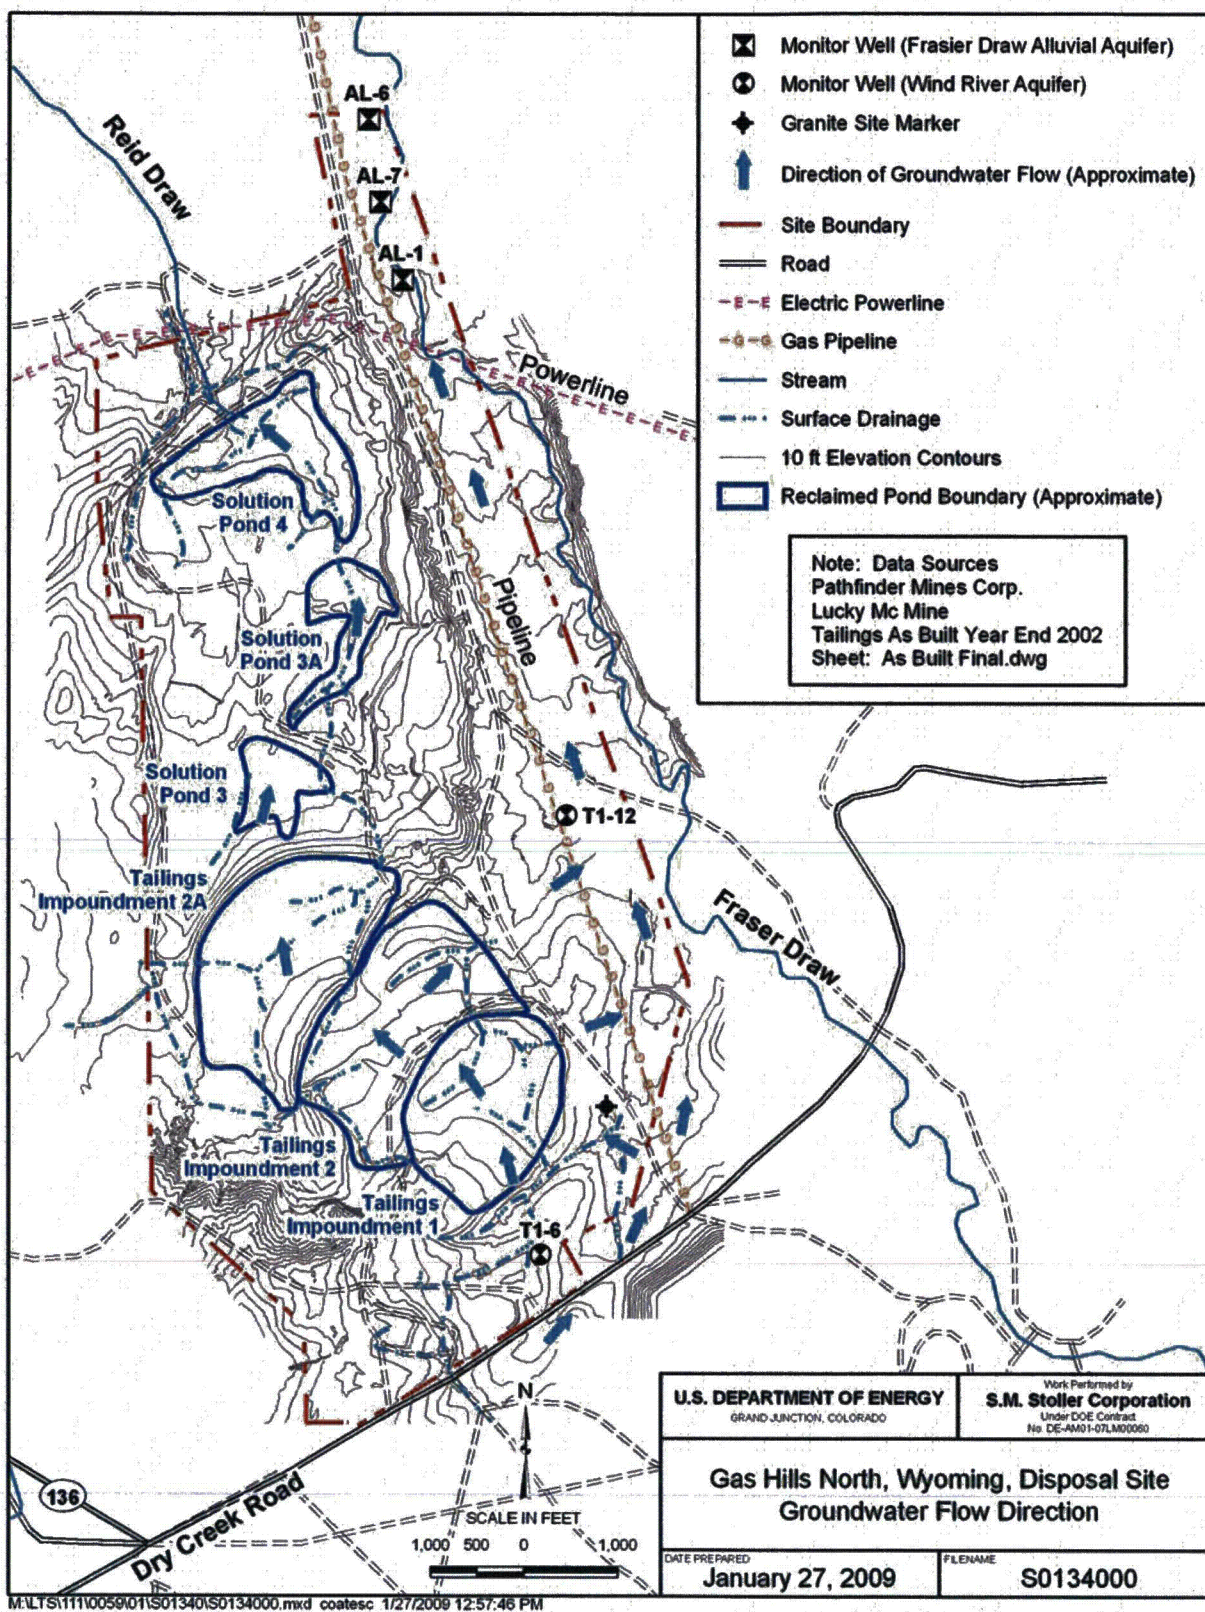


Figure 9. Approximate Groundwater Flow Direction at the Gas Hills North, Wyoming, Disposal Site

Historically, some of the pore water stored in the tailings and solution ponds seeped into the underlying formations, as these ponds were not lined. As mentioned above, seepage that occurred at the upper portion of the tailings retention system entered the Wind River aquifer and flowed east through the eroded channels in the Cody Shale and into the Fraser Draw alluvial system (Figure 9). Any seepage that occurred in the remaining portion of the tailings retention system, downgradient to the eroded channels in the bedrock, would likely have slowly migrated to the base of Solution Pond 4 dam, which was keyed into the Cody Shale to stop any farther migration down Reid Draw. Historical monitoring results obtained from the POC well located directly downgradient of Solution Pond 4 dam demonstrated the effectiveness of the tailings retention system (Hydro-Engineering 2002b).

Seepage from the tailings retention system, which was more voluminous during milling, contains elevated concentrations of process-related chemicals, including uranium, selenium, nickel, combined Ra-226 and Ra-228, arsenic, beryllium, cadmium, chromium, Th-230, chloride, sulfate, nitrate, and total dissolved solids (TDS). Seepage from this system is a source of mill-related groundwater contamination in the area.

Another possible source of site-related contamination, particularly with respect to uranium, is the historical routine and permitted discharge of groundwater from mine dewatering operations that occurred into Fraser Draw (see Section 2.1). Beginning in 2001, groundwater monitoring was conducted beyond the site boundary within Fraser Draw, downgradient of the site. This monitoring continued until the approval to discontinue the off-site monitoring was received from NRC, with concurrence from WDEQ, in 2008 (NRC 2008, WDEQ 2008).

Groundwater contamination that migrated laterally from the upper portion of the tailings retention system and into the Wind River aquifer and the Fraser Draw alluvium was the target of corrective action performed from 1980 until 2002. Corrective action at the site had two objectives: (1) chemical-mass removal in the Wind River aquifer and Fraser Draw alluvium, and (2) dewatering of the tailings responsible for the seepage of process-related chemicals. The groundwater corrective action was effective in removing a substantial portion of the drainable water from the tailings, and at reducing the mass flux of contaminants. However, after considerable pumping, the operator concluded that further significant reductions in the concentrations of uranium, selenium, nickel, combined Ra-226 and Ra-228, beryllium, and cadmium were not readily achievable with continued pumping.

On December 21, 2000, the licensee submitted an ACL application to NRC for these constituents because their concentrations were deemed to be as low as reasonably achievable, considering practicable corrective actions. Based on 2001 data, all of the ACL constituents except uranium and selenium were confined to the groundwater immediately beneath the tailings ponds or immediately adjacent to the tailings in Fraser Draw. In addition to uranium and selenium, some other indicator constituents—chloride, sulfate, nitrate, and TDS—have migrated downgradient (north) within Fraser Draw.

NRC approved the ACL application on December 20, 2002 (NRC 2002), at which time groundwater corrective action was terminated. No restrictions were placed on groundwater use downgradient of the site, as the water quality met applicable standards and criteria for Class III (i.e., suitable for livestock). Class III is the designated State of Wyoming groundwater classification for this area, based on the naturally poor water quality.

This page intentionally left blank

3.0 Long-Term Surveillance Program

3.1 General License for Custody and Long-Term Care

States have right of first refusal for custody and long-term care of Title II disposal sites (UMTRCA, Section 202 [a]). On July 15, 1994, the State of Wyoming exercised its right of first refusal and declined the custody and long-term care of the Gas Hills North site (State of Wyoming 1994). Because the State declined this right, the site was transferred to DOE for custody and long-term care.

Upon NRC acceptance of this LTSP and termination of PMC's license (Number SUA-672), the site is included under NRC's general license for custody and long-term care (10 CFR 40.28 [b]). Concurrent with this action, a deed and title to the portion of the site owned by PMC were transferred to DOE (Appendix A). The balance of the site, which is federally owned, was withdrawn by BLM from public use and placed under DOE's jurisdiction for custody and long-term care (Appendix A).

Although sites are designed to last "for up to 1,000 years, to the extent reasonably achievable, and, in any case, for at least 200 years" (10 CFR 40, Appendix A, Criterion 6), there is no termination of the general license for DOE's custody and long-term care of the site (10 CFR 40.28 [b]).

Should changes to this LTSP become necessary, NRC must be notified of the changes, and the changes may not conflict with the requirements of the general license. Additionally, NRC representatives must be guaranteed permanent right of entry for the purpose of periodic site inspections. Access to the site, as shown on Figure 1 and Figure 2, is unimpeded from public roads across federal property.

3.2 Requirements of the General License

To meet the requirements of NRC's license at 10 CFR 40, Section 28, and Appendix A, Criterion 12, the long-term custodian must, at a minimum, perform the following tasks. The section in the LTSP where each requirement is addressed is given in parentheses.

1. Annual site inspection (Section 3.3).
2. Annual inspection report (Section 3.4).
3. Follow-up inspections and inspection reports, as necessary (Section 3.5).
4. Site maintenance, as necessary (Section 3.6).
5. Emergency measures in the event of catastrophe (Section 3.6).
6. Environmental monitoring (Section 3.7).

3.3 Annual Site Inspections

3.3.1 Frequency of Inspections

At a minimum, sites must be inspected annually to confirm the integrity of visible features at the site and to determine the need, if any, for maintenance, additional inspections, or monitoring (10 CFR 40, Appendix A, Criterion 12).

To meet this requirement, DOE will inspect the Gas Hills North disposal site once each calendar year. The date of the inspection may vary from year to year, but DOE will endeavor to inspect the site approximately once every 12 months unless circumstances warrant variance. Any variance to this inspection frequency will be explained in the inspection report. DOE will notify NRC and the State of Wyoming of the inspection at least 30 days in advance of the scheduled inspection date.

3.3.2 Inspection Procedure

For the purpose of inspection, the Gas Hills North disposal site will be divided into sections called *transects*. Each transect will be inspected individually. Proposed transects for the first inspection of the Gas Hills North site are listed in Table 2 and shown on Figure 10.

Table 2. Transects Used During First Inspection of the Gas Hills North Site

Transect	Inspection Description
Covers, Sideslopes, and Dams of Stabilized Tailings and Solution Ponds	Check integrity of impoundments—cover, sideslopes, dam, and rock mulch. Check for any visual evidence of seepage from the base of Solution Pond No. 4 dam.
Drainage Channels	Check for erosion, riprap placement, integrity, and functionality.
Site Perimeter and Balance of Site	Check integrity of the area between tailings impoundments and solution ponds, the site perimeter, site boundary, perimeter fence and gates, site entrance, boundary monuments, entrance sign, and site marker.
Outlying Area	Check 0.25 mile beyond site boundary for changes in land use.

The annual inspection will be a visual walk-through. The primary purpose of the inspection will be to look for evidence of significant disposal cell settlement, slumping, or cracking; riprap or rock mulch degradation; wind or water erosion; structural discontinuity of the containment dams; vegetation condition (including the presence of noxious weeds); animal or human intrusions that could result in adverse impacts to the site; or other modifying processes that could be detrimental to the performance of the disposal system. Disposal site and disposal cell inspection techniques are described in detail in Attachment 4 of the guidance document (DOE 2001).

Any changes in site vegetation will be noted during routine site inspections. If encroachment of deep-rooted vegetation is observed growing on the tailings impoundments, an assessment will be conducted to determine if any action is necessary. State, local, or federally listed noxious weeds present on site will be controlled.

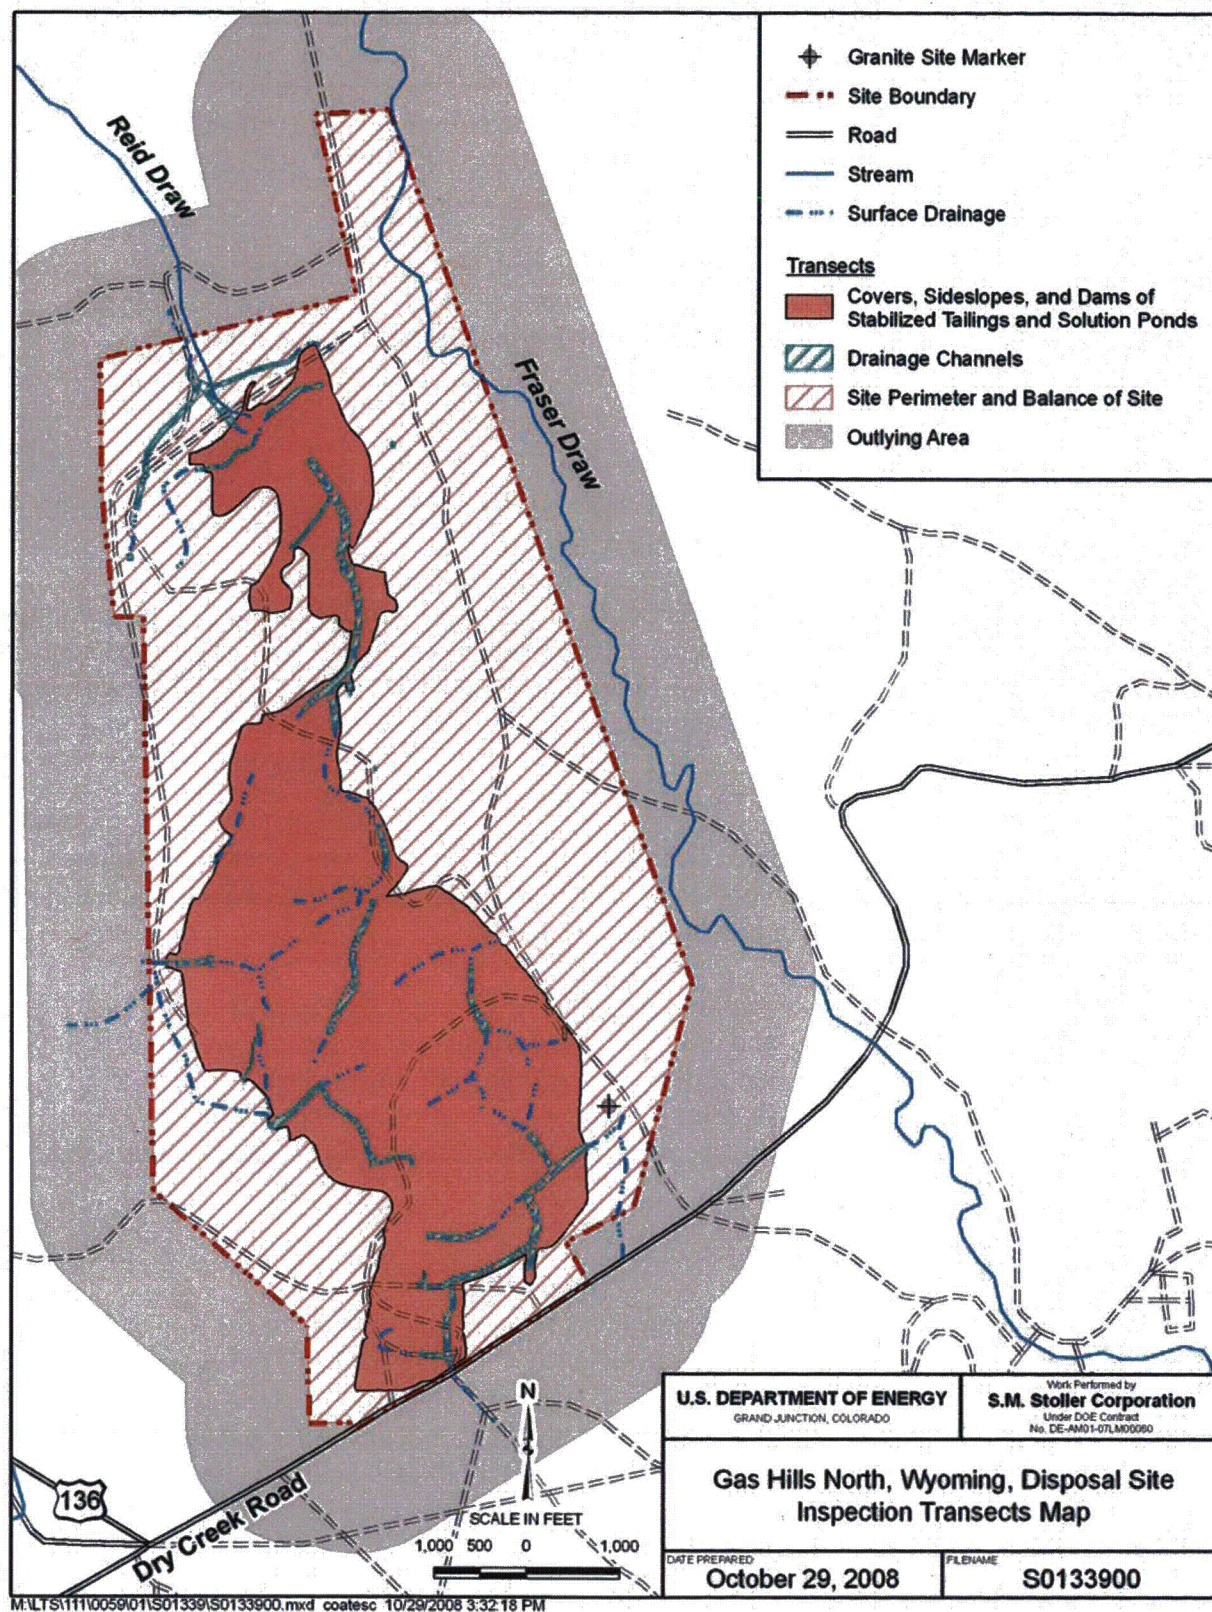


Figure 10. Inspection Transects for the Gas Hills North, Wyoming, Disposal Site

In addition to inspecting the site itself, inspectors will note changes and developments in the area surrounding the site, especially changes within the surrounding watershed basin. Significant changes within this area could include development or expansion of human habitation, erosion, road building, or other change in land use. Changes in land use in the area immediately surrounding the site could affect overland water flow characteristics and general site management considerations. Therefore, they should be evaluated.

It may be necessary to document certain observations with photographs. Observations warranting photographs include evidence of vandalism or a slow modifying process, such as rill erosion, that should be monitored more closely during general site inspections. Photographs will be documented in a field photograph log (Appendix C).

3.3.3 Inspection Checklist

The inspection checklist guides the inspection. The initial site-specific inspection checklist for the Gas Hills North disposal site is presented in Appendix D.

The checklist is subject to revision as necessary. At the conclusion of an annual site inspection, inspectors will make notes regarding revisions to the checklist in anticipation of the next annual site inspection. Revisions to the checklist will include such items as new discoveries or changes in site conditions that must be inspected and evaluated during the next annual inspection.

3.3.4 Personnel

Annual inspections normally will be performed by a minimum of two inspectors. Inspectors will be experienced engineers and scientists who have been specifically trained to conduct site inspections (through participation in previous site inspections).

Engineers typically will be geotechnical, geological, or civil engineers. Scientists will include geologists, hydrologists, biologists, and environmental scientists representing various fields (e.g., ecology, soils, range management). If serious or unique problems develop at the site, more than two inspectors may be assigned to the inspection. Inspectors specialized in specific fields may be assigned to the inspection to evaluate serious or unusual problems and make recommendations.

3.4 Annual Inspection Reports

Results of annual site inspections will be reported to NRC within 90 days of the last site inspection of that calendar year (10 CFR 40, Appendix A, Criterion 12). In the event that the annual report cannot be submitted within 90 days, DOE will notify NRC of the circumstances. Annual inspection reports also will be distributed to the State and any other stakeholders who request a copy. The annual inspection report for the Gas Hills North disposal site is included in a document containing the annual inspection reports for all sites licensed under 10 CFR 40.28.

Results of the groundwater monitoring program will also be included in the annual inspection and monitoring report. DOE will typically provide trends in water quality, in the form of concentration versus time graphs, for all analytes with an ACL (for all wells in the monitoring program); trend graphs for the indicator parameters, chloride, nitrate, sulfate and TDS may also be included. In addition, DOE will provide a table(s) containing groundwater quality data and water level measurements.

3.5 Follow-Up Inspections

Follow-up inspections are unscheduled inspections that are targeted to evaluate specific findings or concerns.

3.5.1 Criteria for Follow-Up Inspections

Criteria necessitating follow-up inspections are described in 10 CFR 40.28 (b)(4). DOE will conduct follow-up inspections should any of the following occur:

- A condition is identified during the annual site inspection or other site visit that requires personnel, perhaps with specific expertise, to return to the site to evaluate the condition.
- DOE is notified by a citizen or outside agency that conditions at the site are substantially changed.
- An extreme natural condition, such as a 6.5-Richter-scale earthquake or a rainfall event of 9.70 inches or more in 1 hour (Hydro-Engineering 1999).

With respect to citizens and outside agencies, DOE will establish and maintain lines of communications with local law enforcement and emergency response agencies to facilitate notification in the event of significant trespass, vandalism, or a natural disaster. Due to the remote location of the Gas Hills North site, DOE recognizes that local agencies may not necessarily be aware of current conditions at the site. However, these agencies will be requested to notify DOE or provide information should they become aware of a significant event that might affect the security or integrity of the site.

DOE may request the assistance of local agencies to confirm the seriousness of a condition before conducting a follow-up inspection or emergency response.

The public may use the 24-hour DOE telephone number posted prominently on the entrance sign to request information or to report a problem at the site.

Once a condition or concern is identified at the site, DOE will evaluate the information and determine whether a follow-up inspection is warranted. Conditions that may require a routine follow-up inspection include changes in vegetation, erosion, storm damage, low-impact human intrusion, minor vandalism, or the need to evaluate, define, or perform maintenance tasks.

Conditions that threaten the safety or the integrity of the disposal site may require a more immediate (non-routine) follow-up inspection. Slope failure, a disastrous storm, a major seismic event, and deliberate human intrusion are among these conditions.

DOE will use a graded approach with respect to follow-up inspections. The urgency of the follow-up inspection will be in proportion to the seriousness of the condition. The timing of the inspection may be governed by seasonal considerations. For example, a follow-up inspection to investigate a vegetation problem may be scheduled for a particular time of year when growing conditions are optimum. A routine follow-up inspection to perform maintenance or to evaluate an erosion problem might be scheduled to avoid significant snow cover.

In the event of “unusual damage or disruption” (10 CFR 40, Appendix A, Criterion 12) that threatens or compromises site safety, security, or integrity, DOE will:

- Notify NRC pursuant to 10 CFR 40, Appendix A, Criterion 12, or 10 CFR 40.60, whichever is determined to apply.
- Begin the DOE Environment, Safety, and Health Reporting Process (DOE Order 231.1A, Chg. 1, or current guidance).
- Respond with an immediate follow-up inspection or emergency response team.
- Implement measures as necessary to contain or prevent the dispersion of radioactive materials (Section 3.6).

3.5.2 Personnel

Inspectors assigned to follow-up inspections will be selected on the same basis as for annual site inspections (see Section 3.3.4).

3.5.3 Reports of Follow-Up Inspections

Results of follow-up inspections will be included in the next annual inspection report (Section 3.4). Separate reports will not be prepared unless DOE determines that it is advisable to notify NRC or another outside agency of a problem at the site.

If follow-up inspections are required for more serious or emergency reasons, DOE will submit to NRC a preliminary report of the follow-up inspection within the required 60 days (10 CFR 40, Appendix A, Criterion 12).

3.6 Routine Site Maintenance and Emergency Measures

3.6.1 Routine Site Maintenance

UMTRCA disposal sites are designed and constructed so that “ongoing active maintenance is not necessary to preserve isolation” of radioactive material (10 CFR 40, Appendix A, Criterion 12). The tailings impoundments, stabilized solution ponds, and associated systems have been designed and constructed to minimize the need for routine maintenance.

The surface of the tailings impoundments and stabilized solution ponds were constructed with minimal slope to promote positive drainage while minimizing runoff water velocities that result in erosion. The surface was covered with rock mulch that is expected to endure for the long term. Because of the rock mulch and mild slopes, adverse wind or water erosion impacts that would require maintenance are not anticipated. The tailings impoundment area is fenced to prevent damage from any livestock grazing in the vicinity and to discourage intentional or unintentional trespassing. Areas where runoff water could achieve erosional velocities have been armored with riprap.

If an inspection of the disposal site cell does reveal that an as-built feature has failed or degraded in such a way that it compromises site protectiveness, repairs will be conducted to reestablish the as-built condition. DOE will perform routine site maintenance, where and when needed, to maintain protectiveness. Results of routine site maintenance will be summarized in the annual site inspection report.

3.6.2 Control of Deep-Rooted Vegetation on Tailings Impoundments

Vegetation, including deep-rooted plants, began establishing on the reclaimed tailings impoundments and solution ponds before regulatory closure of the disposal site occurred. Site documents do not indicate that control of such vegetation is necessary to maintain cell performance. Therefore, monitoring or control of vegetation on the tailings impoundments and solution ponds is not required. DOE will allow the natural succession of native vegetation to proceed on these disposal cell covers and the remainder of the site and will note general vegetation conditions in inspection reports. Additional information regarding vegetation management and cover performance is provided in Appendix B.

3.6.3 Emergency Measures

Emergency measures are the actions that DOE will take in response to unusual damage or disruptions that threaten or compromise site safety, security, or integrity. DOE will contain or prevent the dispersal of radioactive materials in the unlikely event of a breach in impoundment cover materials.

3.6.4 Criteria for Routine Site Maintenance and Emergency Measures

Conceptually, there is a continuum in the progression from minor routine maintenance to the large-scale reconstruction of a tailings impoundment following a potential disaster. Although required by 10 CFR 40.28 (b)(5), criteria for triggering particular DOE responses for each increasingly serious level of intervention are not easily defined because the nature and scale of all potential problems cannot be foreseen. Nevertheless, with regard to identified potentially threatening situations, DOE will evaluate conditions and determine appropriate actions. NRC will be notified of any situation or condition that threatens the integrity of the disposal system and requires corrective action.

The information in Table 3 will, however, serve as a guide for appropriate DOE responses. The table shows that the difference between routine maintenance and emergency response is primarily one of urgency and degree of threat or risk. DOE's priority (urgency) in column 1 of Table 3 bears an inverse relationship with DOE's estimate of probability. The highest priority response is believed to be the least likely to occur.

3.6.5 Reporting Maintenance and Emergency Measures

Routine maintenance completed during the previous 12 months will be summarized in the annual inspection report.

In accordance with 10 CFR 40.60, within 4 hours of discovery of any Priority 1 or 2 event listed in Table 3, DOE will notify the following group at NRC:

- Decommissioning and Uranium Recovery Licensing Directorate, Division of Waste Management and Environmental Protection, Office of Federal and State Materials and Environmental Management Programs, U.S. Nuclear Regulatory Commission.

The telephone number for the required 4-hour notification to the NRC Operations Center is (301) 816-5100.

Table 3. DOE Criteria for Maintenance and Emergency Measures

Priority	Description ^a	Example	Response
1	Breach of disposal impoundments with dispersal of radioactive material.	Seismic event that exceeds design basis and causes massive discontinuity in cover.	Notify NRC. Immediate follow-up inspection by DOE emergency response team. Emergency actions to prevent further dispersal, recover radioactive materials, and repair breach.
2	Breach of disposal impoundments without dispersal of radioactive material.	Partial or threatened exposure of radioactive materials.	Notify NRC. Immediate follow-up inspection by DOE emergency response team. Emergency actions to repair the breach.
3	Breach of site security.	Human intrusion, vandalism.	Restore security; urgency based on assessment of risk.
4	Maintenance of specific site surveillance features.	Deterioration of signs, markers.	Repair at first opportunity.
5	Minor erosion or undesirable changes in vegetation.	Erosion not immediately affecting disposal cell, invasion of undesirable plant species.	Evaluate, assess impact, respond as appropriate to address problem.

^aOther changes or conditions will be evaluated and treated similarly on the basis of risk.

3.7 Environmental Monitoring

3.7.1 Groundwater Monitoring

As discussed in Section 2.5, NRC granted ACLs for uranium, selenium, nickel, combined Ra-226 and Ra-228, beryllium, and cadmium (NRC 2002). The established ACL values and pertinent groundwater protection standards for site-related hazardous constituents and indicator parameters are shown in Table 4, along with modeled concentrations for Point-of-Exposure (POE) Well AL-6 and maximum and 95th percentile background concentrations for the area.

ACLs were established by modeling the maximum predicted concentration of each site-related hazardous constituent and indicator parameter at the designated site POC Well T1-12, downgradient of the tailings impoundments; these maximum concentrations are the ACL values. To determine protectiveness of the ACLs, fate and transport modeling was performed to determine maximum predicted concentrations for each constituent at POE Well AL-6, the downgradient-most monitoring point on the site (Table 4). Because the ambient groundwater is considered to be Class III (i.e., suitable for livestock), human health risks were calculated for ingestion of beef from cows drinking water with maximum predicted POE concentrations (Hydro-Engineering 2002b). All calculated risks were found to be well below acceptable levels, which indicates that compliance with the ACLs at the POC are protective of human health at the POE through the most likely route of exposure (NRC 2002). Furthermore, because these calculations were found to be well below acceptable risk levels, it also indicates that the ACLs are not the maximum concentrations that would still remain protective at the POC (based on risk) and that these values, if exceeded at the POC, do not signal an immediate or possibly even a future threat at the POE.

Table 4. ACLs, Groundwater Protection Standards, Modeled POE Concentrations, and Background Levels for Analytes at the Gas Hills North, Wyoming, Disposal Site

Analyte	ACL	Groundwater Protection Standard	Modeled POE Concentration ^a	Maximum Background Levels ^b (95 th Percentile)
Arsenic ^c		0.05 mg/L ^d 0.2 mg/L ^e		0.012 mg/L (0.004 mg/L)
Beryllium ^c	0.07 mg/L	NA	0.05 mg/L	0.05 mg/L (0.03 mg/L)
Cadmium ^c	0.02 mg/L	0.05 mg/L ^e	0.01 mg/L	0.016 mg/L (0.01 mg/L)
Chromium ^c		0.05 mg/L ^{d,e}		0.05 mg/L (0.04 mg/L)
Nickel	0.85 mg/L	NA	0.15 mg/L	0.39 mg/L (0.15 mg/L)
Ra-226 + Ra-228	7.50 pCi/L	5 pCi/L ^e	5.60 pCi/L	11.0 pCi/L (5.61 pCi/L)
Selenium	1.10 mg/L	0.05 mg/L ^e	0.26 mg/L	0.25 mg/L (0.26 mg/L)
Th-230 ^c		13.2 pCi/L ^f		12.1 pCi/L (2.60 pCi/L)
Uranium	1.70 mg/L	NA	1.17 mg/L	1.75 mg/L (0.91 mg/L)
TDS		5,000 mg/L ^e	4,160 mg/L ^g	
Chloride		2,000 mg/L ^e	187 mg/L	
Nitrate plus nitrite (as N)		10 mg/L ^d 100 mg/L ^e	80 mg/L	
Sulfate		3,000 mg/L ^e	2,080 mg/L	

^a Modeled POE concentrations per ACL application, Table E-2 (Hydro-Engineering 2002b).

^b Background levels per ACL application, Table 1.3-1 (Hydro-Engineering 2002b).

^c Analyte is not included in long-term monitoring unless the trending of other site-related hazardous constituents or indicator parameters warrants re-evaluation.

^d Maximum concentration limit (MCL) per 40 CFR 192; applicable at the POC.

^e Wyoming Class III groundwater protection standard (i.e., suitable for livestock); applicable at the POE.

^f Site-specific standard per ACL application, Table E-1 (Hydro-Engineering 2002b); applicable at the POC.

^g Estimated value – constituent not included in transport model – per ACL application, Section 5.1.3 (Hydro-Engineering 2002b).

pCi/L = picocuries per liter; mg/L = milligram per liter (equivalent to parts per million [ppm]);

NA = not applicable; ACL = alternate concentration limit; POC = point of compliance; POE = point of exposure;

TDS = total dissolved solids.

Note: All analytes listed are considered site-related hazardous constituents per 10 CFR 40, Appendix A, Criterion 5B(2) except chloride, nitrate, sulfate, and TDS, which are considered indicator parameters.

As shown in Table 4, several predicted POE and background concentrations for the listed analytes exceed drinking water standards and, therefore, are not protective for unrestricted groundwater use (i.e., residential use). Although designation by the State as a Class III aquifer does not automatically restrict groundwater use for certain purposes, it is assumed that because of the naturally poor water quality, future use of groundwater for domestic purposes is unlikely. Most of the land downgradient of the site is currently owned by the federal government (BLM), and it is assumed that this will continue into the foreseeable future. For ACLs to remain protective for the site, land use assumptions must remain valid. However, because site-related hazardous constituents downgradient of the property boundary are not present in concentrations distinguishable from background levels, it can be concluded that site-related contaminants do not pose any incremental hazards, regardless of land use.

Since approval of the ACLs in December 2002, all quarterly monitoring results reported concentrations of beryllium and cadmium below the analytical method detection limit or at background concentrations—below their respective ACLs of 0.07 mg/L and 0.02 mg/L (Appendix E). Additionally, since 2002, concentrations of arsenic, chromium, and Th-230 were

all reported below their respective groundwater protection standards of 0.05 mg/L, 0.05 mg/L, and 13.2 pCi/L, or have been within the range of background concentrations as reported from the designated background well T1-6 (Appendix E). Historically, elevated concentrations of these five site-related constituents (beryllium, cadmium, arsenic, chromium, and Th-230) occurred only in the tailings pore water and not in the surrounding groundwater system with one exception: in 1988 Th-230 was reported at 16.1 ± 5.4 pCi/L, just above the established groundwater protection standard of 13.2 pCi/L. Therefore, DOE will analyze groundwater samples under the long-term monitoring program for uranium, selenium, nickel, and combined Ra-226 and Ra-228. In addition, DOE will analyze groundwater samples for TDS, sulfate, chloride, and nitrate plus nitrite (as N) because these parameters are also useful indicators of contaminant migration.

It should be noted that historical groundwater monitoring results for radium (combined Ra-226 and Ra-228) have varied significantly at the wells in the monitoring network, including the background well T1-6 (see trend graphs provided in Appendix E). For example, radium concentrations in background well T1-6, which typically have been in the 2 to 5 pCi/L range, were reported at 1.2 pCi/L in September 2002, 11.8 pCi/L in June 2007, and 7.6 pCi/L in November 2009. Although Ra-226 is contained in the tailings, it also occurs naturally in the Wind River Formation (the host formation for the uranium ore). This formation includes the aquifer in which the background well is completed; the formation is also a source of recharge to the Fraser Draw alluvium. Historical semi-annual groundwater monitoring reports (Hydro-Engineering 2007, 2008a, 2008b, 2009a, 2009b, 2010a) included the following statement regarding this variability in radium concentrations: "Measured radium activities generally exhibit more variability than other constituents, and little significance is given to occasional outliers." It should be noted that this historical variability included radium concentrations reported above the ACL. Indeed, shortly before transition of the site to DOE, radium concentrations were reported above the ACL of 7.5 pCi/L as follows; 8.3 pCi/L in POE well AL-6 (March 2007), 11.8 pCi/L in background well T1-6 (June 2007), 7.7 pCi/L in trend well AL-1 (November 2009), and 7.6 pCi/L in background well T1-6 (November 2009).

Because of the variability in radium concentrations observed historically at the site, particularly with respect to those reported at the designated background well T1-6 (Appendix E, Figure E-8), exceedance of the radium ACL alone is not a reliable indicator of cell performance and is not sufficient cause for considering corrective action. Therefore, DOE will not initiate an evaluative monitoring program until monitoring results indicate that a notable change in the groundwater system has occurred that may indeed reflect unexpected leakage from the cell. This could involve one or more of the following:

- Exceedence of a ground water standard for 3 consecutive annual monitoring events for a given well. This is consistent with the 1-of-3 groundwater compliance sampling strategy discussed in recent EPA guidance (EPA 2009) and is more likely to represent an actual upward trend in concentration rather than a temporary excursion. NRC will be notified of all exceedences of any standard, but a formal evaluation to determine the cause of the exceedance (and any additional actions) would not take place unless 3 consecutive exceedences are observed.
- More than one site-related constituent shows unusual behavior that is inconsistent with established patterns. Based on time-concentration plots (Appendix E), most cell-related constituents display relatively constant concentrations within a fairly narrow range. A

deviation from this could signal unexpected releases from the cell. It is recognized that different constituents have different mobilities and therefore travel times. Chloride and sulfate are generally thought to be most mobile and therefore good indicators of potential cell leakage.

- Other aberrant behavior in groundwater chemistry that cannot be explained based on previously observed trends and ranges of constituent concentrations.

DOE will report monitoring results to NRC annually (the WDEQ site representative will be included on the distribution). DOE will consult with NRC regarding the need to take any additional actions, such as initiating an evaluative monitoring program, in response to an established exceedance of a groundwater protection standard at the site that is clearly site-related. Any subsequent assessment that may result from the exceedance of an established groundwater protection standard at the site will focus on the risks associated with the exceedance.

Table 5 summarizes the long-term groundwater monitoring plan for the Gas Hills North disposal site. The locations of the monitor wells in the groundwater monitoring network are shown on Figure 2. The purpose of the annual sampling is to verify that ACLs for site-related hazardous constituents are not exceeded at the POC, concentrations of site-related hazardous constituents and indicator parameters at the POE remain protective, and DOE remains in compliance with groundwater protection standards at the site boundary. Concentrations of site-related hazardous constituents and indicator parameters at trend and POE wells will be compared to modeled concentrations to assess whether predictions made by the groundwater model are being met.

Table 5. Long-Term Groundwater Monitoring Plan for the Gas Hills North, Wyoming, Disposal Site

Well Designation	Monitoring Frequency	Analytes	Comments
T1-12	Annually	Uranium, selenium, nickel, Ra-226 + Ra-228, TDS, sulfate, chloride, nitrate plus nitrite, pH, electrical conductivity, water level	Farthest upgradient POC well, Wind River aquifer
AL-1	Annually	Uranium, selenium, nickel, Ra-226 + Ra-228, TDS, sulfate, chloride, nitrate plus nitrite, pH, electrical conductivity, water level	Fraser Draw alluvial aquifer trend well between the POC and POE wells
AL-6	Annually	Uranium, selenium, nickel, Ra-226 + Ra-228, TDS, sulfate, chloride, nitrate plus nitrite, pH, electrical conductivity, water level	POE well, Fraser Draw alluvial aquifer at site boundary
AL-7	Annually	Uranium, selenium, nickel, Ra-226 + Ra-228, TDS, sulfate, chloride, nitrate plus nitrite, pH, electrical conductivity, water level	Fraser Draw alluvial aquifer trend well between the POC and POE wells
T1-6	Annually	Uranium, selenium, nickel, Ra-226 + Ra-228, TDS, sulfate, chloride, nitrate plus nitrite, pH, electrical conductivity, water level	Background well, Wind River aquifer

POC = point of compliance; POE = point of exposure; TDS = total dissolved solids.

Note: All analytes listed are considered site-related hazardous constituents per 10 CFR 40, Appendix A, Criterion 5B(2) except chloride, nitrate, sulfate, and TDS which are considered indicator parameters, and pH and electrical conductivity which are considered field parameters.

As established previously (with regard to radium), if any ACL or other applicable groundwater quality standard at the site is exceeded at the POC well, or trends indicate that a groundwater protection standard or the established maximum background concentration will be exceeded at the POE well (i.e., that offsite protectiveness could potentially be compromised), the following actions will be taken:

- DOE will inform NRC (and WDEQ) that a standard has been exceeded and monitoring will be conducted annually for the next two years to confirm the exceedance is not just a temporary excursion and is indeed site-related (i.e., not naturally occurring); all constituents in the long-term monitoring plan (Table 5) will be included in the confirmatory sampling.
- If a standard is exceeded for three consecutive annual monitoring events in any individual well and is determined to be site-related, DOE will develop an evaluative monitoring work plan and submit that plan to NRC for review prior to implementing the evaluative monitoring program.
- The evaluative monitoring program may involve a reassessment of potential risks of each constituent, which would likely include an evaluation of the assumptions and uncertainties used in the risk assessment provided in the ACL application. DOE will examine the behavior of each individual monitored constituent independently to determine if increases or other patterns could be attributed to cell performance or are the result of other, possibly natural, causes. The evaluation will assess the likelihood as to whether the exceedance will impact human health and the environment.
- The evaluative monitoring program could lead to a more detailed groundwater field investigation.
- The evaluative monitoring program will include a determination as to whether it is warranted to reinstate beryllium, cadmium, arsenic, chromium, and Th-230 into the long-term groundwater monitoring program (Table 5).
- The results of the evaluative monitoring program will be used, in consultation with NRC, to determine if; 1) corrective action may be warranted, 2) modifications to the long-term monitoring program are needed, or 3) no further action is required (i.e., long-term monitoring continues without modification).
- DOE will also keep WDEQ informed of any conditions or actions that threaten to impact groundwater quality beyond the site boundary.

Following the establishment of a baseline (i.e., results from the first 5 years of long-term monitoring), the groundwater monitoring program will be evaluated every 5 years to determine if ACLs remain protective and the cell is performing as designed. Additionally, the evaluations will assess whether a change in the monitoring frequency is warranted. For example, the evaluation may recommend that the monitoring frequency and suite of analytical constituents be modified. Modifications to the monitoring program will only occur following NRC concurrence, and will be documented. If the evaluation recommends changes to or discontinuation of the groundwater monitoring program, the LTSP will be revised and submitted to NRC for concurrence.

Groundwater monitoring will be discontinued entirely once the following criteria have been met: 1) trends have established that ACLs will not be exceeded at the POC (i.e., concentrations of site-related constituents have stabilized and remain in compliance); 2) trends have demonstrated

that groundwater constituent levels will remain protective at the POE—no exceedance of groundwater protection standards or concentrations above the established range of background values will occur (i.e., attenuation of site-related contamination is occurring as predicted by the fate and transport modeling presented in the ACL application); and 3) monitoring has demonstrated that the disposal system is performing as designed (i.e., no evidence that additional contamination from the cell is being mobilized). Discontinuing of groundwater monitoring will only occur after NRC technical review and concurrence that doing so is protective of human health and the environment.

Once every 10 years, beginning in the first year following transition, DOE will check the records at the Wyoming State Engineer's Office to determine if there have been significant changes in water demands in the vicinity of the site. Other nearby activities, such as residential developments or uranium exploration and extraction that could affect the groundwater use or conditions in the vicinity of the site will be noted during annual site inspections and subsequently evaluated.

Results of the groundwater monitoring program will be included in the annual inspection report (Section 3.4). Groundwater monitoring results will include time versus concentration graphs for selenium, uranium, combined radium-226 and radium-228, sulfate, chloride, nitrate plus nitrite, nickel, pH, and TDS, along with a hydrograph of water level measurements.

3.7.2 Land Use Monitoring

During each annual site inspection, DOE will monitor land use in the area surrounding the site to ensure that changes in land or water use do not affect site protectiveness. For example, a resurgence of interest in uranium mining and processing could lead to increased activity in the vicinity of the site and an increased potential for site disturbance. Monitoring of local water use will also be performed periodically as mentioned above in Section 3.7.1.

3.7.3 Vegetation Monitoring

Riprap rock was selected as the cover material over the disposal areas on site; however, some areas of the Gas Hills North disposal site were revegetated as part of the site reclamation. Vegetation at the disposal site is expected to help maintain erosional stability. Annual visual inspections will be conducted to verify the continued health of the on-site vegetation and to ensure that undesirable plant species do not proliferate at the site. Natural plant community succession caused by fire or other natural processes is expected and will not adversely impact the performance of the waste containment system.

3.8 Institutional Controls

The Gas Hills North disposal site is owned by the U.S. Government, and DOE protects the site through institutional controls such as deed restrictions, inspections, and appropriate signage. DOE may also use fences and gates to control site access, and does so for this site. Once every 10 years, beginning in 2010, DOE will verify that the property deed remains on file in the Fremont County Courthouse.

3.9 Records

LM receives and maintains selected records to support post-closure site maintenance. Inactive records are preserved at a federal records center. Site records contain critical information required to protect human health and the environment, manage land and assets, protect the legal interests of DOE and the public, and mitigate community impacts resulting from the cleanup of legacy waste.

The records are managed in accordance with the following requirements:

- 44 USC 29, "Records Management by the Archivist of the United States and by the Administrator of General Services"; 44 USC 31, "Records Management by Federal Agencies"; and 44 USC 33, "Disposal of Records."
- 36 CFR 12, Subchapter B, "Records Management."
- DOE Guide 1324.5B, *Implementation Guide*.
- *LM Information and Records Management Transition Guidance*.

3.10 Quality Assurance

All activities related to the surveillance and maintenance of the Gas Hills North site will comply with DOE Order 414.1C, *Quality Assurance* or current guidance. Quality assurance requirements are routinely fulfilled by the use of a work-planning process, standard operating procedures, trained personnel, documents and records maintenance, and assessment activities. Requirements will be transmitted through procurement documents to subcontractors if and when appropriate.

3.11 Health and Safety

Health and safety requirements and procedures for LM activities are consistent with DOE orders, federal regulations, and applicable codes and standards. The DOE Integrated Safety Management process serves as the basis for the contractor's health and safety program.

Specific guidance is contained in the *Office of Land and Site Management Project Safety Plan* (DOE 2007) or current guidance. This Project Safety Plan identifies specific hazards associated with the anticipated scope of work and provides direction for the control of these hazards. During the pre-inspection briefing, personnel are required to review the plan to ensure that they understand the potential hazards and the health and safety requirements associated with the work to be performed.

4.0 References

10 CFR 40. U.S. Nuclear Regulatory Commission, Title 10, Part 40, "Domestic Licensing of Source Material," *Code of Federal Regulations*, January 1, 2008.

36 CFR 12. National Archives and Records Administration, Title 36, Part 12, Subchapter B, "Records Management," *Code of Federal Regulations*, July 1, 2008.

40 CFR 192. U.S. Environmental Protection Agency, Title 40, Part 192, "Health and Environmental Protection Standards for Uranium and Thorium Mill Tailings," *Code of Federal Regulations*, July 1, 2008.

DOE (U.S. Department of Energy), 2001. *Guidance for Implementing the Long-Term Surveillance Program for UMTRCA Title I and Title II Disposal Sites*, prepared by the U.S. Department of Energy, Grand Junction Office, Grand Junction, Colorado, GJO-2001-215-TAR, April.

DOE (U.S. Department of Energy), 2007. *Office of Land and Site Management Project Safety Plan*, DOE-LM/GJ1116-2006, Rev. 0, prepared for the U.S. Department of Energy, Office of Legacy Management, Grand Junction, Colorado, January.

DOE Orders: 231.1A, *Environment, Safety, and Health Reporting*, Chg. 1, August 19, 2005.
414.1C, *Quality Assurance*, June 17, 2005.
450.1A, *Environmental Protection Program*, Chg. 2, June 4, 2008.

Executive Order 13423. *Strengthening Federal Environmental, Energy, and Transportation Management*, January 24, 2007.

ERG (Environmental Restoration Group, Inc.), 1999. *Lucky Mc Mill Site Completion Report*, prepared for Pathfinder Mines Corporation, Mills, Wyoming, February.

EPA (U.S. Environmental Protection Agency), 1974. *Authorization to Discharge Under the National Pollutant Discharge Elimination System*, Permit No. WY-0003131, June 26.

EPA (U.S. Environmental Protection Agency), 2009. *Statistical Analysis of Groundwater Monitoring Data at RCRA Facilities, Unified Guidance*, EPA 530-R-09-007, March.

Hydro-Engineering, 1999. *Lucky Mc Mine Tailings Reclamation Plan Source Material License No SUA-672*, 2 volumes, prepared for Pathfinder Mines Corporation, Lucky Mc Mine, Gas Hills, Wyoming, July.

Hydro-Engineering, 2002a. *Lucky Mc Mine Tailings Reclamation Plan Source Material License No SUA-672*, Addendum 1, Revision 4 (Revised Solution Pond Area Reclamation Design), prepared for Pathfinder Mines Corporation, Lucky Mc Mine, Gas Hills, Wyoming, August.

Hydro-Engineering, 2002b. *Application for Alternate Concentration Limits Pathfinder Mines Corporation, Lucky Mc Mine*, License No. SUA-672, Docket No. 40-2259, prepared for Pathfinder Mines Corporation, Lucky Mc Mine, January.

Hydro-Engineering, 2007. *Semi-Annual Ground-Water Monitoring for Lucky Mc Mine*, prepared for Pathfinder Mines Corporation, Lucky Mc Mine, Gas Hills, Wyoming, July.

Hydro-Engineering, 2008a. *Semi-Annual Ground-Water Monitoring for Lucky Mc Mine*, prepared for Pathfinder Mines Corporation, Lucky Mc Mine, Gas Hills, Wyoming, January.

Hydro-Engineering, 2008b. *Semi-Annual Ground-Water Monitoring for Lucky Mc Mine*, prepared for Pathfinder Mines Corporation, Lucky Mc Mine, Gas Hills, Wyoming, September.

Hydro-Engineering, 2009a. *Semi-Annual Ground-Water Monitoring for Lucky Mc Mine*, prepared for Pathfinder Mines Corporation, Lucky Mc Mine, Gas Hills, Wyoming, January.

Hydro-Engineering, 2009b. *Semi-Annual Ground-Water Monitoring for Lucky Mc Mine*, prepared for Pathfinder Mines Corporation, Lucky Mc Mine, Gas Hills, Wyoming, August.

Hydro-Engineering, 2010a. *Semi-Annual Ground-Water Monitoring for Lucky Mc Mine*, prepared for Pathfinder Mines Corporation, Lucky Mc Mine, Gas Hills, Wyoming, February.

NRC (U.S. Nuclear Regulatory Commission), 1993. *Environmental Assessment for the Proposed Decommissioning and Reclamation of the Pathfinder Lucky Mc Mill and Tailings Ponds*, Docket Number 40-2259, July.

NRC (U.S. Nuclear Regulatory Commission), 1999a. Federal Register Notice; Finding of No Significant Impact—No Action Alternative in Reid Draw, Pathfinder Mines Corporation, Docket Number 40-2259, Volume 64, Page 13239, March 17.

NRC (U.S. Nuclear Regulatory Commission), 1999b. *Technical Evaluation of Environmental Report on Status of Radiological Contamination of Reid Draw at Gas Hills, Wyoming*, License No. SUA-672, Docket No. 40-2259, April 19.

NRC (U.S. Nuclear Regulatory Commission), 2002. Letter to T.W. Hardgrove, Pathfinder Mines Corporation, from D. M. Gillen, Chief, Fuel Cycle Facilities Branch, U.S. Nuclear Regulatory Commission, approving the proposed use of alternate concentration limits for groundwater at Pathfinder Mines Corporation's Lucky Mc Site, December 20.

NRC (U.S. Nuclear Regulatory Commission), 2006. *Review of Pathfinder Lucky Mc Mill Tailings Site Reclamation Completion Report, Amendment No. 69 to Source Materials License SUA-672(TAC LU0099)*, September.

NRC (U.S. Nuclear Regulatory Commission), 2008. *Materials License*, License Number SUA-672, Docket Number 40-2259, Pathfinder Mines Corporation, July (as amended).

PMC (Pathfinder Mines Corporation), 1992a. *Mill Decommissioning Plan, Lucky Mc Mine, Source Material License No. SUA-672*, Docket Number 40-2259, March.

PMC (Pathfinder Mines Corporation), 1992b. *Lucky Mc Mine Tailings Reclamation Plan, Source Material License No. SUA-672*, Volumes I and II, July.

PMC (Pathfinder Mines Corporation), 1998. *Environmental Report: Remediation of Reid Draw Near the Lucky Mc Mill Site*, August (revised November 1998 and February 1999).

PMC (Pathfinder Mines Corporation), 2005. *Lucky Mc Mine Tailings Reclamation Project Completion Report, Source Material License No. SUA-672*, Volumes I and II, April.

Rogers, V.C., K.K. Nielson, and D.R. Kalkwarf, 1984. *Radon Attenuation Handbook for Uranium Mill Tailings Cover Design*, NUREG/CR-3533; PNL-4878; RAE-18-5.

State of Wyoming, 1994. Letter to J. E. Virgona, Project Manager, U.S. Department of Energy, from D. Hemmer, Director, Wyoming Department of Environmental Quality, declining custody of all UMTRCA Title II sites within the State of Wyoming, July 15.

44 USC 29. "Records Management by the Archivist of the United States and by the Administrator of General Services," *United States Code*.

44 USC 31. "Records Management by Federal Agencies," *United States Code*.

44 USC 33. "Disposal of Records," *United States Code*.

WDEQ (Wyoming Department of Environmental Quality), 1978. *Authorization to Discharge Under the National Pollutant Discharge Elimination System*, Permit No. WY-0003131, July 31.

WDEQ (Wyoming Department of Environmental Quality), 2008. Letter to K. I. McConnell, Deputy Director, Decommissioning and Uranium Recovery Licensing Directorate, U.S. Nuclear Regulatory Commission, from M. Thiesse, West District Supervisor, GPC Program, Water Quality Division, Wyoming Department of Environmental Quality, providing concurrence to discontinue offsite groundwater monitoring in Fraser Draw, July 23.

Whitcomb, Harold A., and Marlin E. Lowry, 1968. *Ground-Water Resources and Geology of the Wind River Basin Area, Central Wyoming*, United States Geological Survey Hydrologic Investigations Atlas HA-270.

This page intentionally left blank

Appendix A

Real Estate Information

This page intentionally left blank

Warranty Deed

This page intentionally left blank

DEED OF CONVEYANCE

THIS CONVEYANCE, made this 11th day of June, 2010, between LUCKY MC URANIUM CORPORATION, a Delaware corporation, now known as PATHFINDER MINES CORPORATION (hereinafter "Grantor"), whose address is 935 Pendell Boulevard, Mills, Wyoming 82644, and the UNITED STATES OF AMERICA, of Washington, D.C. (hereinafter the "Grantee"), consists of two sections.

1. **Section 1: Conveyance with General Warranty of Title.** For good and valuable consideration, the receipt of which is hereby acknowledged, Grantor hereby grants, conveys, and warrants unto the Grantee the following described real property (hereinafter the "Subject Lands"):

Parcel 1

Land located in Sections 9, 10, 15, and 22, Township 33 North, Range 90 West, of the Sixth Principle Meridian, Fremont County, Wyoming, as encompassed by Mining Patent No. 49-69-0038, recorded March 11, 1969 in Book 112 of Warranty Deeds, Page 492.

Excepting: A tract of land situated in Section 22, Township 33 North, Range 90 West, Sixth Principle Meridian, Fremont County, Wyoming, more particularly described as all that part of Mining Patent No. 49-69-0038 lying South of a line beginning at DOE Monument PC13 which bears North 0°34' West 150 feet from the Southwest corner of said Patent No. 49-69-0038; thence North 89°27' East 462.16 feet to a point witnessed from 15 feet South 89°30' West by DOE Monument PC 14; thence South 18°08' East 85.92 feet to a point on the south line of said Patent No. 49-69-0038 witnessed from 65 feet North 59°13' East by DOE Monument PC 15.

Further Excepting: All that part of Mining Patent No. 49-69-0038 lying South and East of a line beginning at DOE Monument PC 2 which coincides with Corner No. 1 (NE) of Mill Site No. 50 out of Mineral Survey No. 649; thence South 63°52' West 812.30 feet to DOE Monument PC 1; thence South 27°51' East 274.09 feet to a point on the south line of Mineral Survey No. 645 marked by rebar and 2" aluminum cap.

This parcel contains 524.9 acres, more or less.

Parcel 2

Land located in the East ½ of Section 16, Township 33 North, Range 90 West, of the Sixth Principle Meridian, Fremont County, Wyoming, said parcel being more particularly described as follows: Commence at the Northeast corner of Section 16, the point of beginning of this parcel description; Thence West, 1,422.34 feet along the North line of Section 16, to DOE Monument PC 8; Thence South 05°12' East, 1,326.44 feet to DOE Monument PC 9; Thence North 89°22'11" East, 314.43 feet to DOE Monument PC 10; Thence South 00°18' East, 3,958.38 feet to a point on the south line of said Section 16 marked by rebar with aluminum cap; Thence North 89°48' East, 983.05 feet to the Southeast Corner of said Section 16; Thence North 00°11' West, 5,276.75 feet to the point of the beginning of this described parcel.

This parcel contains 131.1 acres, more or less.

2010-1335061

06/10/2010 11:11:39 AM Page: 1 of 2
DEED \$11.00 Areva
Julie A. Freeze, Fremont County Clerk



The acquiring federal agency is the Department of Energy.

TO HAVE AND TO HOLD the above described premises, together with all and singular the rights and appurtenances thereof to the same belonging or in anywise appertaining to the use, benefit, and behalf of the Grantee, its successors and assigns, forever.

The Grantor, for itself and its successors, does hereby covenant and agree that it will WARRANT AND FOREVER DEFEND title to the above premises unto the Grantee, its successors and assigns, against all and every person or persons claiming the whole or any part thereof, excepting from Grantor's warranty, however, all easements, rights-of-way, restrictions, exceptions, and reservations of recording, including but not limited to reservations or exceptions contained in Patents affecting the Subject Lands or in the acts authorizing the issuance of such Patents and further excepting from Grantor's warranty all existing easements

2. **Section 2. Quitclaim of Certain Interest. FOR THE SAME**
CONSIDERATION SET OUT ABOVE, Grantor, for itself, its successors and assigns, hereby releases and quitclaims to the Grantee, all right, title, and interest which the Grantor may have in the banks, beds, and waters of any streams bordering the Subject Lands, and also all interest in alleys, roads, streets, ways, strips, gores, or railroad rights of abutting or adjoining said land and in any means of ingress or egress appurtenant thereto.

IN WITNESS WHEREOF, the Grantor has executed this Deed of Conveyance on the date set forth above.

Lucky Mc Uranium Corporation, a Delaware
Corporation, now known as Pathfinder Mines
Corporation

O. Thoumyre
By: Olivier Thoumyre
Treasurer, Pathfinder Mines Corporation

ACKNOWLEDGMENT

State of MARYLAND)
County of MONTGOMERY) ss

2010-1335061
06/10/2010 11:11:30 AM Page: 2 of 2
DEED 311.00 Dollars
Julie A. Freese, Fremont County Clerk


 
Before me, the undersigned, a Notary Public in and for said County and State, on this day personally appeared Olivier Thoumyre, as Treasurer of Pathfinder Mines Corporation, known to me to be the person whose name is subscribed to the foregoing instrument, and acknowledged to me that he executed the same in the capacity therein stated on behalf of Pathfinder Mines Corporation.

Given Under My Hand and Seal of Office this 11th day of JUNE, 2010.

Steven H. Bullock
Notary Public

My Commission Expires:

JUNE 28 2014

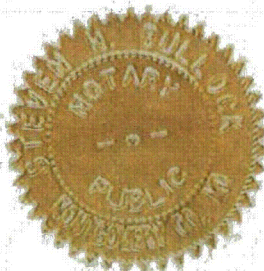

Public Land Order
(Federal Register Notice of Permanent Withdrawal)
(to be inserted upon receipt)

This page intentionally left blank

Site Legal Description

This page intentionally left blank

Legal Description of Site Boundary

The legal description of the 1,276-acre Gas Hills North disposal site follows:

A parcel of land located in the SE $\frac{1}{4}$ of Section 9, the NW $\frac{1}{4}$, SW $\frac{1}{4}$, and the SE $\frac{1}{4}$ of Section 10, Section 15, the NE $\frac{1}{4}$ and the SE $\frac{1}{4}$ of Section 21, and Section 22, all in Township 33 North, Range 90 West, of the 6th Principal Meridian, Fremont County, Wyoming, said parcel being more particularly described as follows:


Beginning at a point on the east line of section 21, N. 0° 42' W., 2169.70 feet from the southeast corner of said section;
Thence N. 47° 52' W., 1328.11 feet to DOE monument PC 11;
Thence N. 0° 18' W., 2211.31 feet to a point on the south line of section 16, monumented with a rebar and aluminum cap;
Thence N. 89° 48' E., 983.05 feet on the south line of section 16 to the southeast corner of said section, point not monumented;
Thence N. 0° 10' W., 5276.75 feet on the east line of section 16 to the northeast corner of said section, point not monumented;
Thence WEST, 1422.34 feet on the south line of section 9 to DOE monument PC8;
Thence N. 0° 05' W., 1445.37 feet to DOE monument PC 7;
Thence N. 76° 35' E., 1438.94 feet to a point on the east line of section 9, N. 0° 48' W., 1779.53 feet from the southeast corner of said section; point not monumented;
Thence N. 76° 35' E., 1387.16 feet to DOE monument PC 6;
Thence N. 12° 00' W., 1992.53 feet to DOE monument PC 5;
Thence N. 87° 28' E., 796.55 feet to DOE monument PC 4;
Thence S. 18° 29' E., 4337.37 feet to a point on the north line of section 15, N. 87° 26' W., 2124.35 feet from the northeast corner of said section, monumented with a 2 $\frac{1}{2}$ " iron pipe with 1973 BLM brass cap;
Thence S. 18° 29' E., 5580.17 feet to DOE monument PC 3 on the north line of section 22, N. 89° 29' W., 400.17 feet, from the northeast corner of section 22, monumented with a 2 $\frac{1}{2}$ " iron pipe with 1973 BLM brass cap;
Thence S. 15° 02' W., 2499.09 feet to DOE monument PC 2, identical with Corner No. 1, Mill Site No. 50, Mineral Survey No. 649;
Thence S. 63° 52' W., 812.30 feet to DOE Monument PC 1;
Thence S. 27° 51' E., 274.09 feet to a point on the south line of Mineral Survey No. 645 monumented with a rebar and aluminum cap;
Thence departing said Mineral Survey 649, S.27° 51' E., 211.41 feet to WC for DOE monument PC 16;
Thence S.27° 51' E., 20.00 feet to true point for DOE monument PC 16; point not monumented;
Thence S. 56° 48' W., 667.38 feet to DOE monument PC 12, identical with Corner No.3, Mill Site 183, Mineral Survey No. 645;
Thence continuing along the south line of Mineral Survey No. 645, S. 59° 13' W., 2244.61 feet to WC for DOE monument PC 15;
Thence S. 59° 13' W., 65.00 feet to true point for DOE monument PC 15, point not monumented;
Thence N. 18° 08' W., 85.92 feet to true point for DOE monument PC 14, point not monumented;

Thence S. $89^{\circ} 27'$ W., 15.00 feet to WC for DOE monument PC 14;
Thence S. $89^{\circ} 27'$ W., 447.16 feet to DOE monument PC 13 on the west line of Mineral Survey No. 645, N. $0^{\circ} 34'$ W., 150.00 feet from Corner No. 1, Mill Site No. 190, Mineral Survey No. 645, point not monumented;
Thence N. $0^{\circ} 34'$ W., on the west line of Mineral Survey 645, 1048.64 feet to Corner No. 1 Mill Site 189 and Corner No. 1, Mill Site No. 177 Mineral Survey No. 645;
Thence departing said Mineral Survey 645, N. $47^{\circ} 52'$ W., 861.73 feet to the POINT OF BEGINNING of said described parcel;

Basis of bearings being True North.

Pre-Transition Land Ownership and Use Map

This page intentionally left blank

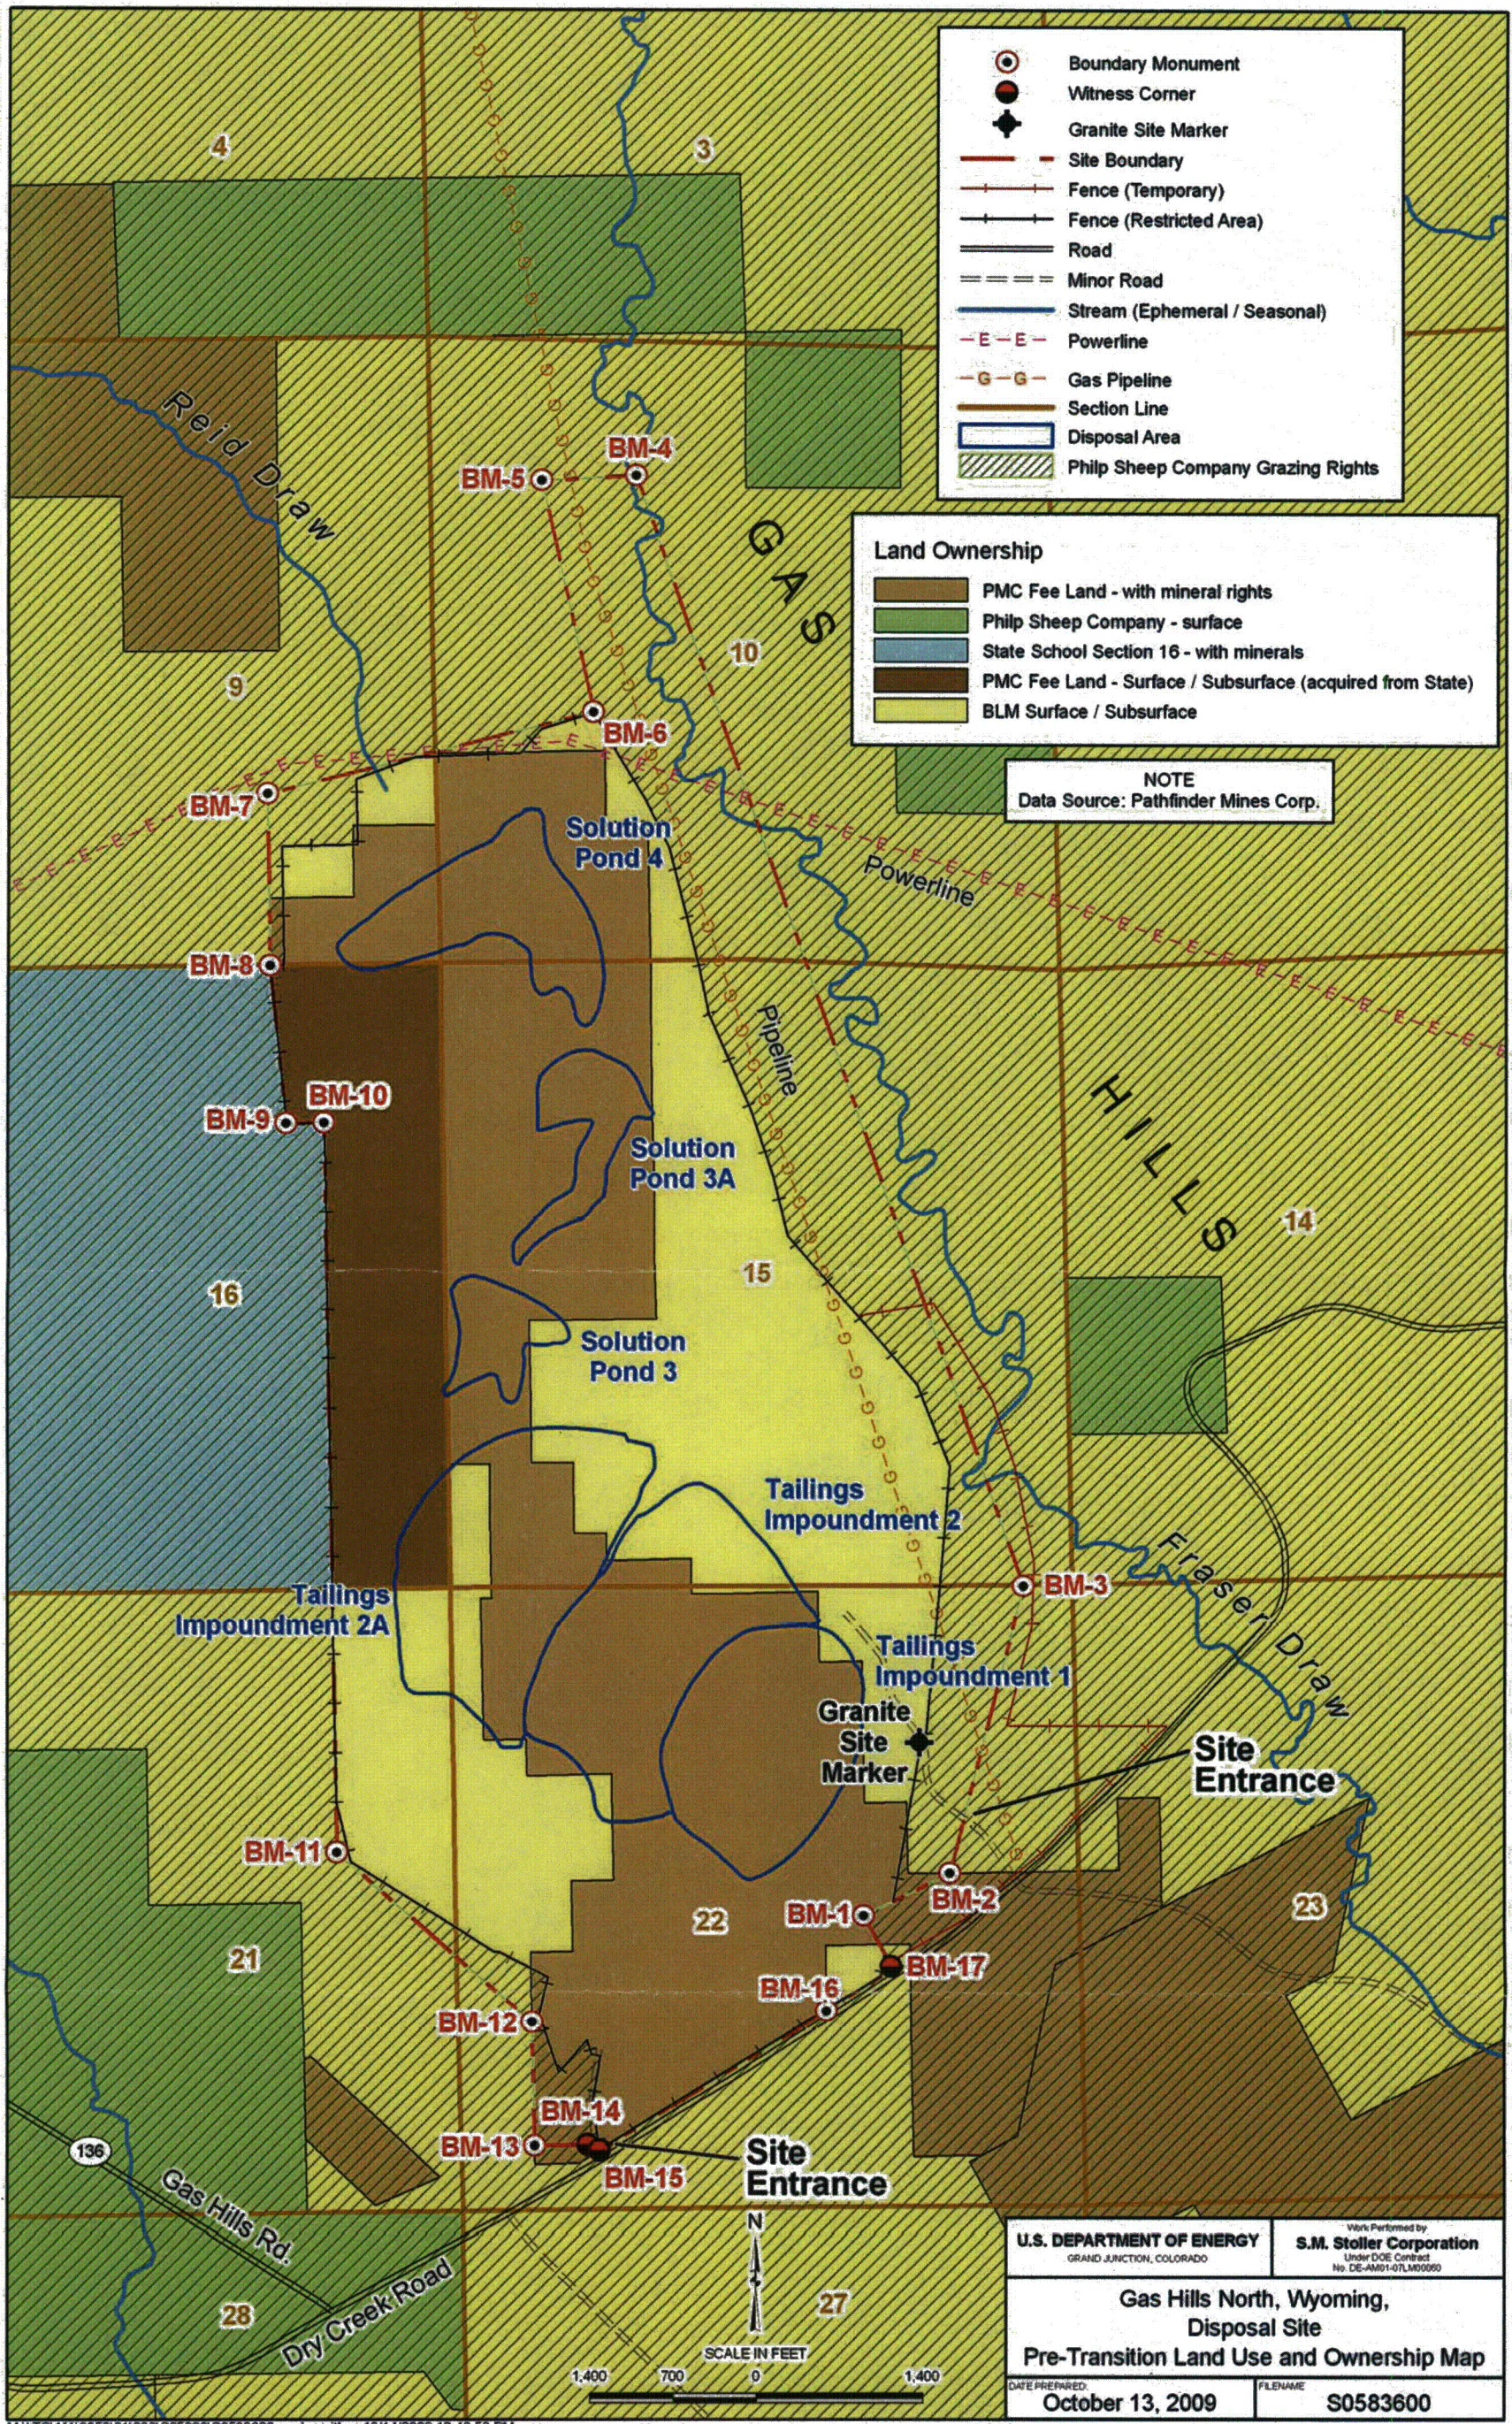

This page intentionally left blank