

**Virginia Electric and Power Company
North Anna Power Station
1022 Haley Drive
Mineral, Virginia 23117**

December 20, 2013

Attention: Document Control Desk
U. S. Nuclear Regulatory Commission
Washington, DC 20555-0001

Serial No.: 13-574A
NAPS: MPW
Docket No.: 50-338
License No.: NPF-4

Dear Sirs:

Pursuant to 10CFR50.73, Virginia Electric and Power Company hereby submits the following Supplemental Licensee Event Report applicable to North Anna Power Station Unit 1.

Report No. 50-338/2013-001-01

This report has been reviewed by the Facility Safety Review Committee and will be forwarded to the Management Safety Review Committee for its review.

Sincerely,



Gerald T. Bischof
Site Vice President
North Anna Power Station

Enclosure

Commitments contained in this letter: None

cc: United States Nuclear Regulatory Commission
Region II
Marquis One Tower
245 Peachtree Center Ave., NE, Suite 1200
Atlanta, Georgia 30303-1257

NRC Senior Resident Inspector
North Anna Power Station

IE22
NRR

LICENSEE EVENT REPORT (LER)

(See reverse for required number of
digits/characters for each block)

Estimated burden per response to comply with this mandatory collection request: 80 hours. Reported lessons learned are incorporated into the licensing process and fed back to industry. Send comments regarding burden estimate to the FOIA/Privacy Section (T-5 F53), U.S. Nuclear Regulatory Commission, Washington, DC 20555-0001, or by internet e-mail to infocollects.resource@nrc.gov, and to the Desk Officer, Office of Information and Regulatory Affairs, NEOB-10202 (3150-0104), Office of Management and Budget, Washington, DC 20503. If a means used to impose an information collection does not display a currently valid OMB control number, the NRC may not conduct or sponsor, and a person is not required to respond to, the information collection.

1. FACILITY NAME

North Anna Power Station, Unit 1

2. DOCKET NUMBER

05000 338

3. PAGE

1 OF 4

4. TITLE

Unit 1 Emergency Diesel Generators Inoperable During Core Alterations

5. EVENT DATE

MONTH	DAY	YEAR
09	26	2013

6. LER NUMBER

YEAR	SEQUENTIAL NUMBER	REV NO.
2013	-- 001 --	01

7. REPORT DATE

MONTH	DAY	YEAR
12	20	2013

8. OTHER FACILITIES INVOLVED

FACILITY NAME	DOCUMENT NUMBER
	05000
FACILITY NAME	DOCUMENT NUMBER
	05000

9. OPERATING MODE

6

11. THIS REPORT IS SUBMITTED PURSUANT TO THE REQUIREMENTS OF 10 CFR §: (Check all that apply)

- | | | | |
|---|---|---|---|
| <input type="checkbox"/> 20.2201(b) | <input type="checkbox"/> 20.2203(a)(3)(i) | <input type="checkbox"/> 50.73(a)(2)(i)(C) | <input type="checkbox"/> 50.73(a)(2)(vii) |
| <input type="checkbox"/> 20.2201(d) | <input type="checkbox"/> 20.2203(a)(3)(ii) | <input type="checkbox"/> 50.73(a)(2)(ii)(A) | <input type="checkbox"/> 50.73(a)(2)(viii)(A) |
| <input type="checkbox"/> 20.2203(a)(1) | <input type="checkbox"/> 20.2203(a)(4) | <input type="checkbox"/> 50.73(a)(2)(ii)(B) | <input type="checkbox"/> 50.73(a)(2)(viii)(B) |
| <input type="checkbox"/> 20.2203(a)(2)(i) | <input type="checkbox"/> 50.36(c)(1)(i)(A) | <input type="checkbox"/> 50.73(a)(2)(iii) | <input type="checkbox"/> 50.73(a)(2)(ix)(A) |
| <input type="checkbox"/> 20.2203(a)(2)(ii) | <input type="checkbox"/> 50.36(c)(1)(ii)(A) | <input type="checkbox"/> 50.73(a)(2)(iv)(A) | <input type="checkbox"/> 50.73(a)(2)(x) |
| <input type="checkbox"/> 20.2203(a)(2)(iii) | <input type="checkbox"/> 50.36(c)(2) | <input type="checkbox"/> 50.73(a)(2)(v)(A) | <input type="checkbox"/> 73.71(a)(4) |
| <input type="checkbox"/> 20.2203(a)(2)(iv) | <input type="checkbox"/> 50.46(a)(3)(ii) | <input type="checkbox"/> 50.73(a)(2)(v)(B) | <input type="checkbox"/> 73.71(a)(5) |
| <input type="checkbox"/> 20.2203(a)(2)(v) | <input type="checkbox"/> 50.73(a)(2)(i)(A) | <input type="checkbox"/> 50.73(a)(2)(v)(C) | <input type="checkbox"/> OTHER |
| <input type="checkbox"/> 20.2203(a)(2)(vi) | <input checked="" type="checkbox"/> 50.73(a)(2)(i)(B) | <input type="checkbox"/> 50.73(a)(2)(v)(D) | |

Specify in Abstract below
or in NRC Form 366A

12. LICENSEE CONTACT FOR THIS LER

FACILITY NAME

Gerald T. Bischof, Site Vice President

TELEPHONE NUMBER (Include Area Code)

(540) 894-2101

13. COMPLETE ONE LINE FOR EACH COMPONENT FAILURE DESCRIBED IN THIS REPORT

CAUSE	SYSTEM	COMPONENT	MANU- FACTURER	REPORTABLE TO EPIX	CAUSE	SYSTEM	COMPONENT	MANU- FACTURER	REPORTABLE TO EPIX

14. SUPPLEMENTAL REPORT EXPECTED

☐ YES (If yes, complete 15. EXPECTED SUBMISSION DATE) ☐ NO15. EXPECTED
SUBMISSION
DATE

MONTH	DAY	YEAR

ABSTRACT (Limit to 1400 spaces, i.e., approximately 15 single-spaced typewritten lines)

On September 26, 2013, at 1717 hours with Unit 1 in Mode 6, zero percent power, core alterations began with two inoperable emergency diesel generators. One emergency diesel generator (1J EDG), in a two train system, was out of service for maintenance with the second emergency diesel generator (1H EDG) inoperable, but unknown at the time. A subsequent failure of the 1H EDG during a 24 hour run, parallel to the grid, determined prior inoperability. Technical Specifications 3.8.2 requires one operable qualified circuit between the offsite transmission network and the onsite Class 1E AC electrical power distribution subsystem(s) required by TS 3.8.10 and one OPERABLE EDG. Momentary loss of control power to the Digital Reference Unit (DRU) caused it to reset to the 60 HZ setting which unloaded the EDG. A loose fuse holder caused the momentary loss of control power. This event is reportable per 10 CFR 50.73(a)(2)(i)(B) for a condition prohibited by Technical Specifications. One qualified circuit between the offsite transmission network and the onsite Class 1E AC electrical power distribution subsystem(s), required by TS 3.8.10, was OPERABLE and the station blackout EDG was also available. Additionally, had a loss of offsite power occurred, the 1H EDG would have been able to supply power in the isochronous mode to the emergency bus. Therefore, the health and safety of the public were not affected by the event.

LICENSEE EVENT REPORT (LER)
CONTINUATION SHEET

1. FACILITY NAME NORTH ANNA POWER STATION UNIT 1	2. DOCKET 05000 - 338	6. LER NUMBER			3. PAGE 2 OF 4
		YEAR 2013	SEQUENTIAL NUMBER --001 --	REV NO. 01	

NARRATIVE

1.0 DESCRIPTION OF THE EVENT

On September 26, 2013, at 1717 hours with Unit 1 in Mode 6, zero percent power, a condition prohibited by Technical Specifications (TS) occurred when reactor core alterations began with one emergency diesel generator (1J EDG), in a two train system, out of service for maintenance with the second emergency diesel generator (1H EDG) (EIS System EK, Component DG) inoperable, but unknown at the time. A subsequent failure of the 1H EDG determined prior inoperability. Technical Specifications 3.8.2 requires one qualified circuit between the offsite transmission network and the onsite Class 1E AC electrical power distribution subsystem(s) required by TS 3.8.10 and one OPERABLE EDG.

On September 24, 2013 the 1H EDG was returned to service and declared operable following post maintenance testing (PMT) for a design change modification of the governor control system. Parts installed by the Design Change included a 2301A Load Sharing and Speed Control, a Digital Reference Unit (DRU) and an EGB-13P Governor/Actuator.

On September 24, 2013 the 1J EDG was removed from service for maintenance. Reactor core reload commenced on September 26, 2013 and completed on September 28, 2013. During this time the 1H EDG was relied upon as the OPERABLE EDG to meet TS. Subsequently on October 3, 2013 at 1115 hours, the 1J EDG was declared operable following repairs and PMT.

On October 5, 2015 at 0828 hours, the 1H EDG was started for a twenty four hour periodic test run. On October 6, 2013 at 0006 hours, 1H EDG experienced a loss of load with local indication showing the fuel racks moved to a lower fuel output. The 1H EDG was secured and declared inoperable.

The failure of the governor control system occurred with the 1H EDG parallel to the grid under 24-hour load testing. Assuming a complete and permanent loss of control power to the 2301A Electronic Governor and DRU, the mechanical governor would have operated at the high speed stop at 63 Hz per design.

However, a momentary loss of power to the Electronic Governor and DRU, due an internal issue in the DRU electronics, a loose wiring connection, or a loose fuse holder would have resulted in the DRU resetting to 900 RPM / 60 Hz set point. The 900 RPM / 60 Hz set point is the reference value used in isochronous mode of operation (design basis function for the EDG).

A complete loss of power or momentary power interruption to the 2301A and DRU would not have prevented the 1H EDG from supplying emergency electrical power during a loss of offsite power to the emergency bus in the isochronous mode. However, the 1H EDG was unable to fulfill its design function since the 1H EDG could not meet TS Surveillance Requirement 3.8.1.15. Synchronization with the offsite power source while loaded with emergency loads upon a simulated restoration of offsite power and the ability to transfer

LICENSEE EVENT REPORT (LER)
CONTINUATION SHEET

1. FACILITY NAME NORTH ANNA POWER STATION UNIT 1	2. DOCKET 05000 - 338	6. LER NUMBER			3. PAGE 3 OF 4
		YEAR 2013	SEQUENTIAL NUMBER --001 --	REV NO. 01	

NARRATIVE

loads to offsite power could not be performed to satisfy the TS surveillance requirement.

2.0 SIGNIFICANT SAFETY CONSEQUENCES AND IMPLICATIONS

No significant safety consequences resulted from this event since one OPERABLE qualified circuit between the offsite transmission network and the onsite Class 1E AC electrical power distribution subsystem(s), required by TS 3.8.10, was available and the station blackout EDG was also available to supply power if required. Additionally, had a loss of offsite power occurred, the 1H EDG would have been able to supply power to the emergency bus. As such, the health and safety of the public were not affected by the event. This event is reportable per 10 CFR 50.73(a)(2)(i)(B) for a condition prohibited by Technical Specifications.

3.0 CAUSE

The direct cause for the complete loss of electrical load of the 1H EDG during 24-hour testing was the momentary loss of electrical control power to the DRU. The apparent cause for the momentary loss of electrical control power to the DRU was a loose fuse holder due to numerous removal and re-installation evolutions during design change implementation, testing, and troubleshooting. This lead to the spreading of the fuse clips. The final installation of the fuse prior to the 24-hour test run was performed by a supplemental electrician not familiar with normal expectations for verification of tightness.

4.0 IMMEDIATE CORRECTIVE ACTION(S)

Following the loss of load the 1H EDG was tripped from the Control Room.

5.0 ADDITIONAL CORRECTIVE ACTIONS

The 1H EDG mechanical actuator, DRU, and power supply fuse holder for fuse FU1NA were subsequently replaced. All wiring connections were verified tight. Post maintenance testing was performed under 1-PT-82.12H, 1H Diesel Generator Isochronous Mode (Start by ESF Actuation) and 1-PT-83.12H, 1H Diesel Generator Test (Start by ESF Actuation) followed by 24-hour run and hot restart test. Post maintenance testing was completed satisfactorily.

The mechanical governor and DRU removed from the 1H EDG were sent to a vendor for testing. The mechanical governor and DRU were found to operate properly following 24-hour bench testing. A loose power supply fuse holder (fuse holder for FU1NA) to the 2301A Load Sharing and Speed Control and DRU was also identified. Vendor testing has verified that a momentary loss of electrical power to the DRU would result in a loss of load event.

**LICENSEE EVENT REPORT (LER)
CONTINUATION SHEET**

1. FACILITY NAME NORTH ANNA POWER STATION UNIT 1	2. DOCKET 05000 - 338	6. LER NUMBER <table border="1"> <tr> <td data-bbox="1047 239 1154 275">YEAR</td> <td data-bbox="1154 239 1300 275">SEQUENTIAL NUMBER</td> <td data-bbox="1300 239 1412 275">REV NO.</td> </tr> <tr> <td data-bbox="1047 275 1154 310">2013</td> <td data-bbox="1154 275 1300 310">--001 --</td> <td data-bbox="1300 275 1412 310">01</td> </tr> </table>	YEAR	SEQUENTIAL NUMBER	REV NO.	2013	--001 --	01	3. PAGE 4 OF 4
YEAR	SEQUENTIAL NUMBER	REV NO.							
2013	--001 --	01							

NARRATIVE

6.0 ACTIONS TO PREVENT RECURRENCE

Guidance for verification of fuse clip tightness and inspection, as part of fuse removal and replacement, will be documented in Maintenance Operating Procedures. Guidance for fuse and fuse clip inspection expectations for supplemental personnel will be documented in the governing administrative procedure. Training needs for electrical maintenance activities with regards to installing fuses, inspecting fuse holders and verification of adequately securing fuses is being evaluated. The results will be provided to the Maintenance Training Review Board for inclusion in Electrical Maintenance Training. A time based preventive maintenance replacement strategy for EDG system fuse holders is being evaluated. These actions have been entered in the Station's Corrective Action System.

7.0 SIMILAR EVENTS

None.

8.0 ADDITIONAL INFORMATION

Unit 2 was operating in Mode 1, 100 percent power, and was not affected by this event.