

REGULATOR INFORMATION DISTRIBUTION ITEM (RIDS)

ACCESSION NBR: 9611260192 DOC. DATE: 96/11/19 NOTARIZED: NO DOCKET #
 FACIL: 50-261 H.B. Robinson Plant, Unit 2, Carolina Power & Light C 05000261
 AUTH. NAME AUTHOR AFFILIATION
 CHERNOFF, H.K. Carolina Power & Light Co.
 YOUNG, D.E. Carolina Power & Light Co.
 RECIP. NAME RECIPIENT AFFILIATION

SUBJECT: LER 96-007-00: on 961020, automatic initiation of RPS occurred due to SG FW level control sys failure. "B" SG FRV manual/automatic control station was replaced 961021.W/961119 ltr.

DISTRIBUTION CODE: IE22T COPIES RECEIVED: LTR 1 ENCL 1 SIZE: 4
 TITLE: 50.73/50.9 Licensee Event Report (LER), Incident Rpt, etc.

NOTES:

RECIPIENT ID CODE/NAME	COPIES LTTR ENCL	RECIPIENT ID CODE/NAME	COPIES LTTR ENCL
PD2-1 PD	1 1	MOZAFARI, B	1 1
INTERNAL: AEOD/SPD/RAB	2 2	AEOD/SPD/RRAB	2 2
FILE CENTER	1 1	NRR/DE/ECGB	1 1
NRR/DE/EELB	1 1	NRR/DE/EMEB	1 1
NRR/DRCH/HHFB	1 1	NRR/DRCH/HICB	1 1
NRR/DRCH/HOLB	1 1	NRR/DRCH/HQMB	1 1
NRR/DRPM/PECB	1 1	NRR/DSSA/SPLB	1 1
NRR/DSSA/SRXB	1 1	RES/DET/EIB	1 1
RGN2 FILE 01	1 1		
EXTERNAL: L ST LOBBY WARD	1 1	LITCO BRYCE, J H	1 1
NOAC MURPHY, G.A	1 1	NOAC POORE, W.	1 1
NRC PDR	1 1	NUDOCS FULL TXT	1 1

NOTE TO ALL "RIDS" RECIPIENTS:

PLEASE HELP US TO REDUCE WASTE. TO HAVE YOUR NAME OR ORGANIZATION REMOVED FROM DISTRIBUTION LISTS OR REDUCE THE NUMBER OF COPIES RECEIVED BY YOU OR YOUR ORGANIZATION, CONTACT THE DOCUMENT CONTROL DESK (DCD) ON EXTENSION 415-2083

FULL TEXT CONVERSION REQUIRED

TOTAL NUMBER OF COPIES REQUIRED: LTTR 25 ENCL 25

C
A
T
E
G
O
R
Y
1
D
O
C
U
M
E
N
T

**Carolina Power & Light Company**

Robinson Nuclear Plant
3581 West Entrance Road
Hartsville SC 29550

Robinson File No: 13510C
Serial: RNP-RA/96-0197

NOV 19 1996

United States Nuclear Regulatory Commission
Attn: Document Control Desk
Washington, DC 20555

H. B. ROBINSON STEAM ELECTRIC PLANT, UNIT NO. 2
DOCKET NO. 50-261/LICENSE NO. DPR-23
LICENSEE EVENT REPORT NO. 96-007-00

Gentlemen:

The enclosed Licensee Event Report (LER), is submitted in accordance with 10 CFR 50.73(a)(2)(iv). This report is required to be submitted to the NRC by November 19, 1996.

Very truly yours,

D. E. Young
Plant General Manager

Enclosure

c: Mr. S. D. Ebnetter, Regional Administrator, USNRC, Region II
Ms. B. L. Mozafari, USNRC Project Manager, HBRSEP
Mr. J. Zeiler, USNRC Resident Inspector, HBRSEP

9611260192 961119
PDR ADDCK 05000261
S PDR

IE221/

NRC FORM 366 (4-95)		U.S. NUCLEAR REGULATORY COMMISSION																																																																												
LICENSEE EVENT REPORT (LER) (See reverse for required number of digits/characters for each block)		APPROVED BY OMB NO. 3150-0104 EXPIRES 04/30/98 <small>ESTIMATED BURDEN PER RESPONSE TO COMPLY WITH THIS MANDATORY INFORMATION COLLECTION REQUEST: 50.0 HRS. REPORTED LESSONS LEARNED ARE INCORPORATED INTO THE LICENSING PROCESS AND FED BACK TO INDUSTRY. FORWARD COMMENTS REGARDING BURDEN ESTIMATE TO THE INFORMATION AND RECORDS MANAGEMENT BRANCH (T-6 F33), U.S. NUCLEAR REGULATORY COMMISSION, WASHINGTON, DC 20555-0001, AND TO THE PAPERWORK REDUCTION PROJECT (3150-0104), OFFICE OF MANAGEMENT AND BUDGET, WASHINGTON, DC 20503.</small>																																																																												
FACILITY NAME (1) H. B. ROBINSON STEAM ELECTRIC PLANT, UNIT NO. 2		DOCKET NUMBER (2) 05000-261	PAGE (3) 1 OF 4																																																																											
TITLE (4) AUTOMATIC INITIATION OF RPS DUE TO STEAM GENERATOR FEEDWATER LEVEL CONTROL SYSTEM FAILURE																																																																														
<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <th colspan="3">EVENT DATE (5)</th> <th colspan="3">LER NUMBER (6)</th> <th colspan="3">REPORT DATE (7)</th> <th colspan="2">OTHER FACILITIES INVOLVED (8)</th> </tr> <tr> <th>MONTH</th> <th>DAY</th> <th>YEAR</th> <th>YEAR</th> <th>SEQUENTIAL NUMBER</th> <th>REVISION NUMBER</th> <th>MONTH</th> <th>DAY</th> <th>YEAR</th> <th>FACILITY NAME</th> <th>DOCKET NUMBER</th> </tr> <tr> <td>10</td> <td>20</td> <td>96</td> <td>96</td> <td>-- 007</td> <td>-- 00</td> <td>11</td> <td>19</td> <td>96</td> <td></td> <td>05000</td> </tr> </table>		EVENT DATE (5)			LER NUMBER (6)			REPORT DATE (7)			OTHER FACILITIES INVOLVED (8)		MONTH	DAY	YEAR	YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	MONTH	DAY	YEAR	FACILITY NAME	DOCKET NUMBER	10	20	96	96	-- 007	-- 00	11	19	96		05000	<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <th colspan="2">OPERATING MODE (9)</th> <th colspan="2">THIS REPORT IS SUBMITTED PURSUANT TO THE REQUIREMENTS OF 10 CFR 5: (Check one or more) (11)</th> </tr> <tr> <td>N</td> <td></td> <td>20.2201(b)</td> <td>20.2203(a)(2)(v)</td> </tr> <tr> <td rowspan="4">POWER LEVEL (10)</td> <td rowspan="4">20</td> <td>20.2203(a)(1)</td> <td>20.2203(a)(3)(i)</td> </tr> <tr> <td>20.2203(a)(2)(i)</td> <td>20.2203(a)(3)(ii)</td> </tr> <tr> <td>20.2203(a)(2)(iii)</td> <td>20.2203(a)(4)</td> </tr> <tr> <td>20.2203(a)(2)(iv)</td> <td>50.36(c)(1)</td> </tr> <tr> <td></td> <td></td> <td>50.73(a)(2)(i)</td> <td>50.73(a)(2)(viii)</td> </tr> <tr> <td></td> <td></td> <td>50.73(a)(2)(ii)</td> <td>50.73(a)(2)(ix)</td> </tr> <tr> <td></td> <td></td> <td>50.73(a)(2)(iii)</td> <td>73.71</td> </tr> <tr> <td></td> <td></td> <td>50.73(a)(2)(iv)</td> <td>OTHER</td> </tr> <tr> <td></td> <td></td> <td>50.73(a)(2)(v)</td> <td>Specify in Abstract below or in NRC Form 366A</td> </tr> <tr> <td></td> <td></td> <td>50.73(a)(2)(vii)</td> <td></td> </tr> </table>		OPERATING MODE (9)		THIS REPORT IS SUBMITTED PURSUANT TO THE REQUIREMENTS OF 10 CFR 5: (Check one or more) (11)		N		20.2201(b)	20.2203(a)(2)(v)	POWER LEVEL (10)	20	20.2203(a)(1)	20.2203(a)(3)(i)	20.2203(a)(2)(i)	20.2203(a)(3)(ii)	20.2203(a)(2)(iii)	20.2203(a)(4)	20.2203(a)(2)(iv)	50.36(c)(1)			50.73(a)(2)(i)	50.73(a)(2)(viii)			50.73(a)(2)(ii)	50.73(a)(2)(ix)			50.73(a)(2)(iii)	73.71			50.73(a)(2)(iv)	OTHER			50.73(a)(2)(v)	Specify in Abstract below or in NRC Form 366A			50.73(a)(2)(vii)	
EVENT DATE (5)			LER NUMBER (6)			REPORT DATE (7)			OTHER FACILITIES INVOLVED (8)																																																																					
MONTH	DAY	YEAR	YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	MONTH	DAY	YEAR	FACILITY NAME	DOCKET NUMBER																																																																				
10	20	96	96	-- 007	-- 00	11	19	96		05000																																																																				
OPERATING MODE (9)		THIS REPORT IS SUBMITTED PURSUANT TO THE REQUIREMENTS OF 10 CFR 5: (Check one or more) (11)																																																																												
N		20.2201(b)	20.2203(a)(2)(v)																																																																											
POWER LEVEL (10)	20	20.2203(a)(1)	20.2203(a)(3)(i)																																																																											
		20.2203(a)(2)(i)	20.2203(a)(3)(ii)																																																																											
		20.2203(a)(2)(iii)	20.2203(a)(4)																																																																											
		20.2203(a)(2)(iv)	50.36(c)(1)																																																																											
		50.73(a)(2)(i)	50.73(a)(2)(viii)																																																																											
		50.73(a)(2)(ii)	50.73(a)(2)(ix)																																																																											
		50.73(a)(2)(iii)	73.71																																																																											
		50.73(a)(2)(iv)	OTHER																																																																											
		50.73(a)(2)(v)	Specify in Abstract below or in NRC Form 366A																																																																											
		50.73(a)(2)(vii)																																																																												
LICENSEE CONTACT FOR THIS LER (12)																																																																														
NAME H. K. Chernoff, Manager - Licensing/Regulatory Programs		TELEPHONE NUMBER (Include Area Code) (803) 857-1437																																																																												
COMPLETE ONE LINE FOR EACH COMPONENT FAILURE DESCRIBED IN THIS REPORT (13)																																																																														
CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO NPRDS	CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO NPRDS																																																																					
X	JB	FRV	W120	Y																																																																										
SUPPLEMENTAL REPORT EXPECTED (14)				EXPECTED SUBMISSION DATE (15)		MONTH		DAY		YEAR																																																																				
YES (If yes, complete EXPECTED SUBMISSION DATE).				X NO																																																																										
ABSTRACT (Limit to 1400 spaces, i.e., approximately 15 single-spaced typewritten lines) (16)																																																																														
<p>On October 20, 1996, H.B. Robinson Steam Electric Plant (HBRSEP), Unit No. 2 was in power ascension following startup from Refueling Outage 17, and was operating at 20 percent reactor power. An automatic reactor trip occurred at 1337 hours following a rapid increase in demand for the "B" Steam Generator (SG) level and feedwater flow, and a subsequent SG overfeed condition. Plant systems functioned as expected, and plant operators stabilized the reactor at zero percent power and hot shutdown conditions using Emergency Operating Procedures (EOPs). Although the root cause of this event could not be conclusively determined, based on industry data and the maintenance history for the "B" SG Feedwater Regulating Valve (FRV) manual/automatic control station, equipment aging is the most likely cause of this event. Although the failure of the "B" SG FRV manual/automatic control station resulted in an automatic actuation of the Reactor Protection System (RPS) and a plant transient, this event has minimal safety significance. The "B" SG FRV manual/automatic control station was replaced on October 21, 1996, and the plant was placed back on line. Licensed Operators will review this event by December 31, 1996, during Cycle 6 of the Licensed Operator Training program. This report is submitted in accordance with 10 CFR 50.73(a)(2)(iv).</p>																																																																														

NRC FORM 366A
(4-95)

U.S. NUCLEAR REGULATORY COMMISSION

LICENSEE EVENT REPORT (LER)
TEXT CONTINUATION

FACILITY NAME (1)	DOCKET	LER NUMBER (6)			PAGE (3)
		YEAR	SEQUENTIAL	REVISION	
H. B. ROBINSON STEAM ELECTRIC PLANT, UNIT NO. 2	05000-261	96	007	00	2 OF 4

TEXT (If more space is required, use additional copies of NRC Form 366A) (17)

I. DESCRIPTION OF EVENT

On October 20, 1996, H. B. Robinson Steam Electric Plant (HBRSEP), Unit No. 2 was in power ascension following startup from Refueling Outage 17, and was operating at 20 percent reactor power. The three Steam Generator (SG) Feedwater Regulation Valves (FRVs) (EIIS Component Code: FCV) were in the automatic operation mode to control feedwater flow to their respective SGs. At approximately 1335 hours Eastern Daylight Time, a rapid increase in demand occurred for the "B" SG level and feedwater flow. Upon observing a rapid increase in flow demand for the "B" SG FRV and the potential for a SG overfeed condition, a licensed Control Room operator took the immediate actions of procedure Abnormal Operating Procedure (AOP)-010, "Main Feedwater/Condensate Malfunction." The operator placed the "B" SG FRV controller (EIIS Component Code: FIK) in manual control and the FRV was driven in the closed direction to match the "B" SG feed flow and steam flow in an attempt to prevent a SG overfill condition and subsequent turbine trip. However, the position demand for the "B" FRV continued to increase, and the amount of water introduced into the "B" SG by the FRV resulted in a swell of water in the "B" SG of sufficient magnitude to reach the SG high water level trip, followed by a turbine trip and a trip of the Main Feed Pumps (MFP) (EIIS System Code: BA). The turbine trip caused an automatic reactor trip at 1337 hours. Plant systems functioned as expected, and plant operators stabilized the reactor at zero percent power and hot shutdown conditions using Emergency Operating Procedures (EOPs). The NRC was notified of this event on October 20, 1996, at 1427 hours Eastern Daylight Time via the Federal Telephone System (FTS) in accordance with 10 CFR 50.72(b)(2)(ii) as an event that resulted in the automatic actuation of the Reactor Protection System (RPS) (EIIS System Code: JC).

II. CAUSE OF EVENT

The root cause of this event could not be conclusively determined. A review of maintenance history for the SG FRV manual/automatic control stations identified previous occurrences when the controllers have failed to operate properly to control SG level. Equipment aging was identified as a causal factor for these occurrences, and several components in the FRV control system have since been replaced to reduce the potential for improper valve to control. The most recent occurrence was found during Refueling Outage 17 when scheduled equipment calibration was being performed. The equipment was subsequently repaired and satisfactorily returned to service. During the investigation of the October 20, 1996, event, plant Maintenance personnel performed calibrations and visual checks of the SG water level control system to identify any input signal that could cause the "B" SG FRV to move to the full-open position. These calibrations and checks demonstrated normal indications and responses. Based on industry data that similar controllers have previously failed to operate properly to control SG level, and the maintenance history for the SG FRV manual/automatic control station that identified previous occurrences when the controllers have failed to adequately control SG level, equipment aging is the most likely cause of this event.

NRC FORM 366A
(4-95)

U.S. NUCLEAR REGULATORY COMMISSION

LICENSEE EVENT REPORT (LER)
TEXT CONTINUATION

FACILITY NAME (1)	DOCKET	LER NUMBER (6)			PAGE (3)
		YEAR	SEQUENTIAL	REVISION	
H. B. ROBINSON STEAM ELECTRIC PLANT, UNIT NO. 2	05000-261	96	-- 007 --	00	3 OF 4

TEXT (If more space is required, use additional copies of NRC Form 366A) (17)

III. ANALYSIS OF EVENT

The operational transient associated with this event began when an automatic turbine trip and subsequent reactor trip occurred as a result of increase in demand for the "B" SG FRV and a SG overfeed condition. Although the failure of the FRV resulted in an automatic actuation of the RPS and a plant transient, this event has minimal safety significance. The basis of Technical Specifications (TS) Section 3.1.1.2 states that one SG capable of performing its heat transfer function will provide sufficient heat removal capability to remove core decay heat after a normal reactor shutdown. With the failure of the "B" SG FRV, normal flow controls remained available to two of the three SGs, and normal flow controls were available to the "B" SG when SG level decreased below the high level trip setpoint. Also, the Auxiliary Feedwater system was available to supply any or all of the three SGs. Therefore, the ability to remove decay heat using the secondary heat sink remained available.

The Updated Final Safety Analysis Report (UFSAR) addresses postulated transients and accidents which could result in a reduction in the capacity of the secondary system to remove heat generated in the Reactor Coolant System (RCS). One of these postulated transients, Feedwater System Malfunctions that Result in an Increase in Feedwater Flow, is addressed in UFSAR Section 15.1.2. The primary challenge of this transient is an increase in heat removal capacity, and as a cooldown event, it is most limiting at end of cycle when the moderator temperature coefficient is most negative. The UFSAR accident analysis bounds this event by the results of the 10 percent load increase event (i.e., Chapter 15.1.3) and the insertion rate used in the rod withdrawal event at subcritical or low power (i.e., Chapter 15.4.1). The event reported by this Licensee Event Report (LER) is less severe than the UFSAR Chapter 15.1.2 event, since it occurred at beginning of cycle. Therefore, this event had minimal effect on plant safety.

This report is submitted in accordance with 10 CFR 50.73(a)(2)(iv).

IV. CORRECTIVE ACTIONS

The "B" SG FRV manual/automatic control station was replaced on October 21, 1996, and the plant was placed back on line.

Licensed Operators will review this event by December 31, 1996, during Cycle 6 of the Licensed Operator Training program.

Maintenance personnel will evaluate the necessity for preventative maintenance procedures to conduct diagnostic checks of manual/automatic control stations, and procedures will be developed accordingly by December 30, 1996.

NRC FORM 366A
(4-95)

U.S. NUCLEAR REGULATORY COMMISSION

LICENSEE EVENT REPORT (LER)
TEXT CONTINUATION

FACILITY NAME (1)	DOCKET	LER NUMBER (6)			PAGE (3)
		YEAR	SEQUENTIAL	REVISION	
H. B. ROBINSON STEAM ELECTRIC PLANT, UNIT NO. 2	05000-261	96	-- 007	-- 00	4 OF 4

TEXT (If more space is required, use additional copies of NRC Form 366A) (17)

V. ADDITIONAL INFORMATION

A. Failed Component Identification

Feedwater Steam Generator Water Level Control System (EIS System Code: JB, Manufacturer: W120)

B. Previous Similar Events

LER 85-05