

ACCELERATED DISTRIBUTION DEMONSTRATION SYSTEM

REGULATORY INFORMATION DISTRIBUTION SYSTEM (RIDS)

ACCESSION NBR:9002120254 DOC.DATE: 90/01/26 NOTARIZED: NO DOCKET #
 FACIL:50-269 Oconee Nuclear Station, Unit 1, Duke Power Co. 05000269
 50-270 Oconee Nuclear Station, Unit 2, Duke Power Co. 05000270
 50-287 Oconee Nuclear Station, Unit 3, Duke Power Co. 05000287

AUTH.NAME AUTHOR AFFILIATION
 TUCKER,H.B. Duke Power Co.
 RECIP.NAME RECIPIENT AFFILIATION
 Document Control Branch (Document Control Desk)

SUBJECT: Responds to NRC 891229 ltr re violations noted in Insp Repts
 50-269/89/31,50-270/89-31 & 50-287/89-31.

DISTRIBUTION CODE: IE01D COPIES RECEIVED:LTR 1 ENCL 1 SIZE: 3
 TITLE: General (50 Dkt)-Insp Rept/Notice of Violation Response

NOTES:

	RECIPIENT ID CODE/NAME	COPIES LTTR ENCL	RECIPIENT ID CODE/NAME	COPIES LTTR ENCL
	PD2-3 PD	1 1	WIENS,L	1 1
INTERNAL:	ACRS	2 2	AEOD	1 1
	AEOD/DEIIB	1 1	AEOD/TPAD	1 1
	DEDRO	1 1	NRR SHANKMAN,S	1 1
	NRR/DLPQ/LPEB10	1 1	NRR/DOEA DIR 11	1 1
	NRR/DREP/PEPB9D	1 1	NRR/DREP/PRPB11	2 2
	NRR/DRIS/DIR	1 1	NRR/DST/DIR 8E2	1 1
	NRR/PMAS/ILRB12	1 1	NUDOCS-ABSTRACT	1 1
	OE LIEBERMAN,J	1 1	OGC/HDS2	1 1
	REG FILE 02	1 1	RES MORISSEAU,D	1 1
	RGN2 FILE 01	1 1		
EXTERNAL:	LPDR	1 1	NRC PDR	1 1
	NSIC	1 1		

NOTE TO ALL "RIDS" RECIPIENTS:

PLEASE HELP US TO REDUCE WASTE! CONTACT THE DOCUMENT CONTROL DESK,
 ROOM P1-37 (EXT. 20079) TO ELIMINATE YOUR NAME FROM DISTRIBUTION
 LISTS FOR DOCUMENTS YOU DON'T NEED!

TOTAL NUMBER OF COPIES REQUIRED: LTTR 26 ENCL 26

DUKE POWER COMPANY
P.O. BOX 33189
CHARLOTTE, N.C. 28242

HAL B. TUCKER
VICE PRESIDENT
NUCLEAR PRODUCTION

TELEPHONE
(704) 373-4531

January 26, 1990


U. S. Nuclear Regulatory Commission
Attention: Document Control Desk
Washington, DC 20555

Subject: Oconee Nuclear Station
Docket Nos. 50-269, -270, -287
Inspection Report 50-269, -270, -287/89-31

Dear Sir:

By a letter dated December 29, 1989, the NRC had issued a notice of violation and 50-269, -270, -287/89-31 inspection report. Pursuant to the provisions of 10 CFR 2.201, I am submitting a written response to the violation identified in the inspection report.

Very truly yours,

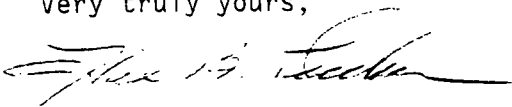

H. S. Tucker

PFG95/td

cc: Mr. S. D. Ebnetter
Regional Administrator
U. S. Nuclear Regulatory
Commission - Region II
101 Marietta St. NW
Suite 2900
Atlanta, GA 30323

Mr. P. H. Skinner
NRC Resident Inspector
Oconee Nuclear Station

Mr. L. A. Wiens
Office of Nuclear Reactor Regulation
U. S. Nuclear Regulatory Commission
Washington, DC 20555

IF01
11

9002120254 900126
FDR ADOCK 05000269
Q FIC

Violation

Oconee Nuclear Station Technical Specifications (TS) 4.4.1 identifies the required testing associated with containment penetration integrity. Included in this specification is the specific requirement to perform local leak rate testing or integrated leak rate testing, as applicable, following any major modification or replacement of a component affecting the integrity of containment. Implicit in this statement is the requirement to perform testing following maintenance to components affecting containment integrity.

Contrary to the above, on September 22, 1989, the licensee identified that subsequent to the most recent Integrated Leak Rate Testing of each unit's containment, maintenance and modifications had been performed on several penetrations without performing the specified testing. This failure to perform the required testing was associated with four specific penetrations on all three units.

Response

1. Admission or detail of alleged violation:

Duke Power admits the violation.

2. Reason for the violation:

The contributing factors that led to the violation were:

- a. Personnel involved in making testing determinations, misunderstood the post modification/maintenance leak testing requirements for penetrations which Technical Specifications requires a Type A test but stated that a Type C test is not required.
- b. Post modification/maintenance testing requirements are listed in two manuals, which are under the control of different groups. The manual used for determining testing requirements for work requests did not include all the valves included in the IST manual.

3. The corrective steps taken and the results achieved:

- a. Penetration #53, and affected valves on other penetrations were declared inoperable. The outside containment boundaries on affected penetrations were verified isolated and administrative controls were instituted to assure that they remain so.
- b. Unit 1 and Unit 2, penetration #53 was modified to allow Type C testing and a successful test was conducted.
- c. Valves 1N-131 and 1CA-29 (penetration #39) and 1CF-3 and 1CF-4 (penetration #59) were successfully Type C tested.
- d. Unit 2, penetration #39 was modified to allow Type C testing and a successful test was conducted.

- e. Unit 3 penetrations were tested using a Containment Integrated Leak Rate Test during a refueling outage in December 1989. The results of the test were satisfactory.

4. Corrective steps which will be taken to avoid further violations:

- a. Inservice Testing Manual will be used to plan all Containment Isolation valve work for determination of post modification/maintenance Code testing.
- b. Personnel involved in the determination of leak rate testing will be trained/qualified in the requirements of Technical Specifications.
- c. Units 1 and 2 will have the Containment Integrated Leak Rate Test performed during the next scheduled refueling outage.

5. Date of full compliance:

Full compliance will be achieved prior to startup from U2E0C11 refueling outage.