

REGULATOR INFORMATION DISTRIBUTION SYSTEM (RIDS)

ACCESSION NBR: 8003070362 DOC. DATE: 80/02/29 NOTARIZED: NO
 FACIL: 50-287 Oconee Nuclear Station, Unit 3, Duke Power Co.
 AUTH. NAME: AUTHOR AFFILIATION
 LEWIS, S. R. Duke Power Co.
 RECIP. NAME: RECIPIENT AFFILIATION
 Region 2, Atlanta, Office of the Director

DOCKET #
 05000287

SUBJECT: LER 80-002/03L-0: on 800201, during monthly 4160 V breaker operability test, breaker 3132T-5 startup breaker for main feeder bus number 2, failed to close. Caused by faulty resistor in relay. Resistor replaced.

DISTRIBUTION CODE: A002S COPIES RECEIVED: LTR 1 ENCL 1 SIZE: 2+1
 TITLE: Incident Reports

NOTES: M. CUNNINGHAM - ALL AMENDMENTS TO FSAR +
CHANGES TO TECH SPECS

ACTION:	RECIPIENT	COPIES		RECIPIENT	COPIES	
	ID CODE/NAME	LTTR	ENCL		ID CODE/NAME	LTTR
	05 BC	4	4			
	<u>ORB #4</u>					
INTERNAL:	01 <u>REC FILE</u>	1	1	02 NRC PDR	1	1
	09 I&E	2	2	11 MPA	3	3
	14 TA/EDO	1	1	15 NOVAK/KNIEL	1	1
	16 EEB	1	1	17 AD FOR ENGR	1	1
	18 PLANT SYS BR	1	1	19 I&C SYS BR	1	1
	20 AD PLANT SYS	1	1	22 REAC SAFT BR	1	1
	23 ENGR BR	1	1	24 KREGER	1	1
	25 PWR SYS BR	1	1	26 AD/SITE ANAL	1	1
	27 OPERA LIC BR	1	1	28 ACIDENT ANALYS	1	1
	29 AUX SYS BR	1	1	AD/ORP-DOR	1	1
	AEOD	1	1	DOUG MAY-TERA	1	1
	HANAUER, S.	1	1	IRELAND, R.	3	3
	JORDAN, E./IE	1	1			
EXTERNAL:	03 LPDR	1	1	04 NSIC	1	1
	29 ACRS	16	16			

MAR 11 1980

TOTAL NUMBER OF COPIES REQUIRED: LTTR 52 ENCL 52

DUKE POWER COMPANY
OCONEE UNIT 3

Report Number: RO-287/80-2

Report Date: February 29, 1980

Occurrence Date: February 1, 1980

Facility: Oconee 3, Seneca, South Carolina

Identification of Occurrence: Main Feeder Bus No. 2 Not Available From Startup Transformers

Conditions Prior to Occurrence: 100% Full Power

Description of Occurrence:

At 2042 on February 1, 1980, breaker 3B2T-5, the 4160 V startup breaker for Oconee 3 Main Feeder Bus (MFB) No. 2, failed to close during performance of the monthly 4160 V breaker operability test. Therefore, two startup transformers were not available to MFB No. 2 as required by Oconee Nuclear Station Technical Specification 3.7.1(b). Repairs were initiated on February 2, and breaker 3B2T was made operable by 2008 that day.

Apparent Cause of Occurrence:

It was determined that the breaker would operate when the lead for the closing coil monitor relay was lifted. Therefore, the relay was removed from service, allowing the breaker to operate until the relay could be repaired. The relay was determined to be malfunctioning due to a faulty resistor.

Analysis of Occurrence:

During the period breaker 3B2T-5 was inoperable, MFB No. 2 could not be energized from the startup transformers. Power was available from transformers 3T and CT-4 to MFB No. 2. In addition, two startup transformers were available to redundant MFB No. 1 during the period breaker 3B2T-5 was inoperable. However, this incident must be reported pursuant to Technical Specifications 6.6.2.i.b(2), although it was of no significance with respect to safe operation, and the health and safety of the public were not affected.

Corrective Action:

The closing coil monitor relay lead was lifted to allow breaker 3B2T-5 to operate. The faulty resistor in the relay was then replaced. Proper operation of breaker 3B2T-5 was then verified.

LICENSEE EVENT REPORT

EXHIBIT A

CONTROL BLOCK: 1 (PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

01 | S | C | N | E | E | 3 | 2 | 0 | 0 | - | 0 | 0 | 0 | 0 | 0 | - | 0 | 0 | 3 | 4 | 1 | 1 | 1 | 1 | 4 | 5

7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50

CONT 01 | REPORT SOURCE | L | 6 | 0 | 5 | 0 | 0 | 0 | 2 | 8 | 7 | 7 | 0 | 2 | 0 | 1 | 8 | 0 | 8 | 0 | 2 | 2 | 9 | 8 | 0 | 9

7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES 10

02 | During performance of the monthly 4160 V breaker operability test, breaker

03 | 3B2T-5, the startupbreaker for Main Feeder Bus No. 2, failed to close. There-

04 | fore, the startup transformers were not available to MFB No. 2. Breaker

05 | 3B2T-5 was made operable less than 24 hours later. Power to MFB No. 2 was

06 | available from transformers 3T and CT-4. In addition, two startup trans-

07 | formers were available to redundant MFB No. 1. Therefore, this incident is

08 | considered to be of no significance with respect to safe operation, and the

09 | health and safety of the public were not affected.

10 |

11 |

12 |

13 |

14 |

15 |

16 |

17 |

18 |

19 |

20 |

21 |

22 |

23 |

24 |

25 |

26 |

27 |

28 |

29 |

30 |

31 |

32 |

33 |

34 |

35 |

36 |

37 |

38 |

39 |

40 |

41 |

42 |

43 |

44 |

45 |

46 |

47 |

48 |

49 |

50 |

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS 27

10 | It was determined that the breaker operated properly when the closing coil

11 | monitor relay lead was lifted. The relay was found to be malfunctioning due

12 | to a faulty resistor. The resistor was replaced, and breaker 3B2T-5 was

13 | tested to verify operability.

14 |

15 |

16 |

17 |

18 |

19 |

20 |

21 |

22 |

23 |

24 |

25 |

26 |

27 |

28 |

29 |

30 |

31 |

32 |

33 |

34 |

35 |

36 |

37 |

38 |

39 |

40 |

41 |

42 |

43 |

44 |

45 |

46 |

47 |

48 |

49 |

50 |

FACILITY STATUS 28 | E | 29 | 1 | 0 | 0 | 0 | 29 | NA | 30 | OTHER STATUS | 31 | B | 32 | Monthly Operability Test

7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50

ACTIVITY CONTENT 33 | Z | 34 | Z | 35 | NA | 36 | LOCATION OF RELEASE | 37 | NA

7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50

PERSONNEL EXPOSURES 37 | 0 | 38 | 0 | 39 | 0 | 40 | 0 | 41 | 0 | 42 | 0 | 43 | 0 | 44 | 0 | 45 | 0 | 46 | 0 | 47 | 0 | 48 | 0 | 49 | 0 | 50 | 0

7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50

PERSONNEL INJURIES 40 | 0 | 41 | 0 | 42 | 0 | 43 | 0 | 44 | 0 | 45 | 0 | 46 | 0 | 47 | 0 | 48 | 0 | 49 | 0 | 50 | 0

7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50

LOSS OF OR DAMAGE TO FACILITY TYPE 42 | Z | 43 | Z | 44 | Z | 45 | Z | 46 | Z | 47 | Z | 48 | Z | 49 | Z | 50 | Z

7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50

PUBLICITY ISSUED DESCRIPTION 44 | N | 45 | N | 46 | N | 47 | N | 48 | N | 49 | N | 50 | N

7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50

NAME OF PREPARER S. R. Lewis

PHONE: (704) 373-8285

8003070 362