



ROCHESTER GAS AND ELECTRIC CORPORATION - 89 EAST AVENUE, ROCHESTER, N.Y. 14649

TELEPHONE
AREA CODE 716 548-2700
Extension 291-250

Ginna Station
July 24, 1979

FILE
LER 79-015
JUL 24 1979

50-244

Mr. Boyce H. Grier, Director
U.S. NUCLEAR REGULATORY COMMISSION
Office of Inspection and Enforcement
Region I
631 Park Avenue
King of Prussia, PA 19406

Subject: LER 79-015, Nonconforming Pipe Supports Identified
during NRC I&E Bulletin 79-14 Inspection

Dear Mr. Grier:

This is to confirm our discussion with Mr. Donald Beckman and Mr. Raymond Markowsky on July 24, 1979 to report Licensee Event Report 79-015. This event is reportable in accordance with Technical Specifications, Section 6.9.2.a(9), ".....; or discovery during plant life of conditions not specifically considered in the safety analysis report or technical specifications that require remedial action or corrective measures to prevent the existence or development of an unsafe condition."

The plant was informed by the RG&E Engineering Department personnel of ten (10) pipe supports within the Containment Vessel identified as nonconforming to the original design drawings. These supports are located on the Containment Spray System, Residual Heat Removal System and the Service Water System. Based on our Engineering Department evaluation, these supports will be reworked to original design requirements or equivalent as required.

Details of the nonconformances and the dispositions based on Engineering's evaluation are identified on the attachment to this letter.

Sincerely,

Bruce A. Snow
Bruce A. Snow
Superintendent

AS:pk

Attachment

cc: L.D. White, Jr.
L.S. Lang

7908270521

cef
A02



11/11/11



11/11/11

ATTACHMENT

LER 79-015

July 24, 1979

<u>SYSTEM</u>	<u>SUPPORT NO.</u>	<u>NONCONFORMANCE</u>	<u>EVALUATION BASED DISPOSIT</u>
Containment Spray	CS 53 ⁰ 45'	Support not installed	Use-as-is
	CS 251 ⁰	3" pipe clamp not installed	Rework
	CS 307 ⁰	3" pipe clamp not installed	Rework
	CS 12	6" U-Bolt not installed	Rework
Residual Heat Removal	RH-16	10" pipe clamp not installed	Rework
Service Water	SW-3	Support not installed	Rework
	SW-20	6-8" U-Bolts not installed	Rework
	SW-22	4-8" U-Bolts not installed	Rework
	SW-23	8" pipe clamp not installed	Rework
	SW-29	Support not installed	Rework

