

EOP: ECA-0.1	TITLE: LOSS OF ALL AC POWER RECOVERY WITHOUT SI REQUIRED	REV: 6 PAGE 1 of 20
-----------------	--	------------------------

ROCHESTER GAS AND ELECTRIC CORPORATION

GINNA STATION

CONTROLLED COPY NUMBER

23

TECHNICAL REVIEW

PORC REVIEW DATE

5/6/92

Thomas A. Marlowe
PLANT SUPERINTENDENT

5/8/92
EFFECTIVE DATE

CATEGORY 1.0

REVIEWED BY: _____

9206160382 920605
PDR ADCK 05000244
P PDR



EOP: ECA-0.1	TITLE: LOSS OF ALL AC POWER RECOVERY WITHOUT SI REQUIRED	REV: 6 PAGE 2 of 20
-----------------	--	------------------------

A. PURPOSE - This procedure provides actions to use normal operational systems to stabilize plant conditions following restoration of AC emergency power.

B. ENTRY CONDITIONS/SYMPTOMS

1. ENTRY CONDITIONS - This procedure is entered from:

- a. ECA-0.0, LOSS OF ALL AC POWER, when AC emergency power is restored and SI is not required.

10

11

12

13

14

15

16

17

18

19

20

21

22

23

24

25

26

27

EOP: ECA-0.1	TITLE: LOSS OF ALL AC POWER RECOVERY WITHOUT SI REQUIRED	REV: 6 PAGE 3 of 20
-----------------	--	------------------------

STEP	ACTION/EXPECTED RESPONSE	RESPONSE NOT OBTAINED
<p><u>NOTE:</u></p> <ul style="list-style-type: none"> o CSFSTs should be monitored for information only. FR procedures should not be implemented prior to completion of Step 11. o Adverse CNMT values should be used whenever CNMT pressure is greater than 4 psig or CNMT radiation is greater than 10^{+05} R/hr. 		
1	<p>Check RCP Seal Isolation Status:</p> <ul style="list-style-type: none"> a. RCP seal injection needle valves - CLOSED <ul style="list-style-type: none"> • V-300A • V-300B b. RCP CCW return valves - CLOSED <ul style="list-style-type: none"> • MOV-759A • MOV-759B 	<ul style="list-style-type: none"> a. Dispatch AO with key to RWST gate to locally close valves before starting charging pump. b. <u>IF</u> valves open or position not known, <u>THEN</u> check CCW pump status: <ul style="list-style-type: none"> 1) <u>IF</u> pump running, <u>THEN</u> go to Step 2. 2) <u>IF</u> pump <u>NOT</u> running, <u>THEN</u> manually close valves. <p><u>IF</u> valve(s) can <u>NOT</u> be closed, <u>THEN</u> place switches for RCP thermal barrier CCW outlet valves to CLOSE.</p> <ul style="list-style-type: none"> • AOV-754A • AOV-754B
2	<p>Check CI Annunciator A-26, CONTAINMENT ISOLATION - EXTINGUISHED</p>	<p>Perform the following:</p> <ul style="list-style-type: none"> a. Depress CI reset pushbutton b. Verify annunciator A-26, CONTAINMENT ISOLATION, extinguished.

10

11

12

13

14

15

16

17

18

19



EOP: ECA-0.1	TITLE: LOSS OF ALL AC POWER RECOVERY WITHOUT SI REQUIRED	REV: 6 PAGE 4 of 20
-----------------	--	------------------------

STEP	ACTION/EXPECTED RESPONSE	RESPONSE NOT OBTAINED
3	Establish IA to CNMT:	
a.	Verify non-safeguards busses energized from offsite power	a. Perform the following:
o	Bus 13 normal feed - CLOSED	1) Close non-safeguards bus tie breakers:
	-OR-	• Bus 13 to Bus 14 tie
o	Bus 15 normal feed - CLOSED	• Bus 15 to Bus 16 tie
b.	Check at least two SW pumps - RUNNING	b. Manually start SW pumps as power supply permits (258 kw each).
		<u>IF</u> less than two SW pumps running, <u>THEN</u> go to Step 4.
c.	Verify turbine building SW isolation valves - OPEN	c. Manually align valves.
	• MOV-4613 and MOV-4670	
	• MOV-4614 and MOV-4664	
d.	Start at least two air compressors (75 kw each)	d. <u>IF</u> air compressors can <u>NOT</u> be started, <u>THEN</u> dispatch AO to locally reset compressors as necessary.
e.	Check IA supply:	e. Perform the following:
o	Pressure - GREATER THAN 60 PSIG	1) Continue attempts to restore IA (Refer to AP-IA.1, LOSS OF INSTRUMENT AIR).
o	Pressure - STABLE OR INCREASING	2) Continue with Step 6. <u>WHEN</u> IA restored, <u>THEN</u> do Steps 3f through 5.
f.	Reset both trains of XY relays for IA to CNMT (AOV-5392) if necessary	
g.	Verify IA to CNMT AOV-5392 - OPEN	

1

2

3

4

5

6

7

8

9

10

11

12

13

14

15

16

17

18

19

20

21

22

23

24

25

26

27

28

29

30

31

32

33

34

35

36

37

38

39

40

41

42

43

44

45

46

47

48

49

50

51

52

53

54

55

56

57

58

59

60

61

62

63

64

65

EOP: ECA-0.1	TITLE: LOSS OF ALL AC POWER RECOVERY WITHOUT SI REQUIRED	REV: 6 PAGE 5 of 20
-----------------	--	------------------------

STEP	ACTION/EXPECTED RESPONSE	RESPONSE NOT OBTAINED
<p>***** <u>CAUTION</u> THE LOADS PLACED ON THE ENERGIZED AC EMERGENCY BUS SHOULD NOT EXCEED THE CAPACITY OF THE POWER SOURCE. *****</p>		
4	<p>Manually Load Following Equipment On AC Emergency Busses:</p> <p>a. Start one CCW pump (124 kw)</p> <p>b. Energize MCCs as power supply permits</p> <ul style="list-style-type: none"> • MCC A from Bus 13 • MCC B from Bus 15 • MCC E from Bus 15 • MCC F from Bus 15 <p>c. Verify instrument bus D - ENERGIZED</p> <p>d. <u>WHEN</u> bus 15 restored, <u>THEN</u> reset control room lighting</p> <p>e. Start at least one CNMT RECIRC fan</p> <p>f. Restore Rx head cooling as power supply permits:</p> <ol style="list-style-type: none"> 1) Check IA to CNMT - AVAILABLE 2) Start one Rx compartment cooling fan (23 kw each) 3) Start both control rod shroud fans (45 kw each) <p>g. Dispatch AO to establish normal shutdown alignment (Refer to Attachment SD-1)</p>	<p>c. Restore power to instrument bus D from MCC B or MCC A (maintenance supply).</p> <ol style="list-style-type: none"> 1) Go to Step 5. 2) Perform the following: <ul style="list-style-type: none"> o Dispatch AO to reset UV relays at MCC C and MCC D. o Manually start one fan as power supply permits. (23 kw) 3) Manually start at least one fan (45 kw)

12

13

14

15

16

17

18

19

20

21

22

23

24

25

26

27

28

29

30

31

32

33

34

35

36

37

38

39

40

41

42

43

44

45

46

47

48

49

50

51

52

53

54

55

56

57

EOP: ECA-0.1	TITLE: LOSS OF ALL AC POWER RECOVERY WITHOUT SI REQUIRED	REV: 6 PAGE 6 of 20
-----------------	--	------------------------

STEP	ACTION/EXPECTED RESPONSE	RESPONSE NOT OBTAINED
5	Check If Charging Flow Has Been Established:	
a.	Charging pumps - ANY RUNNING	a. Perform the following: 1) Ensure seal injection needle valves to both RCPs isolated: • RCP A, V-300A • RCP B, V-300B 2) Ensure HCV-142 open, demand at 0%.
b.	Charging pump suction aligned to RWST: o LCV-112B - OPEN o LCV-112C - CLOSED	b. Manually align valves as necessary. <u>IF</u> LCV-112B can <u>NOT</u> be opened, <u>THEN</u> perform the following: 1) Verify charging pump A <u>NOT</u> running and place in PULL STOP. 2) Dispatch AO to locally open manual charging pump suction from RWST (V-358 located in charging pump room). 3) <u>WHEN</u> V-358 open, <u>THEN</u> direct AO to close V-268 to isolate charging pumps B and C from VCT (V-268 located in charging pump room).
c.	Start charging pumps (75 kw each) as necessary and adjust charging flow to restore PRZR level	

24

25

26

27

28



EOP: ECA-0.1	TITLE: LOSS OF ALL AC POWER RECOVERY WITHOUT SI REQUIRED	REV: 6 PAGE 7 of 20
-----------------	--	------------------------

STEP	ACTION/EXPECTED RESPONSE	RESPONSE NOT OBTAINED
6	Verify SI Flow Not Required:	
	a. RCS subcooling based on core exit T/Cs - GREATER THAN 0°F USING FIGURE MIN SUBCOOLING	a. Go to ECA-0.2, LOSS OF ALL AC POWER RECOVERY WITH SI REQUIRED, Step 1.
	b. PRZR level - GREATER THAN 5% [30% adverse CNMT]	b. Control charging flow to maintain PRZR level. IF PRZR level can <u>NOT</u> be maintained, <u>THEN</u> go to ECA-0.2, LOSS OF ALL AC POWER RECOVERY WITH SI REQUIRED, Step 1.
7	Check PRZR Level - GREATER THAN 13% [40% FOR ADVERSE CONTAINMENT]	Control charging flow as necessary.

100

101

102

103

104

105

106

107

108

109

110

111

112

113

114

115

116

EOP: ECA-0.1	TITLE: LOSS OF ALL AC POWER RECOVERY WITHOUT SI REQUIRED	REV: 6 PAGE 8 of 20
-----------------	--	------------------------

STEP	ACTION/EXPECTED RESPONSE	RESPONSE NOT OBTAINED
------	--------------------------	-----------------------

CAUTION

- o IF CST LEVEL DECREASES TO LESS THAN 5 FEET, THEN ALTERNATE WATER SOURCES FOR AFW PUMPS WILL BE NECESSARY (REFER TO ER-AFW.1, ALTERNATE WATER SUPPLY TO AFW PUMPS).
- o IF S/G NR LEVEL DECREASES TO LESS THAN 5% [25% ADVERSE CNMT] AND FEED FLOW IS LESS THAN 200 GPM, THEN THE MDAFW PUMPS SHOULD BE MANUALLY LOADED ON AC EMERGENCY BUS TO SUPPLY WATER TO THE S/G(S).

NOTE:

- o If MDAFW pump operation is not required, pump switches should be maintained in PULL-STOP to prevent automatic start.
- o TDAFW pump flow control valves fail open on loss of IA.

8 Check Intact S/G Levels:

a. Narrow range level - GREATER THAN 5% [25% adverse CNMT]

b. Control feed flow to maintain narrow range level between 17% [25% adverse CNMT] and 50%

a. Maintain total feed flow greater than 200 gpm until narrow range level greater than 5% [25% adverse CNMT] in at least one S/G.

IF feed flow less than 200 gpm, THEN perform the following:

1) Verify MDAFW pump discharge valves open.

- MOV-4007
- MOV-4008

2) Manually start MDAFW pumps as necessary (228 KW each).

28

29

30

31

32

33

34

35

36

37

38

39

40

41

42

43

44

45

46



EOP: ECA-0.1	TITLE: LOSS OF ALL AC POWER RECOVERY WITHOUT SI REQUIRED	REV: 6 PAGE 9 of 20
-----------------	--	----------------------------

STEP	ACTION/EXPECTED RESPONSE	RESPONSE NOT OBTAINED
9	<p>Establish S/G Pressure Control:</p> <ul style="list-style-type: none"> a. Adjust S/G ARV controllers to maintain existing S/G pressure b. Verify S/G ARV controllers in AUTO c. Dispatch AO to perform Attachment SD-2 <p><u>NOTE:</u> If any heat tracing or BAST temperatures are low, flowpaths from the BASTs should be evaluated before being used.</p>	
10	<p>Check BAST Temperature:</p> <ul style="list-style-type: none"> o Annunciator B-31, BAST TEMP OR LO N2 PRESS - EXTINGUISHED o Annunciator K-22, HEAT TRACING SYSTEM - EXTINGUISHED 	<p>Perform the following:</p> <ul style="list-style-type: none"> a. Verify SI pump suction valves from BASTs closed. <ul style="list-style-type: none"> • MOV-826A or MOV-826B • MOV-826C or MOV-826D b. Open at least one SI pump suction valve from RWST. <ul style="list-style-type: none"> o MOV-825A <p style="text-align: center;">-OR-</p> <ul style="list-style-type: none"> o MOV-825B c. Dispatch AO to locally check BAST and heat tracing temperatures.

12

13

14

15

16

17

18

19

20

21



EOP: ECA-0.1	TITLE: LOSS OF ALL AC POWER RECOVERY WITHOUT SI REQUIRED	REV: 6 PAGE 10 of 20
-----------------	--	-------------------------

STEP

ACTION/EXPECTED RESPONSE

RESPONSE NOT OBTAINED

NOTE: Safeguards pump switches should be placed in AUTO only if associated bus is energized.

11 Place Following Pump Switches
In AUTO:

- SI pumps
- RHR pumps
- CNMT spray pumps

NOTE: FR procedures may now be implemented as necessary.

12 Verify Adequate SW Flow To
CCW Hx:

a. Verify at least two SW pumps -
RUNNING

a. Manually start pumps as power
supply permits (258 kw each).
IF less than two SW pumps can be
operated, THEN go to Step 19.

b. Verify AUX BLDG SW isolation
valves - OPEN

b. Establish SW to AUX BLDG (Refer
to Attachment AUX BLDG SW).

- MOV-4615 and MOV-4734
- MOV-4616 and MOV-4735

Continue with Step 19. WHEN SW
restored to AUX BLDG, THEN do
Steps 12c through 18.

c. Verify CNMT RECIRC fan
annunciator C-2, HIGH
TEMPERATURE ALARM - EXTINGUISHED

c. Dispatch AO to locally throttle
flow to CCW Hx to between
5000 gpm and 6000 gpm total flow.

100

101

102

103

104

105

106

107

108

109

110



EOP: ECA-0.1	TITLE: LOSS OF ALL AC POWER RECOVERY WITHOUT SI REQUIRED	REV: 6 PAGE 11 of 20
-----------------	--	-------------------------

STEP	ACTION/EXPECTED RESPONSE	RESPONSE NOT OBTAINED
13	Check If Normal CVCS Operation Can Be Established	
a.	Verify IA restored:	a. Continue with Step 19. <u>WHEN</u> IA restored, <u>THEN</u> do Steps 13 through 18.
	o IA to CNMT (AOV-5392) - OPEN	
	o IA pressure - GREATER THAN 60 PSIG	
b.	Charging pump - ANY RUNNING	b. Continue with Step 19. <u>WHEN</u> any charging pump running, <u>THEN</u> do Steps 14 through 18.

2

3

4

5

6

7

8

9

10

11

12

13



EOP: ECA-0.1	TITLE: LOSS OF ALL AC POWER RECOVERY WITHOUT SI REQUIRED	REV: 6 PAGE 12 of 20
-----------------	--	-----------------------------

STEP	ACTION/EXPECTED RESPONSE	RESPONSE NOT OBTAINED
14	Check If Seal Return Flow Should Be Established:	
a.	Verify RCP #1 seal outlet temperature - LESS THAN 235°F	a. Go to Step 15.
b.	Verify RCP seal outlet valves - OPEN <ul style="list-style-type: none"> • AOV-270A • AOV-270B 	b. Manually open valves as necessary.
c.	Reset both trains of XY relays for RCP seal return isolation valve MOV-313 if necessary	
d.	Open RCP seal return isolation valve MOV-313	d. Perform the following: <ol style="list-style-type: none"> 1) Place MOV-313 switch to OPEN. 2) Dispatch AO with key to RWST gate to locally open MOV-313.
e.	Verify RCP #1 seal leakoff flow - LESS THAN 5.5 GPM	e. <u>IF</u> any RCP seal leakoff flow greater than 5.5 gpm <u>THEN</u> close the affected RCP seal discharge valve: <ul style="list-style-type: none"> • RCP A, AOV-270A • RCP B, AOV-270B <u>IF</u> both RCP seal discharge valves are shut, <u>THEN</u> go to Step 15.
f.	Verify RCP #1 seal leakoff flow - GREATER THAN 0.25 GPM	f. Refer to AP-RCP.1, RCP SEAL MALFUNCTION.

1

2

3

4

5

6

7

8

9

10



EOP: ECA-0.1	TITLE: LOSS OF ALL AC POWER RECOVERY WITHOUT SI REQUIRED	REV: 6 PAGE 13 of 20
-----------------	--	-----------------------------

STEP	ACTION/EXPECTED RESPONSE	RESPONSE NOT OBTAINED
15	Verify PRZR Level - GREATER THAN 13% [40% adverse CNMT]	Continue with Step 19. <u>WHEN</u> PRZR level increases to greater than 13% [40% adverse CNMT], <u>THEN</u> do Steps 16 through 18.
16	Establish Normal Letdown: a. Establish charging line flow to REGEN Hx - GREATER THAN 20 GPM b. Place the following switches to CLOSE: • Letdown orifice valves (AOV-200A, AOV-200B, and AOV-202) • AOV-371, letdown isolation valve • AOV-427, loop B cold leg to REGEN Hx c. Place letdown controllers in MANUAL at 25% open • TCV-130 • PCV-135 d. Reset both trains of XY relays for AOV-371 and AOV-427 if necessary e. Open AOV-371 and AOV-427 f. Open letdown orifice valves as necessary g. Place TCV-130 in AUTO at 105°F h. Place PCV-135 in AUTO at 250 psig i. Adjust charging pump speed and HCV-142 as necessary	<u>IF</u> RCP seal return has been established, <u>THEN</u> establish excess letdown as follows: o Place excess letdown divert valve, AOV-312, to NORMAL. o Ensure CCW from excess letdown open, (AOV-745). o Open excess letdown isolation valve AOV-310. o Slowly open HCV-123 to maintain excess letdown temperature less than 195°F and pressure less than 100 psig. o Adjust charging pump speed as necessary. <u>IF</u> RCP seal return <u>NOT</u> established, <u>THEN</u> consult TSC to determine if excess letdown should be placed in service.

552

2.1

1.4

4.7

4.0

1.1

1.1

1.1

1.1

1.1

1.1

1.1

1.1

1.1

1.1

1.1

1.1

1.1

1.1

1.1

40.0

EOP: ECA-0.1	TITLE: LOSS OF ALL AC POWER RECOVERY WITHOUT SI REQUIRED	REV: 6 PAGE 14 of 20
-----------------	--	-------------------------

STEP	ACTION/EXPECTED RESPONSE	RESPONSE NOT OBTAINED
17	<p>Check VCT Makeup System:</p> <p>a. Verify the following:</p> <ol style="list-style-type: none"> 1) Boric acid flow control valve - SET FOR REQUIRED CSD CONCENTRATION (Refer to Figure SDM) 2) At least one BA and RMW pump in AUTO 3) RMW mode selector switch in AUTO 4) RMW control armed - RED LIGHT LIT <p>b. Check VCT level</p> <ul style="list-style-type: none"> o Level - GREATER THAN 20% -OR- o Level - STABLE OR INCREASING 	<p>a. <u>IF</u> VCT auto makeup can <u>NOT</u> be established, <u>THEN</u> manually control VCT level (Refer to ER-CVCS.1, REACTOR MAKEUP CONTROL MALFUNCTION).</p> <p>b. Manually increase VCT makeup flow as follows:</p> <ol style="list-style-type: none"> 1) Ensure BA transfer pumps and RMW pumps running. <u>IF NOT</u>, <u>THEN</u> dispatch AO to reset MCC C and MCC D UV lockouts as necessary. 2) Place RMW flow control valve HCV-111 in MANUAL and increase RMW flow. 3) Increase boric acid flow as necessary. <p><u>IF</u> VCT level can <u>NOT</u> be restored, <u>THEN</u> go to Step 19.</p>

15-

15

12

12

12

12

12

12

12

12

15

EOP: ECA-0.1	TITLE: LOSS OF ALL AC POWER RECOVERY WITHOUT SI REQUIRED	REV: 6 PAGE 15 of 20
-----------------	--	-------------------------

STEP	ACTION/EXPECTED RESPONSE	RESPONSE NOT OBTAINED
18	Check Charging Pump Suction Aligned To VCT:	
	a. VCT level - GREATER THAN 20%	a. <u>IF</u> VCT level can <u>NOT</u> be maintained greater than 5%, <u>THEN</u> perform the following: 1) Ensure charging pump suction aligned to RWST: o LCV-112B open o LCV-112C closed 2) Continue with Step 19. <u>WHEN</u> VCT level greater than 40%, <u>THEN</u> do Step 18b.
	b. Verify charging pumps aligned to VCT o LCV-112C - OPEN o LCV-112B - CLOSED	b. Manually align valves as necessary.
19	Control PRZR Level:	
	a. Check letdown - IN SERVICE	a. Stop and start charging pumps as necessary to control PRZR level.
	b. Maintain PRZR level between 13% [40% adverse CNMT] and 50%	

4.

10.

11.

12.

13.

14.



EOP: ECA-0.1	TITLE: LOSS OF ALL AC POWER RECOVERY WITHOUT SI REQUIRED	REV: 6 PAGE 16 of 20
-----------------	--	-------------------------

STEP	ACTION/EXPECTED RESPONSE	RESPONSE NOT OBTAINED
<p><u>NOTE:</u></p> <ul style="list-style-type: none"> o If auxiliary spray is in use, spray flow may be increased by closing normal charging valve AOV-294 and normal PRZR spray valves. o When using a PRZR PORV select one with an operable block valve. 		
20	<p>Establish PRZR Pressure Control:</p> <ul style="list-style-type: none"> a. Check letdown - IN SERVICE b. Use PRZR heaters and auxiliary spray valve (AOV-296) to maintain RCS pressure 	<p>a. Perform the following:</p> <ul style="list-style-type: none"> 1) Use PRZR heaters and one PRZR PORV to maintain RCS pressure. IF IA <u>NOT</u> available, <u>THEN</u> Refer to Attachment N2 PORVS to operate PORV. 2) Go to Step 21.
21	<p>Verify Natural Circulation:</p> <ul style="list-style-type: none"> o RCS subcooling based on core exit T/Cs - GREATER THAN 0°F USING FIGURE MIN SUBCOOLING o S/G pressures - STABLE OR DECREASING o RCS hot leg temperatures - STABLE OR DECREASING o Core exit T/Cs - STABLE OR DECREASING o RCS cold leg temperatures - AT SATURATION TEMPERATURE FOR S/G PRESSURE 	<p>Increase dumping steam from intact S/Gs.</p>

1

2

3

4

5

6

7

8

9

10

11

12

13

14

15

16

17

18

19

20

21

22

23

24

25

26

27

28

29

30

31

32

33

34

35

36

37

38

39

40

41

42

43

44

45

46

47

48

49

50

51

52

53

54

55

EOP: ECA-0.1	TITLE: LOSS OF ALL AC POWER RECOVERY WITHOUT SI REQUIRED	REV: 6 PAGE 17 of 20
-----------------	--	-------------------------

STEP	ACTION/EXPECTED RESPONSE	RESPONSE NOT OBTAINED
	<p><u>NOTE:</u> Adverse CNMT conditions or loss of forced air cooling may result in failure of NIS detectors.</p>	
22	Check If Source Range Detectors Should Be Energized:	
a.	Source range channels - DEENERGIZED	a. Go to Step 22e.
b.	Check intermediate range flux - EITHER CHANNEL LESS THAN 10 ⁻¹⁰ AMPS	b. Perform the following: <ol style="list-style-type: none"> 1) <u>IF</u> neither intermediate range channel is decreasing <u>THEN</u> initiate boration. 2) Continue with Step 23. <u>WHEN</u> flux is LESS THAN 10⁻¹⁰ amps on any operable channel, <u>THEN</u> do Steps 22c through e.
c.	Check the following: <ul style="list-style-type: none"> o Both intermediate range channels - LESS THAN 10⁻¹⁰ AMPS <p>-OR-</p> <ul style="list-style-type: none"> o Greater than 20 minutes since reactor trip 	c. Continue with Step 23. <u>WHEN</u> either condition met, <u>THEN</u> do Steps 22d and e.
d.	Verify source range detectors - ENERGIZED	d. Manually energize source range detectors by depressing P-6 permissive defeat pushbuttons (2 of 2). <p><u>IF</u> source ranges can <u>NOT</u> be restored, <u>THEN</u> refer to ER-NIS.1, SR MALFUNCTION and go to Step 23.</p>
e.	Transfer Rk-45 recorder to one source range and one intermediate range channel	

2

3

4

5

6

7

8

9

10

11

12

13

EOP: ECA-0.1	TITLE: LOSS OF ALL AC POWER RECOVERY WITHOUT SI REQUIRED	REV: 6 PAGE 18 of 20
-----------------	--	-------------------------

STEP	ACTION/EXPECTED RESPONSE	RESPONSE NOT OBTAINED
------	--------------------------	-----------------------

CAUTION

- o RCP THERMAL BARRIER COOLING SHOULD BE ESTABLISHED SLOWLY TO MINIMIZE POTENTIAL INTRODUCTION OF STEAM INTO THE CCW SYSTEM AND THERMAL SHOCK TO RCP.
- o RCP SEAL INJECTION SHOULD BE ESTABLISHED SLOWLY TO MINIMIZE RCP THERMAL STRESSES AND POTENTIAL SEAL FAILURES.
- o AS PART OF SUBSEQUENT RECOVERY ACTIONS, RCP(S) SHOULD NOT BE STARTED PRIOR TO A STATUS EVALUATION UNLESS REQUIRED BY AN INADEQUATE CORE COOLING SITUATION.

NOTE: SW should be aligned to CCW Hxs before restoring RCP seal cooling.

23 Check RCP Cooling:

Establish normal cooling to RCPs
(Refer to Attachment SEAL COOLING).

a. Check CCW to RCPs:

- o Annunciator A-7, RCP 1A CCW
RETURN HIGH TEMP OR LOW FLOW
- EXTINGUISHED
- o Annunciator A-15, RCP 1B CCW
RETURN HIGH TEMP OR LOW FLOW
- EXTINGUISHED

b. Check RCP seal injection:

- o Labyrinth seal D/Ps - GREATER THAN 15 INCHES OF WATER

-OR-

- o RCP seal injection flow to each RCP - GREATER THAN 6 GPM

100

100

100

100

100

100

100

100

100

100

100

100

100

100

100

100

100

100

100

100

100

100

100

100

100

100

100

100

100

100

100

100

100

100



EOP: ECA-0.1	TITLE: LOSS OF ALL AC POWER RECOVERY WITHOUT SI REQUIRED	REV: 6 PAGE 19 of 20
-----------------	--	-------------------------

STEP	ACTION/EXPECTED RESPONSE	RESPONSE NOT OBTAINED
24. Verify Adequate Shutdown Margin:		
a. Direct HP to sample RCS and PRZR liquid for boron concentration		
b. Verify boron concentration - GREATER THAN REQUIREMENTS OF FIGURE SDM		b. Borate as necessary.
25 Maintain Stable Plant Conditions		
a. RCS pressure - STABLE		a. Control PRZR heaters and auxiliary spray if available.
b. RCS temperature - STABLE		b. Control dumping steam as necessary.
c. PRZR level - BETWEEN 13% [40% adverse CNMT] and 50%		c. Control charging as necessary.
d. Intact S/G level - BETWEEN 17% [25% adverse CNMT] and 50%		d. Control S/G feed flow as necessary.
26 Verify SI Flow Not Required:		
a. RCS subcooling based on core exit T/Cs - GREATER THAN 0°F USING FIGURE MIN SUBCOOLING		a. Go to ECA-0.2, LOSS OF ALL AC POWER RECOVERY WITH SI REQUIRED, Step 1.
b. PRZR level - GREATER THAN 5% [30% adverse CNMT]		b. Control charging flow to maintain PRZR level.
		IF PRZR level can <u>NOT</u> be maintained, <u>THEN</u> go to ECA-0.2, LOSS OF ALL AC POWER RECOVERY WITH SI REQUIRED, Step 1.

22

1

100

17

18

19

20

21

22

23

24

25

26

27

28

29

30

31

32

33

34

35

36

37

38

39

40

41

42

43

44

45

46

47

48

49

50

51

52

53

54

55

56

57

58

59

60

61

62

63

64

65

66

67

68

69

70

71

72

73

74

75

76

77

78

79

80

81

82

83

84

85

86

87

88

89

90

91

92

93

94

95

96

97

98

99

100



EOP: ECA-0.1	TITLE: LOSS OF ALL AC POWER RECOVERY WITHOUT SI REQUIRED	REV: 6 PAGE 20 of 20
-----------------	--	-------------------------

STEP	ACTION/EXPECTED RESPONSE	RESPONSE NOT OBTAINED
27	Try To Restore Offsite Power To All AC Busses (Refer to ER-ELEC.1, RESTORATION OF OFFSITE POWER)	Maintain plant condition stable using AC emergency power.
28	Determine If Natural Circulation Cooldown Is Required:	
	a. Consult plant staff to determine if RCS cooldown is necessary	a. <u>IF</u> cooldown <u>NOT</u> required, <u>THEN</u> go to O-3, HOT SHUTDOWN WITH XENON PRESENT.
	b. At least one RCP - OPERABLE	b. Go to ES-0.2, NATURAL CIRCULATION COOLDOWN.
	c. Go to O-2.2, PLANT SHUTDOWN FROM HOT SHUTDOWN TO COLD SHUTDOWN	

-END-

EOP: ECA-0.1	TITLE: LOSS OF ALL AC POWER RECOVERY WITHOUT SI REQUIRED	REV: 6 PAGE 1 of 1
-----------------	--	-----------------------

ECA-0.1 APPENDIX LIST

<u>TITLE</u>	<u>PAGES</u>
1) FIGURE MIN SUBCOOLING	1
2) FIGURE SDM	1
3) ATTACHMENT SD-1	1
4) ATTACHMENT SD-2	1
5) ATTACHMENT N2 PORVS	1
6) ATTACHMENT SEAL COOLING	2
7) ATTACHMENT AUX BLDG SW	1

10-11-64

1

2

10-11-64

3

10-11-64

4

5


6

7

EOP: ECA-0.1	TITLE: LOSS OF ALL AC POWER RECOVERY WITHOUT SI REQUIRED	REV: 6 PAGE 1 of 1
-----------------	--	-----------------------

FIGURE MIN SUBCOOLING


NOTE: Subcooling Margin = Saturation Temperature From Figure
Below [-] Core Exit T/C Indication

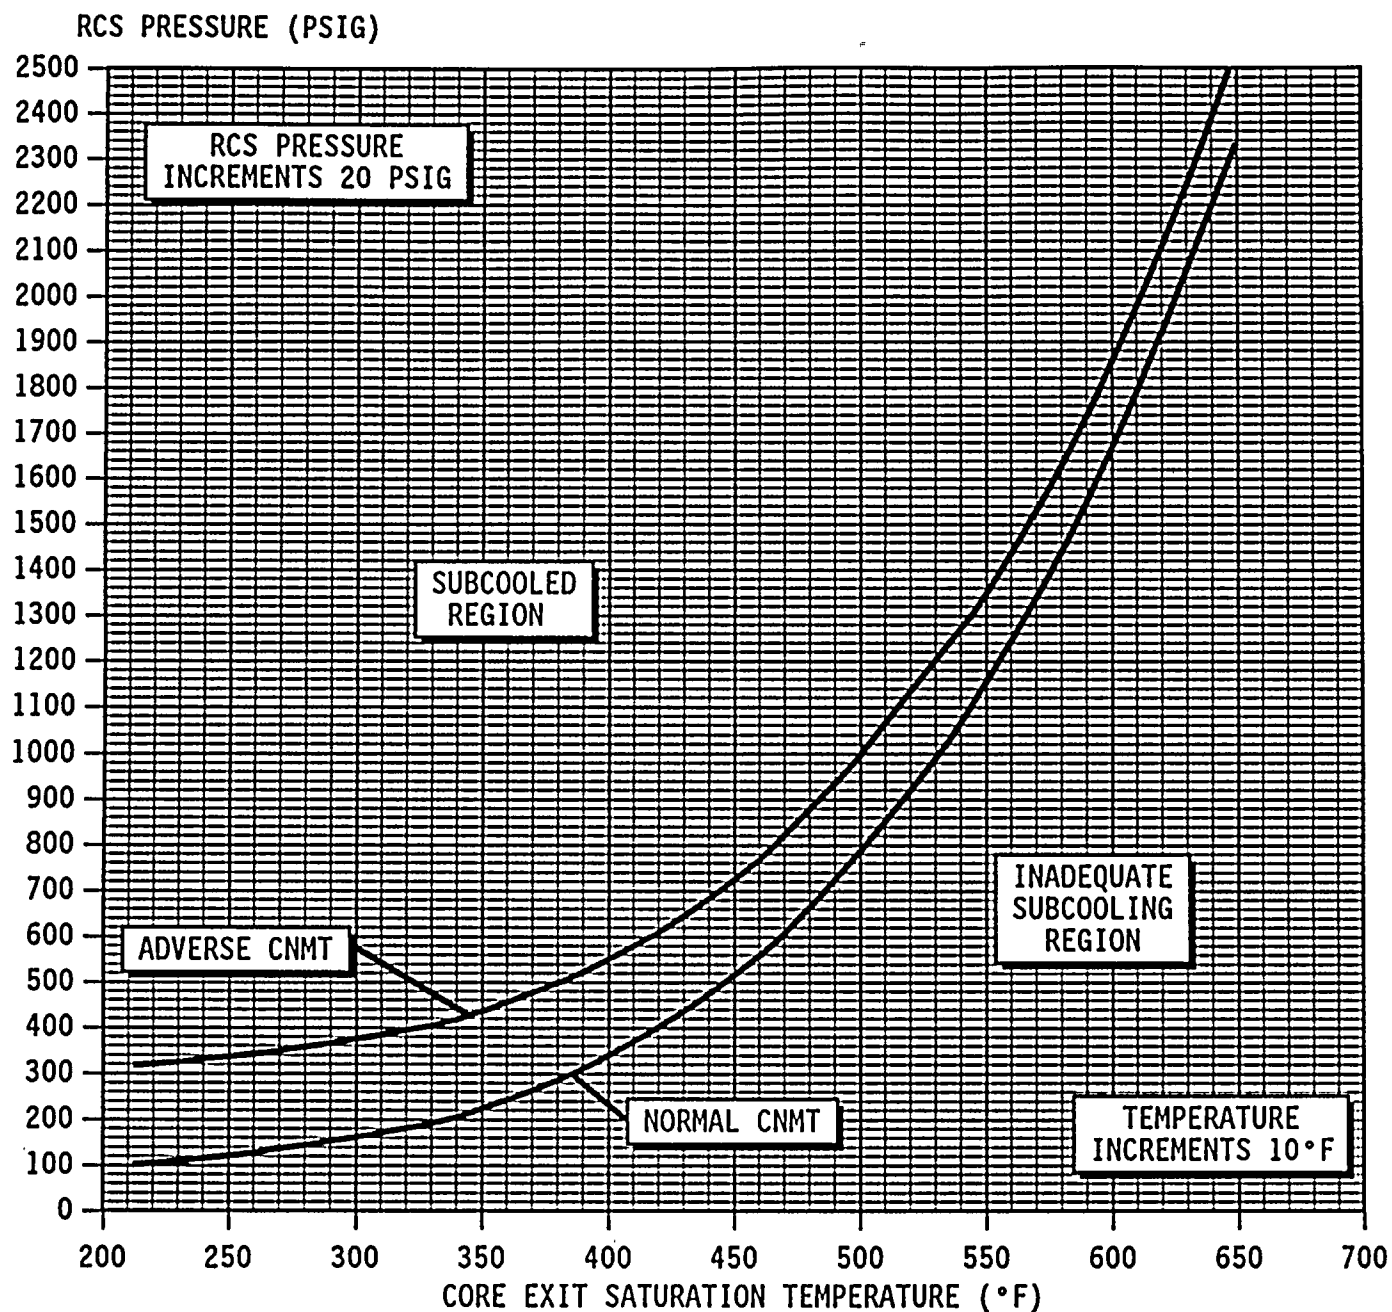



EOP: ECA-0.1	TITLE: LOSS OF ALL AC POWER RECOVERY WITHOUT SI REQUIRED	REV: 6 PAGE 1 of 1
-----------------	--	-----------------------

FIGURE SDM

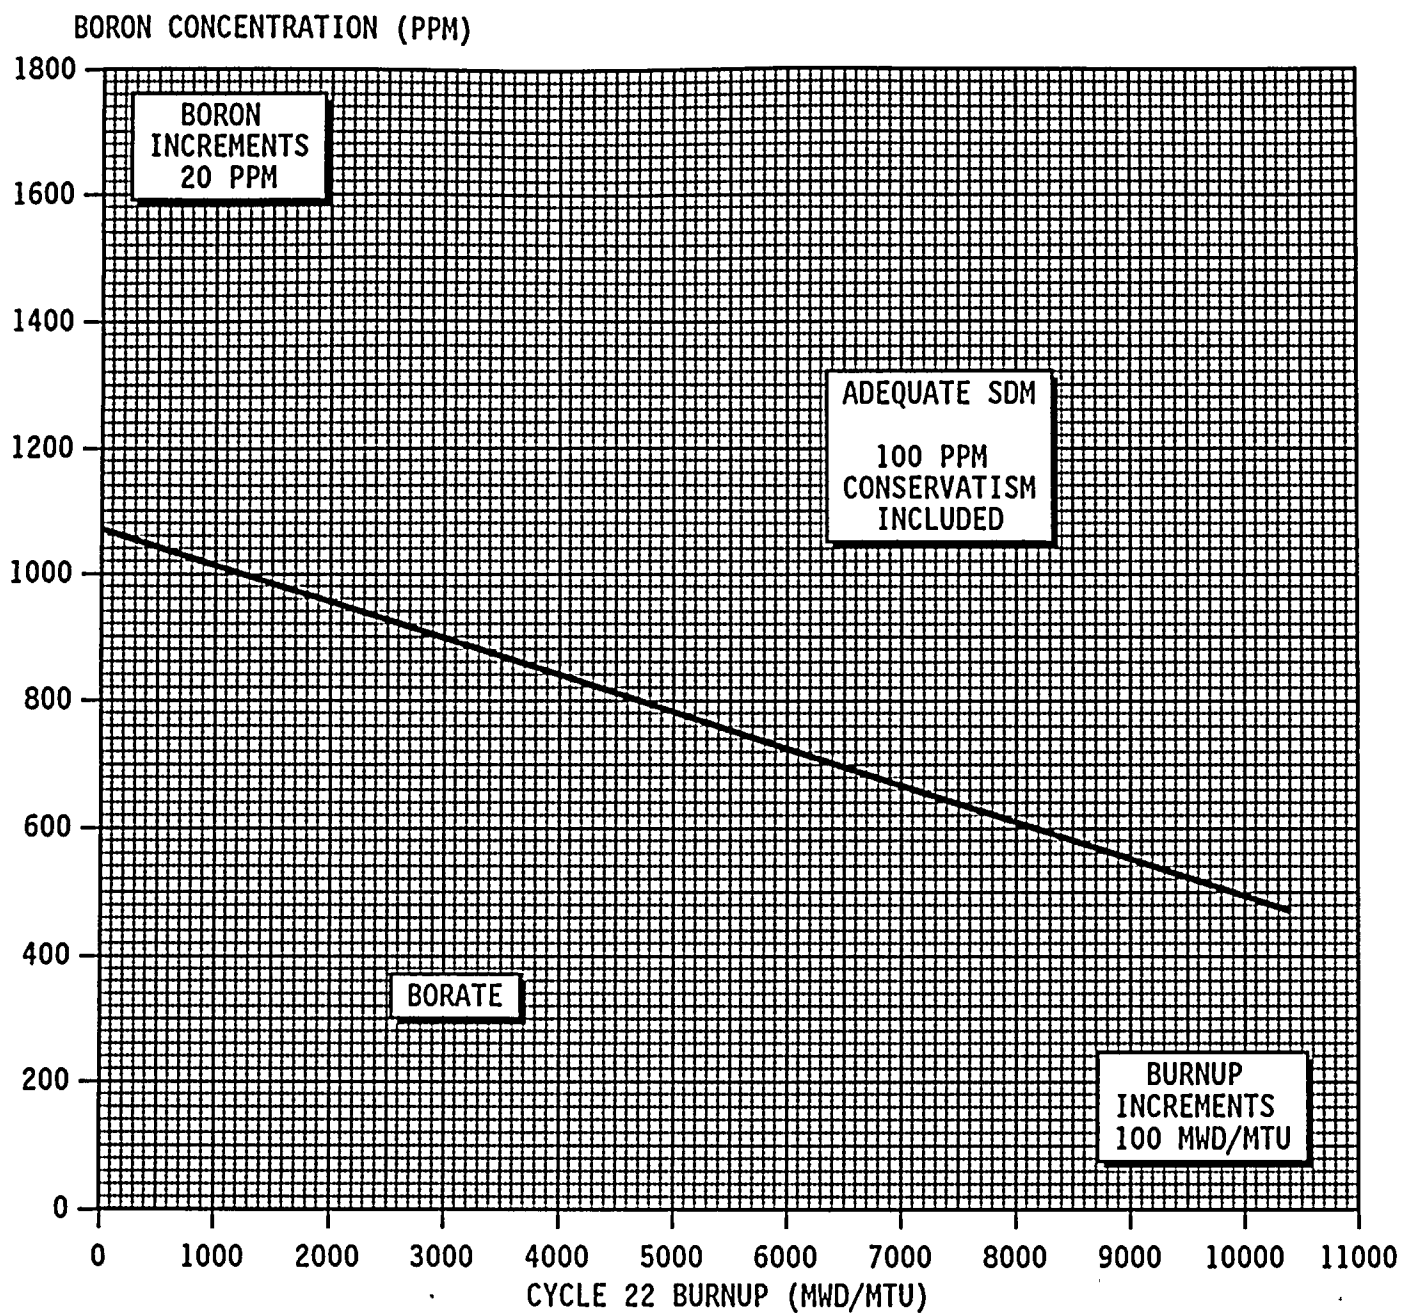

NOTE: To obtain core burnup, use PPCS turn on code BURNUP.

