

ACCELERATED DISTRIBUTION DEMONSTRATION SYSTEM

REGULATORY INFORMATION DISTRIBUTION SYSTEM (RIDS)

ACCESSION NBR: 9208190212 DDC. DATE: 92/08/12 NOTARIZED: NO DOCKET #
 FACIL: 50-397 WPPSS Nuclear Project, Unit 2, Washington Public Powe 05000397
 AUTH. NAME AUTHOR AFFILIATION
 FULLER, R. E. Washington Public Power Supply System
 BAKER, J. W. Washington Public Power Supply System
 RECIP. NAME RECIPIENT AFFILIATION

SUBJECT: LER 92-034-00: on 920713, determined that penetrations in ECCS pump rooms could fail to perform as flooding barrier following design basis flood. Hourly fire/flood tours conducted. Also reported per Part 21.W/920812 ltr.

DISTRIBUTION CODE: 1E22T COPIES RECEIVED: LTR 1 ENCL 1 SIZE: 7
 TITLE: 50.73/50.9 Licensee Event Report (LER), Incident Rpt, etc.

NOTES:

	RECIPIENT ID CODE/NAME	COPIES LTTR ENCL	RECIPIENT ID CODE/NAME	COPIES LTTR ENCL
	PD5 LA	1 1	PD5 PD	1 1
	DEAN, W.	1 1		
INTERNAL:	ACNW	2 2	ACRS	2 2
	AEOD/DOA	1 1	AEOD/DSP/TPAB	1 1
	AEOD/ROAB/DSP	2 2	NRR/DET/EMEB 7E	1 1
	NRR/DLPQ/LHFB10	1 1	NRR/DLPQ/LPEB10	1 1
	NRR/DOEA/OEAB	1 1	NRR/DREP/PRPB11	2 2
	NRR/DST/SELB 8D	1 1	NRR/DST/SICBBH3	1 1
	NRR/DST/SPLBBD1	1 1	NRR/DST/SRXB 8E	1 1
	REG FILE 02	1 1	RES/DSIR/EIB	1 1
	RGN5 FILE 01	1 1		
EXTERNAL:	EG&G BRYCE, J. H	2 2	L ST LOBBY WARD	1 1
	NRC PDR	1 1	NSIC MURPHY, G. A	1 1
	NSIC POORE, W.	1 1	NUDOCS FULL TXT	1 1

NOTE TO ALL "RIDS" RECIPIENTS:

PLEASE HELP US TO REDUCE WASTE! CONTACT THE DOCUMENT CONTROL DESK.
 ROOM P1-37 (EXT. 504-2065) TO ELIMINATE YOUR NAME FROM DISTRIBUTION
 LISTS FOR DOCUMENTS YOU DON'T NEED!

204

WASHINGTON PUBLIC POWER SUPPLY SYSTEM

P.O. Box 968 • 3000 George Washington Way • Richland, Washington 99352

August 12, 1992
G02-92-192


Docket No. 50-397

Document Control Desk
U.S. Nuclear Regulatory Commission
Washington, D.C. 20555

**SUBJECT: NUCLEAR PLANT WNP-2, OPERATING LICENSE NPF-21
LICENSEE EVENT REPORT NO. 92-034**

Transmitted herewith is Licensee Event Report No. 92-034 for the WNP-2 Plant. This report is submitted in response to the report requirements of 10CFR50.73 and discusses the items of reportability, corrective action taken, and action taken to preclude recurrence.

Sincerely,

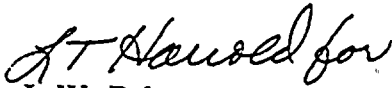


J. W. Baker
WNP-2 Plant Manager (Mail Drop 927M)

JWB/REF/cgeh
Enclosure

cc: Mr. J. B. Martin, NRC - Region V
Mr. C. Sorensen, NRC Resident Inspector (Mail Drop 901A, 2 Copies)
INPO Records Center - Atlanta, GA
Mr. D. L. Williams, BPA (Mail Drop 399)

9208190212 920812
PDR ADOCK 05000397
S PDR

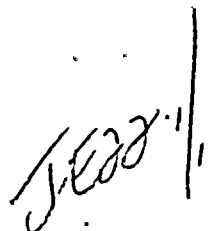

LICENSEE EVENT REPORT (LER)																													
FACILITY NAME (1) Washington Nuclear Plant - Unit 2															DOCKET NUMBER (2) 0 5 0 0 0 3 9 7										PAGE (3) 1 OF 6				
TITLE (4) NONWATER TIGHT PENETRATION SEALS IN ECCS PUMP ROOMS COULD RESULT IN COMMON MODE FAILURE FROM FLOODING																													
EVENT DATE (5)					LER NUMBER (6)					REPORT DATE (7)					OTHER FACILITIES INVOLVED (8)														
MONTH			DAY		YEAR		YEAR		SEQUENTIAL NUMBER		REVISION NUMBER		MONTH			DAY		YEAR		FACILITY NAMES					DOCKET NUMBERS(S)				
0 7 1			3 9 2		9 2		0 3 4		0 0		0 8 1			2 9 2							0 5 0 0 0								
OPERATING MODE (9) 4					THIS REPORT IS SUBMITTED PURSUANT TO THE REQUIREMENTS OF 10 CFR §: (Check one or more of the following) (11)																								
POWER LEVEL (10) 0 0 0					20.402(b)					20.405(C)					50.73(a)(2)(iv)					77.71(b)									
					20.405(a)(1)(i)					50.36(c)(1)					X 50.73(a)(2)(v)					73.73(c)									
					20.405(a)(1)(ii)					50.36(c)(2)					50.73(a)(2)(vii)					X OTHER (Specify in Abstract below and in Text, NRC Form 366A)									
					20.405(a)(1)(iii)					50.73(a)(2)(i)					50.73(a)(2)(viii)(A)														
					20.405(a)(1)(iv)					X 50.73(a)(2)(ii)					50.73(a)(2)(viii)(B)														
					20.405(a)(1)(v)					50.73(a)(2)(iii)					50.73(a)(2)(x)														
Part 21																													
LICENSEE CONTACT FOR THIS LER (12)																													
NAME R. E. Fuller, Compliance Engineer															TELEPHONE NUMBER														
															AREA CODE 5 0 9 3					7 7 - 4 1 4 8									
COMPLETE ONE LINE FOR EACH COMPONENT FAILURE DESCRIBED IN THIS REPORT (13)																													
CAUSE		SYSTEM		COMPONENT		MANUFACTURER		REPORTABLE TO NPRDS		CAUSE		SYSTEM		COMPONENT		MANUFACTURER		REPORTABLE TO NPRDS											
SUPPLEMENTAL REPORT EXPECTED (14)															EXPECTED SUBMISSION DATE (15)					MONTH DAY YEAR									
YES (If yes, complete EXPECTED SUBMISSION DATE) X NO																													
ABSTRACT (16)																													
<p>On July 13, 1992, a Design Engineer determined that selected penetrations in all of the Emergency Core Cooling System (ECCS) pump rooms could fail to perform as a flooding barrier following a design basis flood. This could result in flooding of adjacent ECCS pump rooms. Review and identification of this condition occurred as part of the review process of Plant penetration seals being done per a commitment in LER 89-026. This condition is also reportable per 10CFR Part 21 as a deficiency in the seal design of the ECCS pump room penetrations by the Plant Architect/Engineer (A/E), Burns and Roe, Inc.</p> <p>Immediate corrective actions included hourly fire/flood tours and temporary installation of cameras in stairwells and ECCS pump rooms to provide early warning capability of an unlikely flood condition.</p> <p>The root causes of this condition were less than adequate change management of the penetration seal requirements and inappropriate performance requirements of the sealant material.</p> <p>All of the identified inadequate penetration seals in the ECCS pump rooms will be reworked to be water tight.</p>																													
Continued on next page																													

Continued on next page

LICENSEE EVENT REPORT (LER) TEXT CONTINUATION							
FACILITY NAME (1) Washington Nuclear Plant - Unit 2	DOCKET NUMBER (2) 0 5 0 0 0 3 9 7	LER NUMBER (8)			PAGE (3)		
		Year	Number	Rev. No.			
		92	034	00	2	OF	6
TITLE (4) NONWATER TIGHT PENETRATION SEALS IN ECCS PUMP ROOMS COULD RESULT IN COMMON MODE FAILURE FROM FLOODING							

The safety significance of this condition is negligible. The probability of a flooding event occurring without recognition by the Reactor Operators to mitigate the event is highly unlikely. Also, no event occurred during the period this condition existed that required the penetration seals to perform the flooding barrier function. This condition posed no threat to the health and safety of Plant personnel or the public.

Plant Conditions

Power Level - 0%
Plant Mode - 4

Event Description

On July 13, 1992, a Design Engineer determined that selected penetrations in all of the Emergency Core Cooling System (ECCS) pump rooms could fail to perform as a flooding barrier following a design basis flood. This could result in flooding of adjacent ECCS pump rooms. Review and identification of this condition occurred as part of the review process of Plant penetration seals being done per a commitment in LER 89-026.

There are six ECCS pumps that are in compartments surrounding Primary Containment at the 422-foot elevation. Flooding can occur from various events to an elevation of 466 feet. These events include a long term passive failure of an ECCS pump seal or valve bonnet following a LOCA, or moderate energy pipe cracks in the Reactor Building resulting in flooding of the stairwells or the ECCS pump rooms. The penetration seals protect against common mode failure of ECCS equipment from these flooding events.

During review of ECCS pump room pressurization due to flooding, some of the penetrations in the ECCS pump room walls were found to be fire barrier sealed with BISCO silicone foam SF-20. The silicone foam is not qualified or rated as a watertight seal by the vendor for pressures greater than 0.25-inches w.g. The FSAR states that the ECCS pump rooms are watertight compartments designed to withstand a static head of 44 feet w.g. Therefore, the potential exists for internal flooding among redundant ECCS pump rooms if the silicone foam is exposed to design basis flooding.

The review found approximately 370 penetrating items through walls of the ECCS pump rooms where unqualified materials were used as a sealant for penetrations. The majority of the non-water tight seals are inside conduit around the cables. The majority of the penetration sizes of concern are less than four inches in diameter.

LICENSEE EVENT REPORT (LER) TEXT CONTINUATION							
FACILITY NAME (1) Washington Nuclear Plant - Unit 2	DOCKET NUMBER (2) 0 5 0 0 0 3 9 7	LER NUMBER (8)			PAGE (3)		
		Year	Number	Rev. No.			
		92	034	00	3	OF	6
TITLE (4) NONWATER TIGHT PENETRATION SEALS IN ECCS PUMP ROOMS COULD RESULT IN COMMON MODE FAILURE FROM FLOODING							

Immediate Corrective Action

Hourly flood tours were initiated in appropriate areas of the Plant to ensure mitigation measures could be implemented before the operability of redundant ECCS equipment is compromised due to flooding. In addition, temporary cameras were installed in selected stairwells and ECCS pump rooms to provide additional early warning capability to the Reactor Operators in the unlikely event of a flooding condition. The camera monitors are continuously monitored by personnel for flooding conditions. ECCS pump room flood level instrumentation and corresponding Control Room annunciation were verified operable. In addition, non-Class 1 sump alarms in the ECCS pump rooms are also available to alert the Operators of a possible flooding condition. A Plant procedure was developed to give the Plant Operators direction on how to mitigate a variety of postulated accident conditions. Equipment was prestaged, such as ladders, portable lights, hoists over access hatches, etc., to expedite mitigation of postulated accident conditions. The lowest penetration height of approximately 8 feet above the floor of the ECCS pump rooms provides adequate time for the Operators to mitigate a flooding event and prevent flooding of an adjacent ECCS pump room. Practice exercises were performed with the new procedure verified the time needed for the operators to implement the mitigating actions. These actions were completed prior to startup from the refueling outage.

Further Evaluation and Corrective Action

A. Further Evaluation

1. This event is considered reportable per 10CFR50.73(a)(2)(ii)(A) and (B) as a condition which was unanalyzed and was outside the design basis of the Plant. The BISCO silicone foam in selected ECCS pump room common wall penetrations would not prevent a common mode failure of safety related equipment from a design basis flooding event. This condition is also reportable per 10CFR50.73(a)(2)(v)(A), (B), and (D) as a condition alone that could have prevented the fulfillment of the safety function of systems needed to shutdown the reactor and maintain it in a safe shutdown condition, remove residual heat, and mitigate the consequences of an accident.

The NRC was verbally notified on July 13, 1992, at 1614 hours PST per 10CFR50.72(b)(2)(i) as a degraded condition found while shutdown.

This condition is also reportable per 10CFR Part 21 as a deficiency in the seal design of the ECCS pump room penetrations by the Plant Architect/Engineer (A/E), Burns and Roe, Inc. The deficiency resulted in the possible inability of the ECCS pumping systems to perform their safety function in the unlikely event of a design basis flooding condition.

LICENSEE EVENT REPORT (LER) TEXT CONTINUATION															
FACILITY NAME (1)		DOCKET NUMBER (2)				LER NUMBER (8)			PAGE (3)						
Washington Nuclear Plant - Unit 2		0	5	0	0	0	3	9	7	Year	Number	Rev. No.			
		9	2				0	3	4		0	0	4	OF	6
TITLE (4)		NONWATER TIGHT PENETRATION SEALS IN ECCS PUMP ROOMS COULD RESULT IN COMMON MODE FAILURE FROM FLOODING													

2. In 1978, the NRC issued IE Circular Number 78-06 which required divisional ECCS equipment installed in water tight rooms to preclude common mode flooding. Holders of reactor operating licenses were instructed to assure that pathways that could lead to common flooding of redundant equipment did not exist in their facilities. In 1978 the WNP-2 FSAR was issued stating, "The [reactor building] compartments, comprising interior walls and building exterior walls and doors and penetrations therein, are designed so that any one compartment at a time can withstand flooding to elevation 466'-3", slightly above the operating level of the suppression chamber pool, which is 44 feet above the top of the foundation mat." The current revision of the FSAR, Revision 44, contains this statement.

The A/E's 1980 design specification for penetration seals to be installed at elevations below 471 feet in the Reactor Building required them to be water tight to a pressure of 35 feet w.g. This did not agree with the FSAR statement of 44 feet w.g. on flooding pressure. The design specification for the seals was changed later in the same year to 46 feet w.g. to account for increased pressure due to seismic sloshing. In December of 1982 the A/E inappropriately reduced the seal pressure requirement to 25 feet w.g. for seals installed between elevations of 461.5 feet and 436 feet. This requirement is less than what the actual pressure would be of 30 feet w.g. at 436 feet elevation with the water level at 466 feet elevation. At the same time the maximum pressure requirement for seals installed below 436 feet was also inappropriately reduced to 39 feet w.g., which is less than the 44 feet w.g. indicated in the FSAR. In February of 1983, the A/E deleted the water tight pressure requirement for penetration seals entirely. The basis for this change was not documented.

3. The root causes of inadequate penetration sealant in the ECCS pump rooms were 1) **Less Than Adequate Change Management because System Interaction Was Not Considered,** and 2) **Inappropriate Performance Requirements of Plant Equipment Design.** With respect to the first root cause, the water tight pressure requirement for the seals was deleted without consideration by the A/E of common mode failure of ECCS equipment due to flooding. The second root cause is the result of inconsistent performance requirements of the sealant material and design with regard to the design basis requirements of the ECCS pump rooms.
4. A contractor has been retained to perform testing on a variety of sealant materials that will satisfy the water pressure requirements. The material must also be compatible with the existing fire barrier sealant or perform that function as well. Major difficulties encountered include achieving complete sealing inside conduit that have a high cable fill rate and allowing adequate cure time before testing.

LICENSEE EVENT REPORT (LER) TEXT CONTINUATION													
FACILITY NAME (1)		DOCKET NUMBER (2)					LER NUMBER (8)			PAGE (3)			
Washington Nuclear Plant - Unit 2		0 5 0 0 0 3 9 7					Year	Number		Rev. No.			
							9 2	0 3 4		0 0	5	OF	6
TITLE (4) NONWATER TIGHT PENETRATION SEALS IN ECCS PUMP ROOMS COULD RESULT IN COMMON MODE FAILURE FROM FLOODING													

Final testing of the chosen sealant material is expected to be completed by the middle of August, 1992. Rework of the penetration seals is planned to be completed by the end of September, 1992.

5. There were no other structures, components, or systems inoperable prior to the event which contributed to the event.

B. Further Corrective Action

1. The penetrations in the affected ECCS pump rooms will be reworked to be water tight by September 30, 1992.
2. Evaluations will be performed by September 30, 1992 to consider additional flood monitoring instrumentation.

Safety Significance

The safety significance of this condition is negligible. The source of flooding is from moderate energy line breaks rather than from high energy line breaks. Therefore, recognition of the condition before significant flooding occurs is more likely. In addition, there are Class I level indications in each of the ECCS pump rooms and sump pump monitors to provide reliable flooding information to the Reactor Operators. The probability of a flooding event occurring without recognition by the Reactor Operators to mitigate the event is highly unlikely. Also, no event occurred during the period this condition existed that required the penetration seals to perform the flooding barrier function. This condition posed no threat to the health and safety of Plant personnel or the public.

Similar Events

LER 89-026 documents identification of selected Steam Tunnel penetration seals that could have failed to withstand the internal pressure from a design basis Main Steamline break. A commitment made in LER 89-026 to review Plant penetration seals for pressure requirements identified the condition of the ECCS pump room penetration seals. This review has been completed, and no other penetration seals were identified that would be needed to withstand pressure under accident conditions.

LICENSEE EVENT REPORT (LER) TEXT CONTINUATION															
FACILITY NAME (1)		DOCKET NUMBER (2)					LER NUMBER (8)			PAGE (3)					
Washington Nuclear Plant - Unit 2		0	5	0	0	0	3	9	7	Year	Number	Rev. No.			
		9	2				0	3	4	0	0		6	OF	6
TITLE (4)		NONWATER TIGHT PENETRATION SEALS IN ECCS PUMP ROOMS COULD RESULT IN COMMON MODE FAILURE FROM FLOODING													

EIIS Information

Text Reference

High Pressure Core Spray System
Low Pressure Core Spray System
RHR/Containment Spray
Reactor Core Isolation Cooling System

EIIS Reference

System Component

BG PEN
BM PEN
BO PEN
BN PEN