

# ACCELERATED DOCUMENT DISTRIBUTION SYSTEM

REGULARY INFORMATION DISTRIBUTION SYSTEM (RIDS)

ACCESSION NBR:9308040015 DOC.DATE: 93/07/23 NOTARIZED: NO DOCKET #  
 FACIL:STN-50-528 Palo Verde Nuclear Station, Unit 1, Arizona Publi 05000528  
 AUTH.NAME AUTHOR AFFILIATION  
 BRADISH,T.R. Arizona Public Service Co. (formerly Arizona Nuclear Power  
 LEVINE,J.M. Arizona Public Service Co. (formerly Arizona Nuclear Power  
 RECIP.NAME RECIPIENT AFFILIATION

SUBJECT: LER 89-012-02:on 890510,emergency lighting sys deficiencies  
 identified due to inadequate verification of lighting  
 requirements.Emergency lighting sys upgraded.W/930723 ltr.

DISTRIBUTION CODE: IE22T COPIES RECEIVED:LTR 1 ENCL 1 SIZE: 12  
 TITLE: 50.73/50.9 Licensee Event Report (LER), Incident Rpt, etc.

NOTES:STANDARDIZED PLANT

 
05000528

	RECIPIENT ID CODE/NAME	COPIES LTTR ENCL	RECIPIENT ID CODE/NAME	COPIES LTTR ENCL
	PDV LA	1 1	PDV PD	1 1
	TRAMMELL,C	1 1	TRAN,L	1 1
INTERNAL:	ACNW	2 2	ACRS	2 2
	AEOD/DOA	1 1	AEOD/DSP/TPAB	1 1
	AEOD/ROAB/DSP	2 2	NRR/DE/EELB	1 1
	NRR/DE/EMEB	1 1	NRR/DORS/OEAB	1 1
	NRR/DRCH/HHFB	1 1	NRR/DRCH/HICB	1 1
	NRR/DRCH/HOLB	1 1	NRR/DRIL/RPEB	1 1
	NRR/DRSS/PRPB	2 2	NRR/DSSA/SPLB	1 1
	NRR/DSSA/SRXB	1 1	REG FILE 02	1 1
	RES/DSIR/EIB	1 1	RGN5 FILE 01	1 1
EXTERNAL:	EG&G BRYCE,J.H	2 2	L ST LOBBY WARD	1 1
	NRC PDR	1 1	NSIC MURPHY,G.A	1 1
	NSIC POORE,W.	1 1	NUDOCS FULL TXT	1 1

NOTE TO ALL "RIDS" RECIPIENTS:

PLEASE HELP US TO REDUCE WASTE! CONTACT THE DOCUMENT CONTROL DESK,  
 ROOM P1-37 (EXT. 504-2065) TO ELIMINATE YOUR NAME FROM DISTRIBUTION  
 LISTS FOR DOCUMENTS YOU DON'T NEED!

FULL TEXT CONVERSION REQUIRED  
 TOTAL NUMBER OF COPIES REQUIRED: LTTR 33 ENCL 33



Arizona Public Service Company  
PALO VERDE NUCLEAR GENERATING STATION  
P.O. BOX 52034 • PHOENIX, ARIZONA 85072-2034

JAMES M. LEVINE  
VICE PRESIDENT  
NUCLEAR PRODUCTION

192-00854/JML/TRB/KR  
July 23, 1993

U. S. Nuclear Regulatory Commission  
ATTN: Document Control Desk  
Mail Station P1-37  
Washington, D.C. 20555


Dear Sirs:

**Subject: Palo Verde Nuclear Generating Station (PVNGS)**  
**Unit 1**  
**Docket No. STN 50-528 (License NPF-41)**  
**Licensee Event Report 89-012-02**  
**File: 93-020-404**

Attached please find Supplement Number 2 to Licensee Event Report (LER) 89-012, prepared and submitted pursuant to 10CFR50.73. This LER is being supplemented to correct a reference in Section I.B.16 to a room number located in the Auxiliary Building 100 foot elevation. In accordance with 10CFR50.73(d), a copy of this LER is being forwarded to the Regional Administrator, NRC Region V.

If you have any questions, please contact T. R. Bradish, Manager, Nuclear Regulatory Affairs, at (602) 393-5421.

Sincerely,



JML/TRB/KR/rv


Attachment

cc: W. F. Conway (all with attachment)  
B. H. Faulkenberry  
J. A. Sloan  
INPO Records Center

020092

9308040015 930723  
PDR ADDCK 0500052B  
S PDR



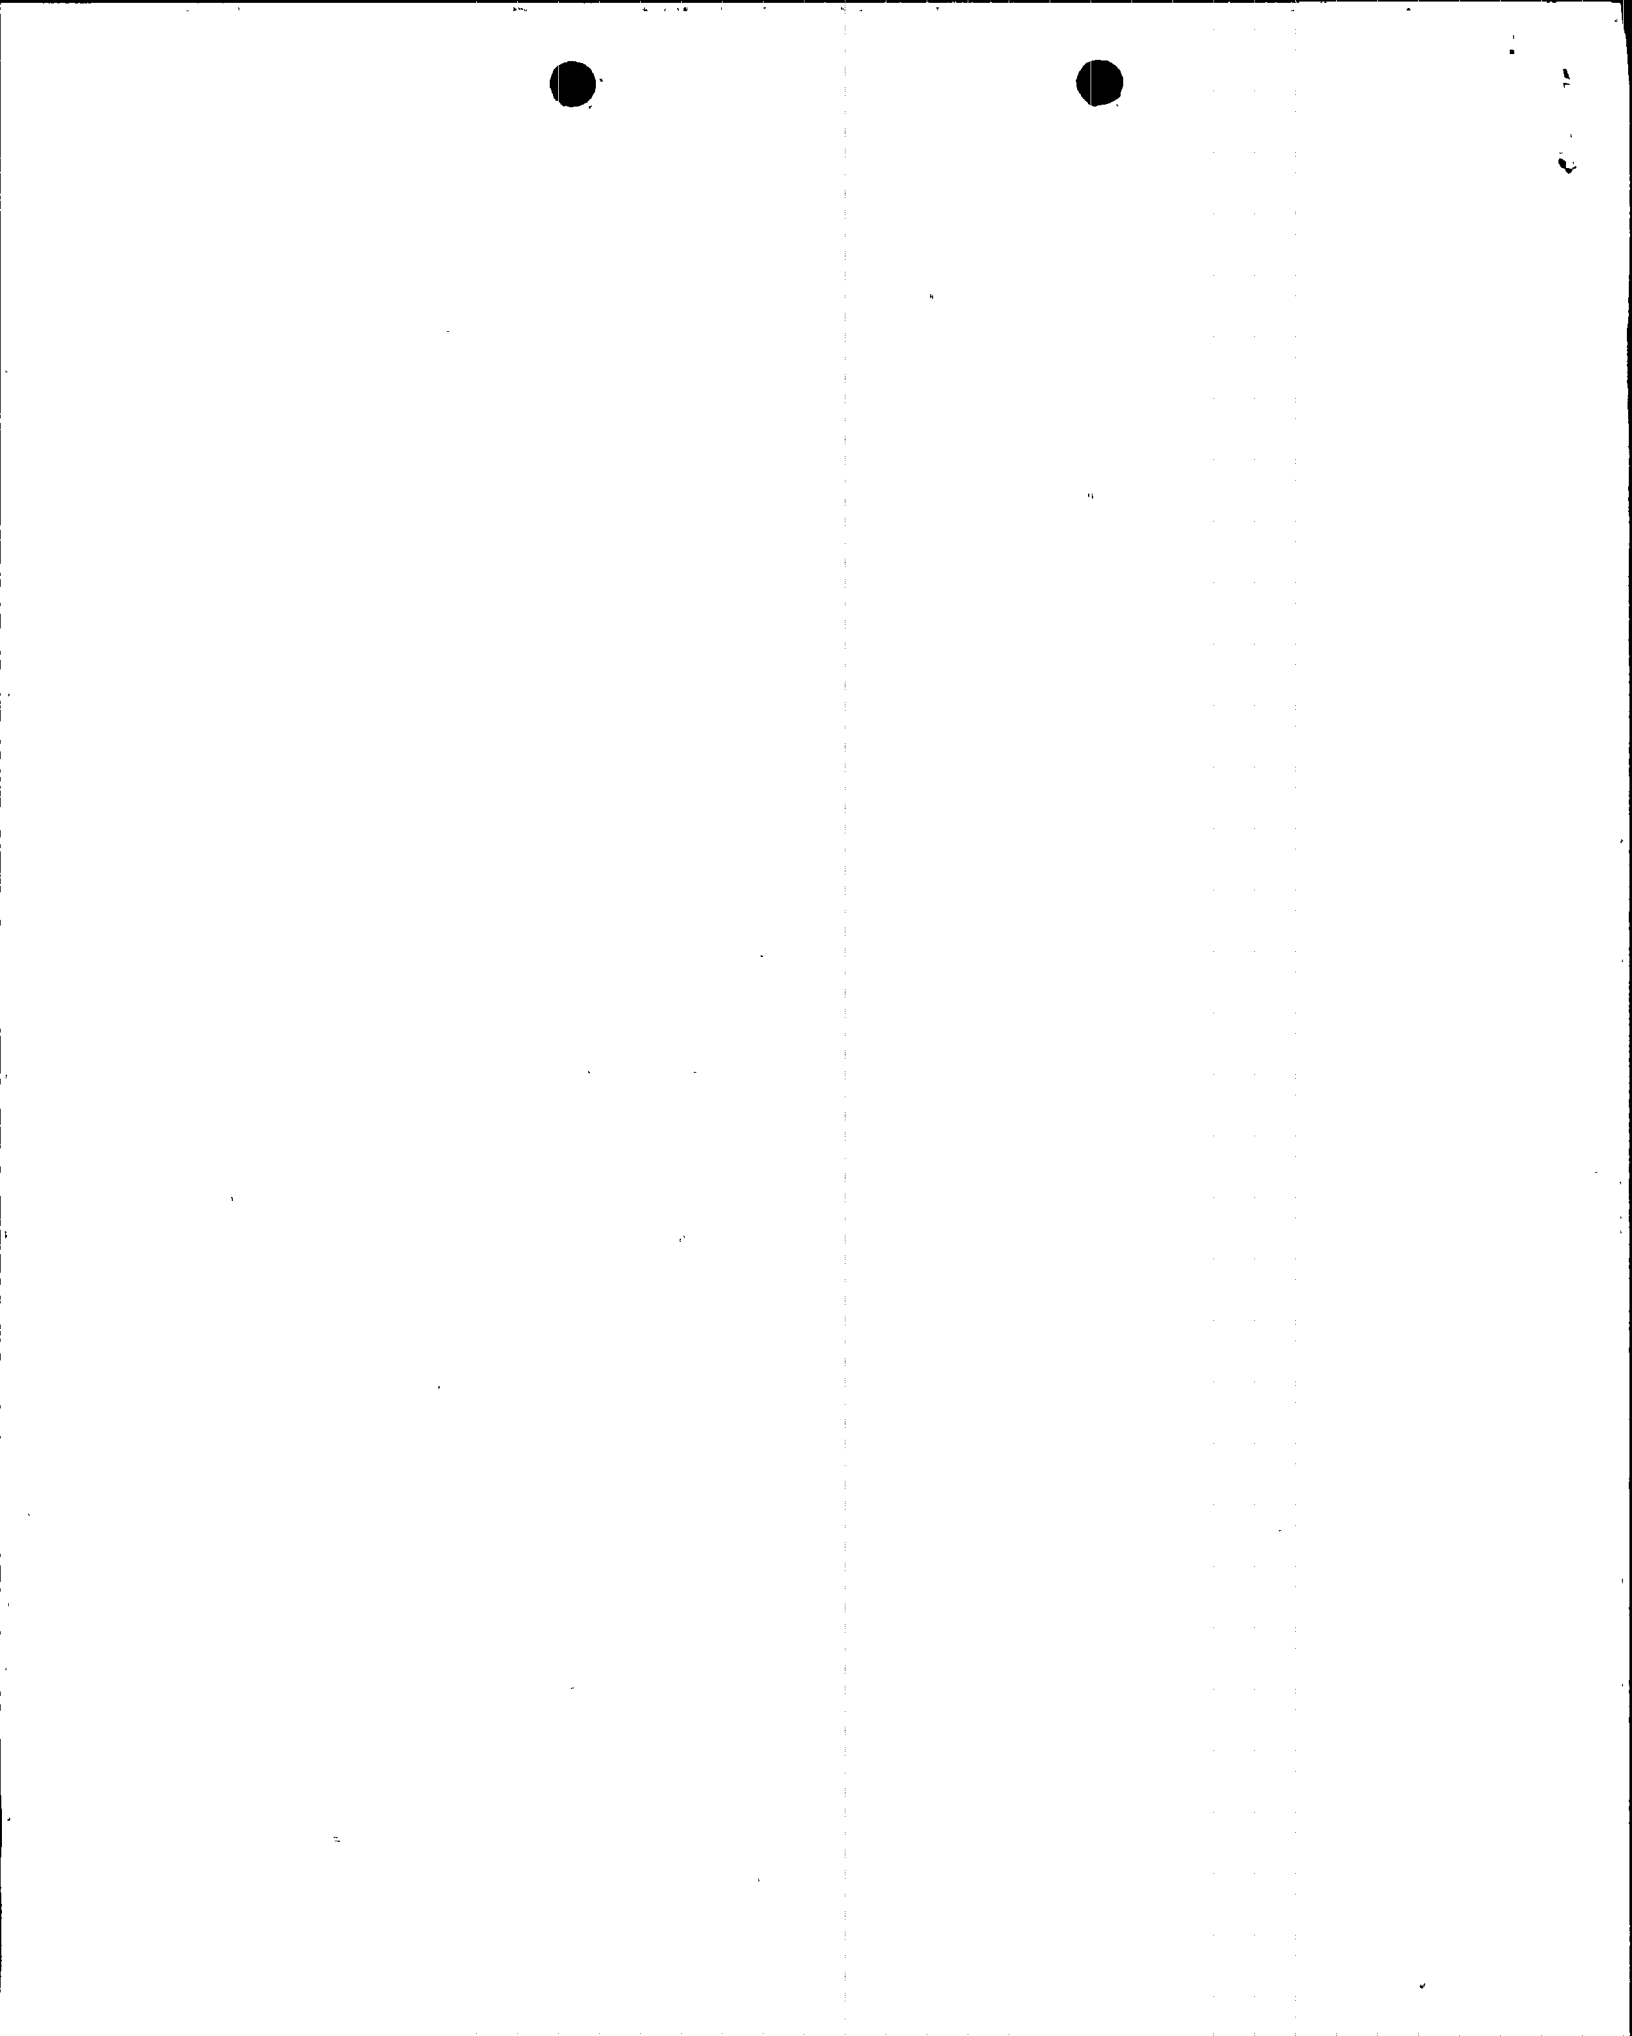

# LICENSEE EVENT REPORT (LER)

FACILITY NAME (1) <b>Palo Verde Unit 1</b>	DOCKET NUMBER (2) <b>0 5 0 0 0 5 2 8</b>	PAGE (3) <b>1 OF 1</b>
---	---	---------------------------

TITLE (4)  
**Emergency Lighting System Deficiencies**

EVENT DATE (5)			LER NUMBER (8)			REPORT DATE (7)			OTHER FACILITIES INVOLVED (8)									
MONTH	DAY	YEAR	YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	MONTH	DAY	YEAR	FACILITY NAMES	DOCKET NUMBER(S)								
0	5	1	0	8	9	8	9	0	1	2	0	7	2	3	9	3	Palo Verde Unit 2	0 5 0 0 0 5 2 9
0	5	1	0	8	9	8	9	0	1	2	0	7	2	3	9	3	Palo Verde Unit 3	0 5 0 0 0 5 3 0

THIS REPORT IS SUBMITTED PURSUANT TO THE REQUIREMENTS OF 10 CFR §: (Check one or more of the following) (11)

OPERATING MODE (9) <b>5</b>	20.402(b)	20.405(c)	50.73(a)(2)(iv)	73.71(b)
POWER LEVEL (10) <b>0 0 0</b>	20.405(a)(1)(i)	50.36(c)(1)	50.73(a)(2)(v)	73.71(c)
	20.405(a)(1)(ii)	50.36(c)(2)	50.73(a)(2)(vi)	<input checked="" type="checkbox"/> OTHER (Specify in Abstract below and in Text, NRC Form 388A)
	20.405(a)(1)(iii)	50.73(a)(2)(i)	50.73(a)(2)(vii)(A)	
	20.405(a)(1)(iv)	50.73(a)(2)(ii)	50.73(a)(2)(vii)(B)	
	20.405(a)(1)(v)	50.73(a)(2)(iii)	50.73(a)(2)(x)	Tech. Spec. 6.9.3

LICENSEE CONTACT FOR THIS LER (12)

NAME <b>Thomas R. Bradish, Manager, Nuclear Regulatory Affairs</b>	TELEPHONE NUMBER
	AREA CODE <b>6 0 2</b>
	<b>3 9 3 - 5 4 2 1</b>

COMPLETE ONE LINE FOR EACH COMPONENT FAILURE DESCRIBED IN THIS REPORT (13)

CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO NRC	CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO NRC

SUPPLEMENTAL REPORT EXPECTED (14)		EXPECTED SUBMISSION DATE (15)	MONTH	DAY	YEAR
<input type="checkbox"/> YES (If yes, complete EXPECTED SUBMISSION DATE)	<input checked="" type="checkbox"/> NO				


ABSTRACT (Limit to 1400 spaces, i.e., approximately fifteen single-space typewritten lines) (16)

On May 10, 1989, Palo Verde Units 1 and 3 were in refueling outages and Palo Verde Unit 2 was in Mode 5 (COLD SHUTDOWN) when APS determined that emergency lighting in Unit 2 did not meet PVNGS design bases or 10CFR50 Appendix R requirements. Twenty-four (24) areas were identified which require the installation of or modification to lighting in order to be able to perform required safe shutdown activities assuming a fire in the control room concurrent with a loss of off-site power. A similar condition was determined to also exist in Units 1 and 3.

The cause of this event was that the original emergency lighting design was developed in 1984 using operating procedures and studies which were not complete and not approved, inadequate engineering guidance for conducting the walkdowns, and inadequate verification that emergency lighting requirements were met.

As corrective action, design changes utilizing approved methodologies were developed to upgrade the emergency lighting. Unit 2 has completed installation of the re-designed emergency lighting. Units 1 and 3 will install the re-designed lighting prior to re-start from their current refueling outages.

There have been no previous similar events reported pursuant to 10CFR50.73. This report is also being provided pursuant to Technical Specification 6.9.3.

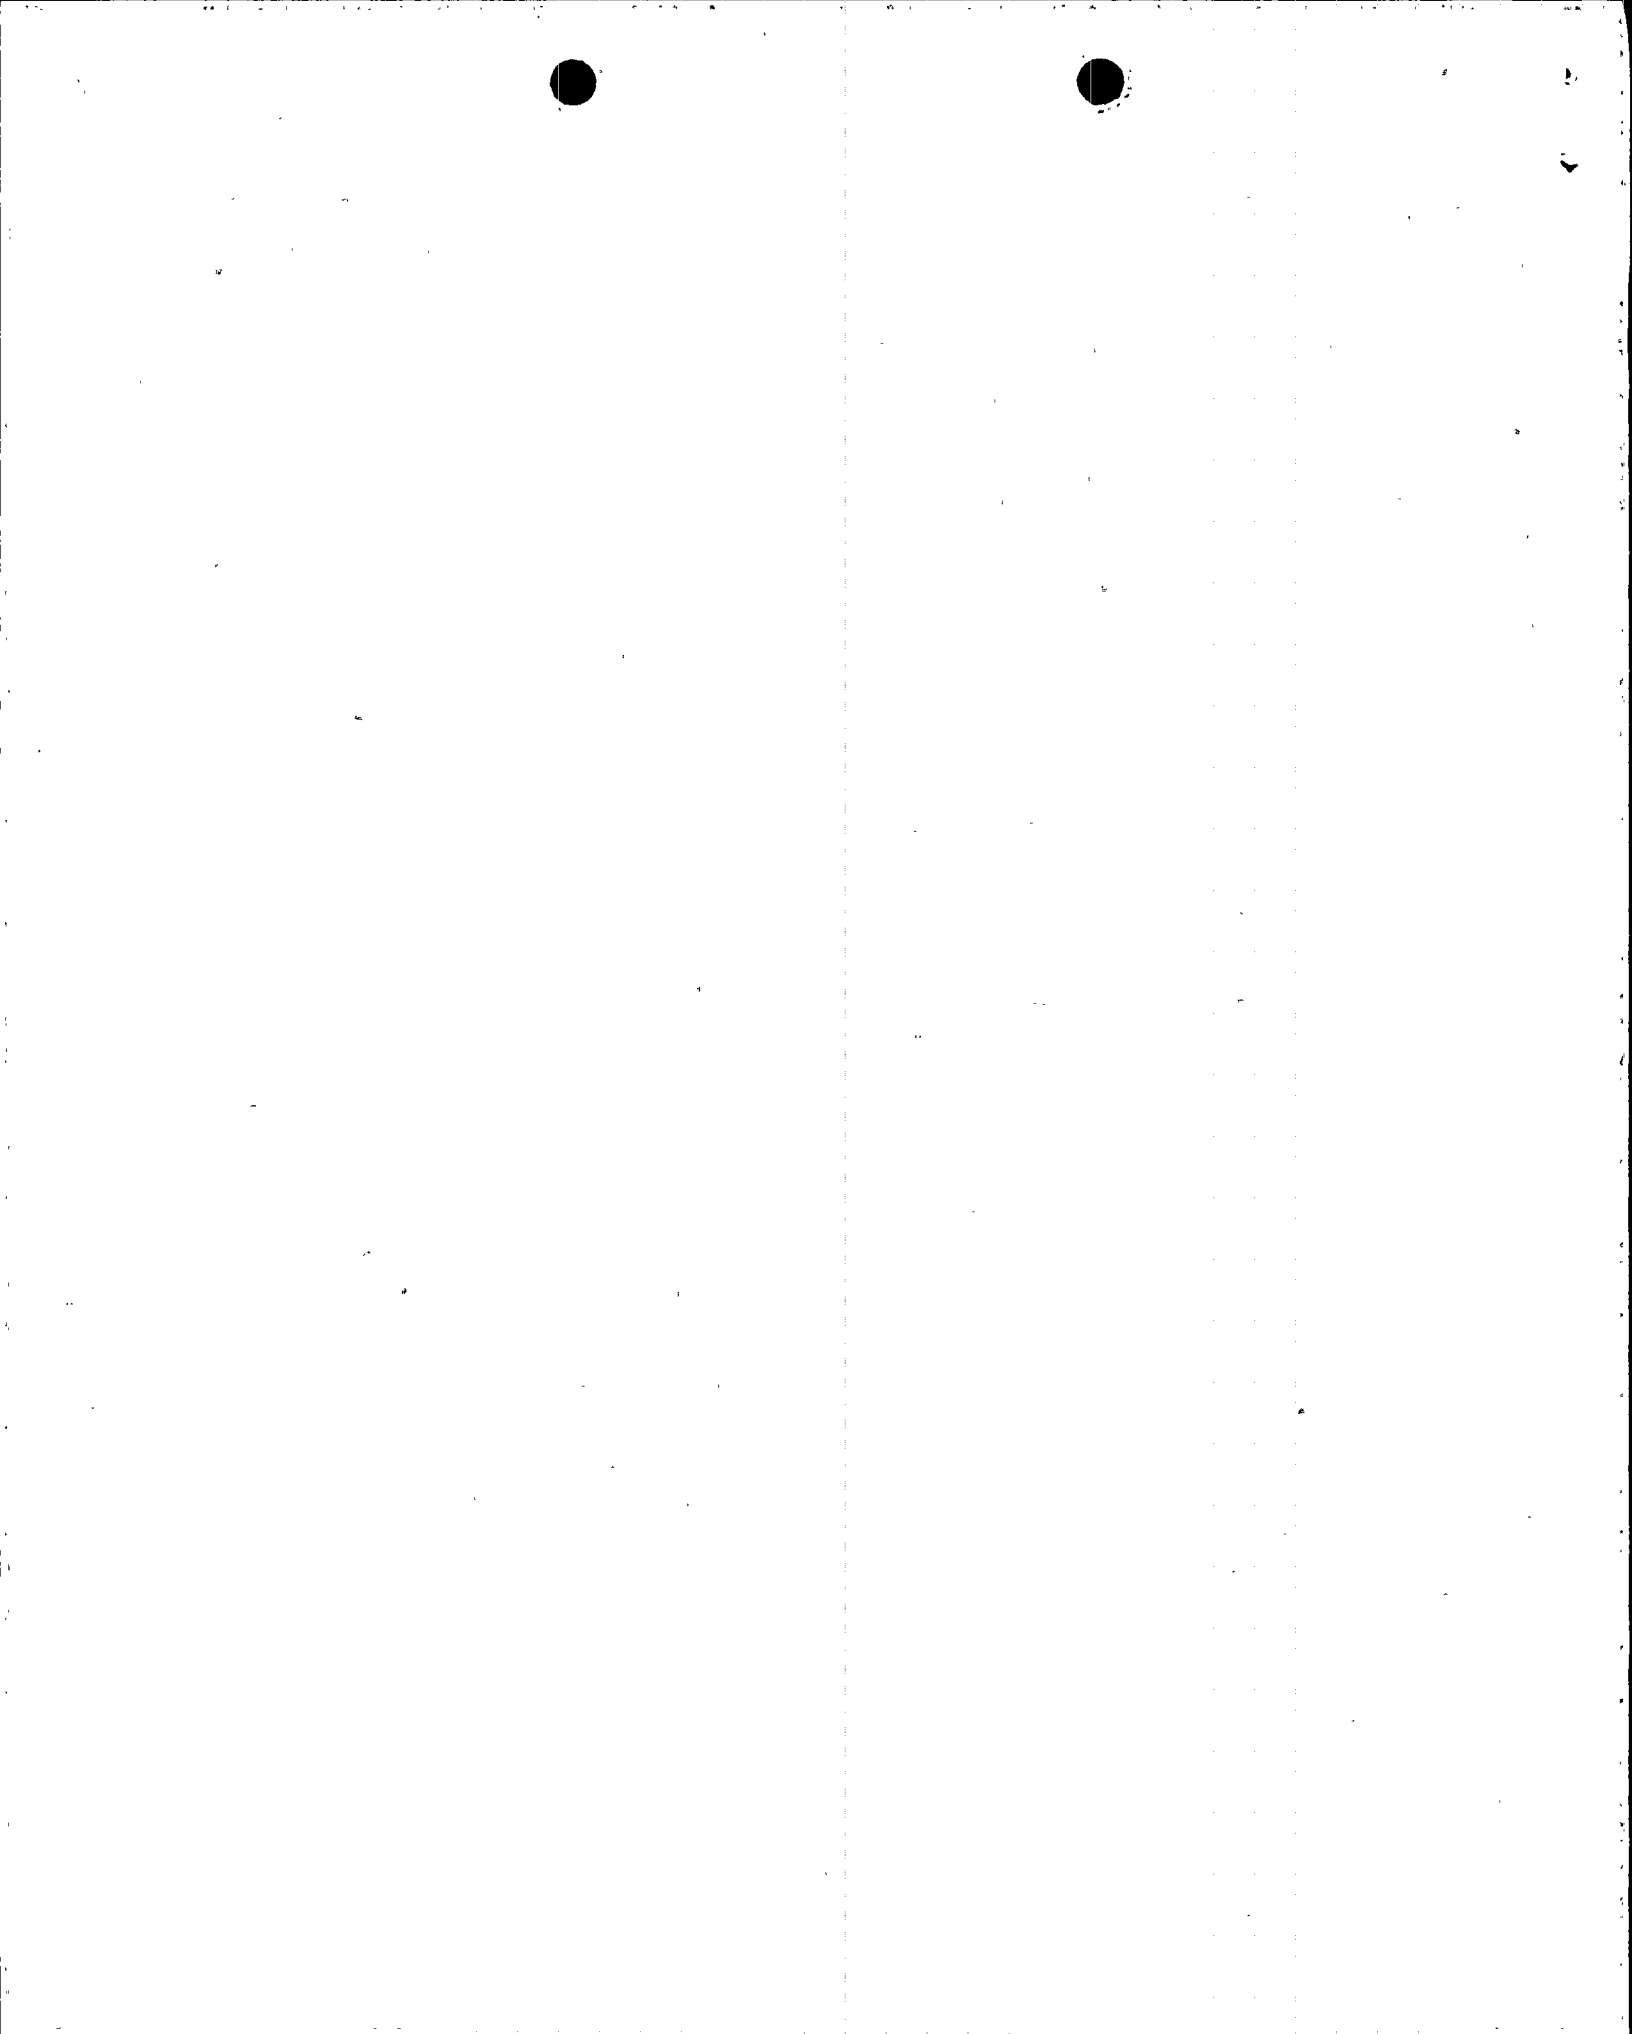

# LICENSEE EVENT REPORT (LER) TEXT CONTINUATION

FACILITY NAME	DOCKET NUMBER	LER NUMBER			PAGE		
Palo Verde Unit 1		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER			
		0	5	0	0	0	5
		2	8	8	9	-	0
		1	2	-	0	2	0
		2	0	2	OF	1	1

TEXT

## I. DESCRIPTION OF WHAT OCCURRED:

### A. Initial Conditions:

The following plant conditions existed on May 10, 1989, at approximately 1400 MST when APS engineering department personnel (utility and contractor, non-licensed) determined that lighting in Unit 2 did not meet the design basis provided in the Palo Verde Updated Final Safety Analysis Report (UFSAR):

Palo Verde Unit 1 was in Mode 5 (COLD SHUTDOWN) at approximately 85 degrees Fahrenheit (F) and atmospheric pressure during a scheduled refueling outage.

Palo Verde Unit 2 was in Mode 5 at approximately 125 degrees F and 130 pounds per square inch-absolute.


Palo Verde Unit 3 was in a refueling outage with the core (AC) off-loaded to the Spent Fuel Pool.

### B. Reportable Event Description (Including Dates and Approximate Times of Major Occurrences):

Event Classification: A condition that was outside the design basis of the plant (10CFR50.73(a)(2)(ii)). Condition which could adversely affect the ability to achieve and maintain safe shutdown (Technical Specification 6.9.3).

During a March 3, 1989, Unit 3 reactor trip event (Reference LER 530/89-001), concerns were identified with the adequacy and proper operation of emergency and essential lighting (FH)(FG) in the vicinity of the Atmospheric Dump Valves (ADV's)(SB)(V) on the 140 foot elevation of the Main Steam Support Structure (MSSS). The concerns arose as the result of attempts to manually operate the ADV's under less than adequate lighting conditions. Therefore, APS has been conducting an extensive evaluation of the PVNGS emergency and essential lighting systems.

Investigation by APS determined that regulations (i.e., 10CFR50 Appendix R) do not require eight (8)-hour emergency lighting in the immediate vicinity of the ADV's. The ADV's can be operated from the control room and remote shutdown panel; therefore, local-manual control is not require to safely shutdown the unit. Current UFSAR commitments are met by eight (8)-hour emergency lighting installed on the 120 foot elevation of the MSSS.

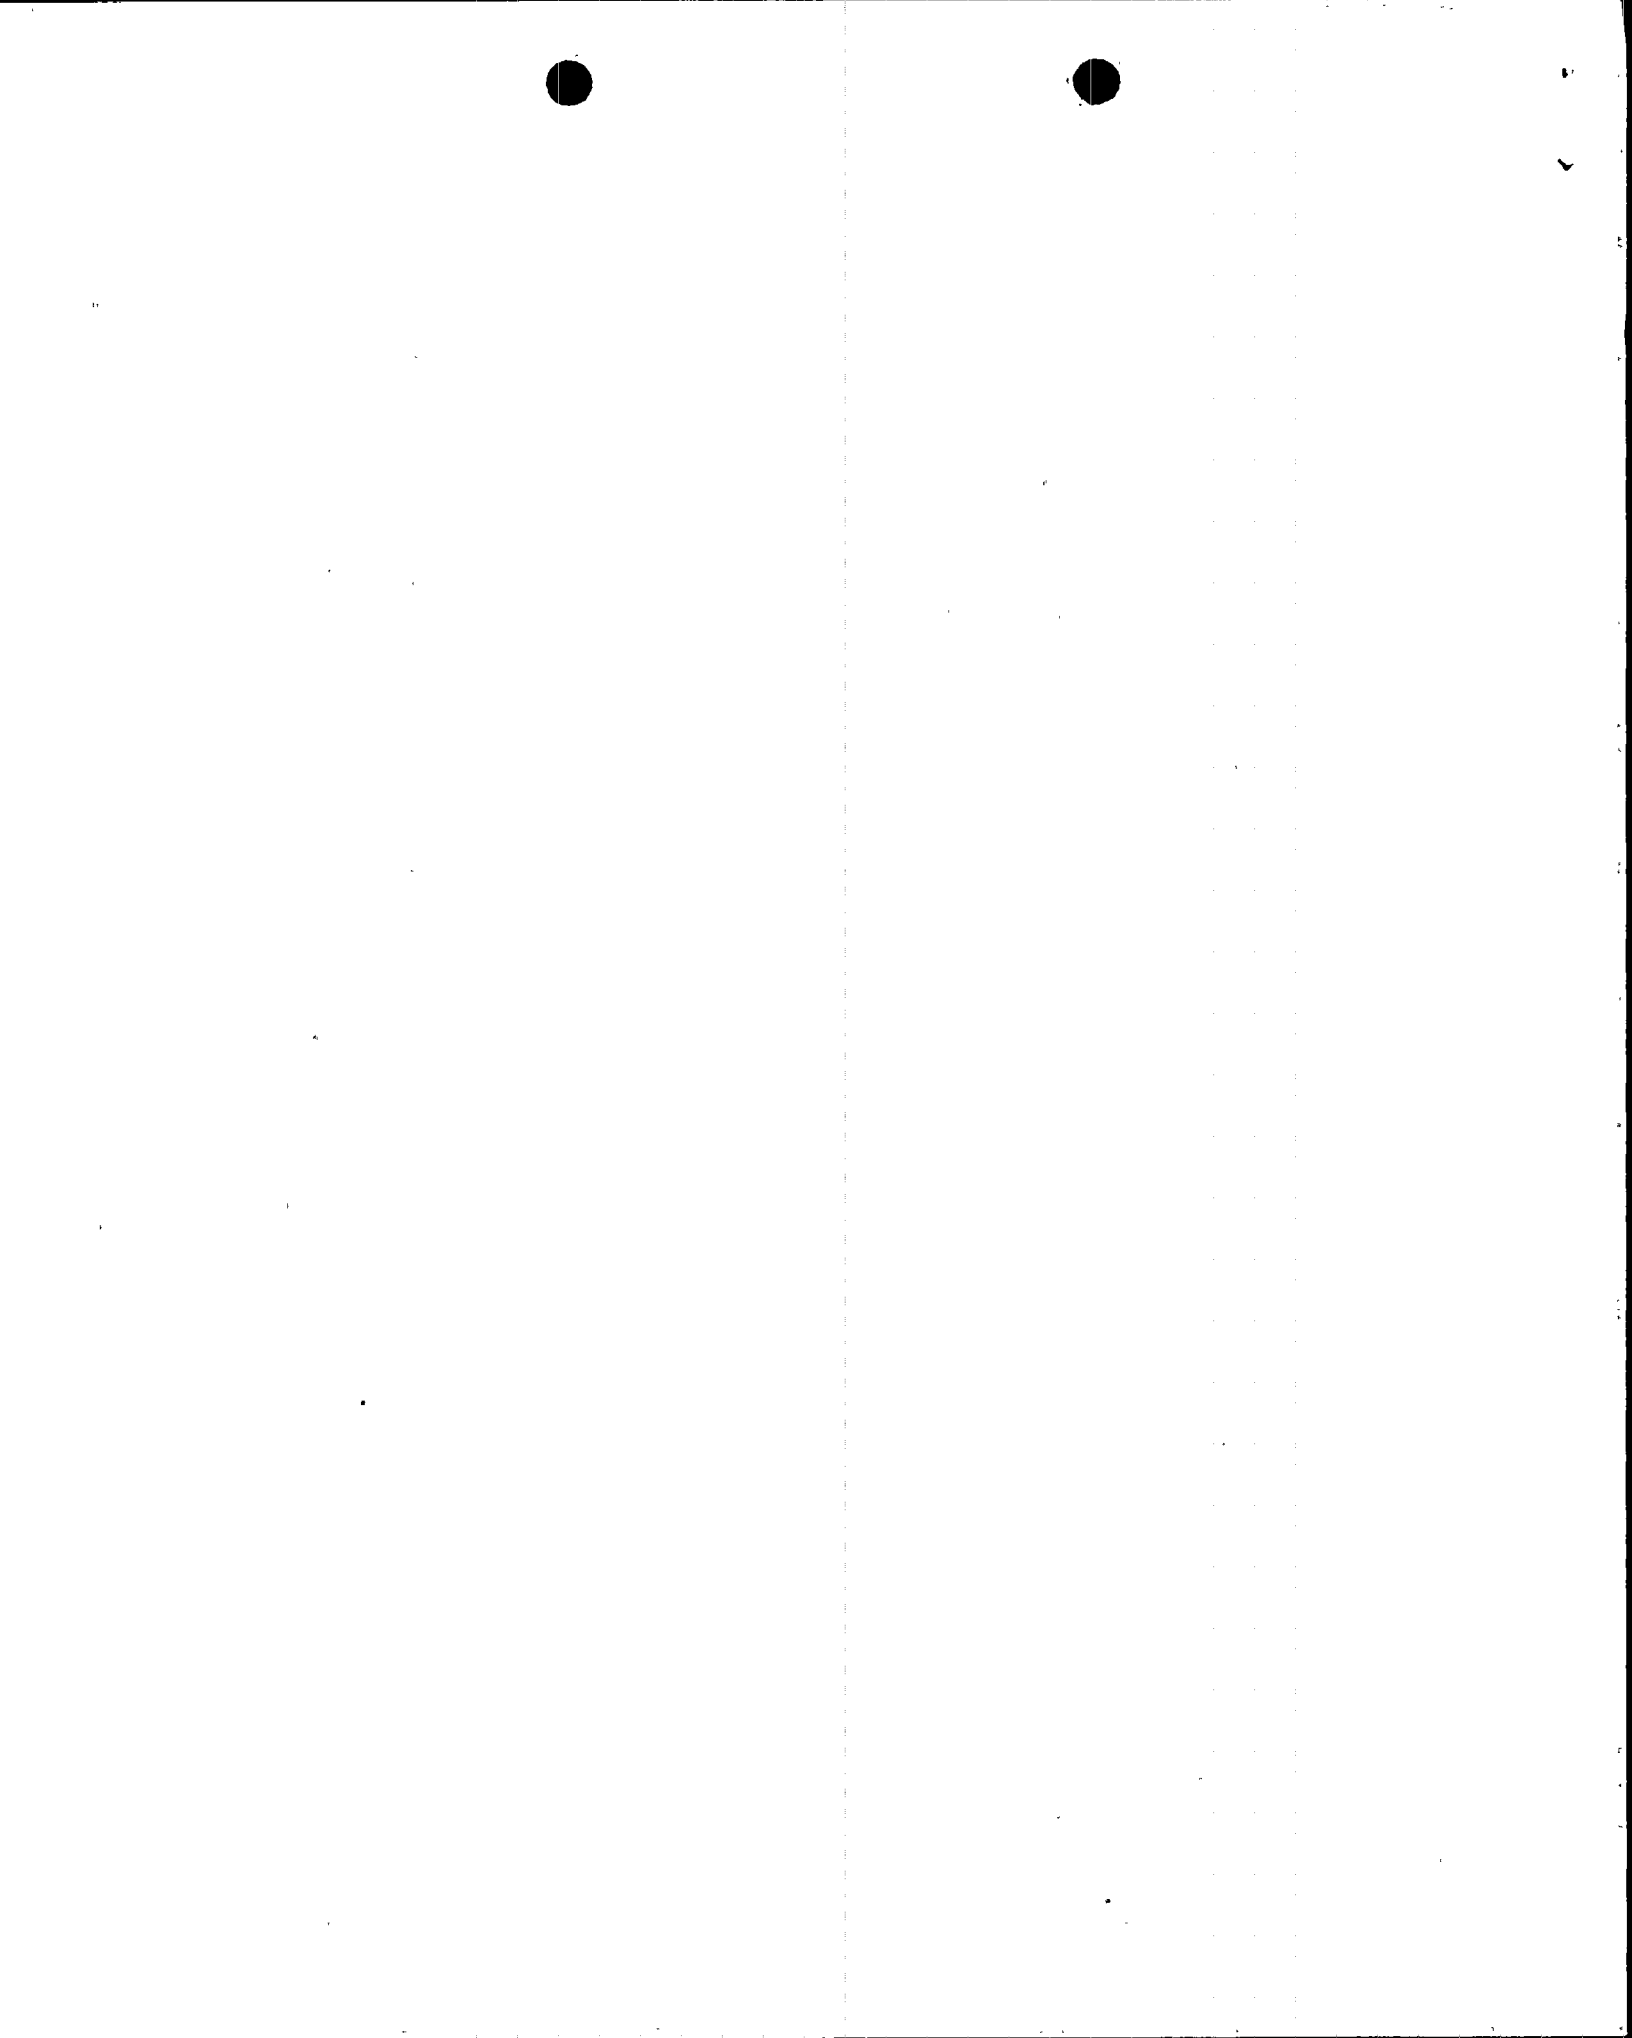



# LICENSEE EVENT REPORT (LER) TEXT CONTINUATION

FACILITY NAME	DOCKET NUMBER	LER NUMBER			PAGE	
Palo Verde Unit 1		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER		
		0	5	0	0	0
		8	8	9	-	0
		1	2	-	0	2
		0	3	OF	1	1

TEXT

However, based upon lessons learned from the Unit 3 reactor trip event, APS is enhancing the emergency lighting in the ADV area of the MSSS to allow local-manual operation of the ADV's.

As part of the APS investigation, engineering department personnel have been reviewing the adequacy of emergency lighting available for performing a shutdown outside the control room due to a fire and assuming a concurrent loss of off-site power and unavailability of normal and essential lighting (per 10CFR50 Appendix R requirements). Utilizing appropriate design documentation and 42A0-2ZZ44, "Shutdown Outside the Control Room Due to Fire and/or Smoke," APS Nuclear Engineering Department (NED) personnel identified the equipment required to be operated from outside the control room. Next, Unit 2 Operations, Engineering Evaluations Department (EED), and Operations Standards personnel performed system walkdowns to identify potential lighting problems. The system walkdowns were performed using the following acceptance criteria:

1. The Safe Shutdown equipment in 42A0-2ZZ24, "Shutdown Outside the Control Room Due to Fire and/or Smoke (Unit 2)," was accessible utilizing a Safe Shutdown pathway being illuminated with (8)-hour emergency lighting.
2. The Safe Shutdown equipment was identifiable utilizing the Equipment Identification Tag and available eight (8)-hour emergency lighting.
3. The actions required by 42A0-2ZZ44, were capable of being performed utilizing available eight (8)-hour emergency lighting.

The potential lighting problems identified during the system walkdowns were reviewed to determine which of the problems were design basis deficiencies (i.e., not in compliance with 10CFR50 Appendix R and UFSAR Design Bases). The review was performed by management and engineering personnel from EED, NED, and Operations Standards. Based upon the results of the system walkdowns and engineering reviews, APS has determined that the following emergency lighting was required to be added in the following Unit 2 areas in order to meet the Emergency Lighting System Design Basis requirements in Section 9.5.1 of the UFSAR or the requirements of 10CFR50 Appendix R (III)(J):

1. Emergency lighting is being added for operating SIB-UV-671, "Containment Spray Control Valve" (BE)(V). SIB-UV-671 is



 
# LICENSEE EVENT REPORT (LER) TEXT CONTINUATION

FACILITY NAME	DOCKET NUMBER	LER NUMBER			PAGE		
Palo Verde Unit 1		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER			
		0	5	0	0	0	5
		8	8	9	-	0	1
		2	8	9	-	0	2
		0	4	OF	1	1	1

TEXT

located on the 88 foot elevation of the Auxiliary Building (NF) and is required to be closed in order to prevent the inadvertent loss of Refueling Water Tank (RWT)(CB)(TK) water and/or the initiation of an undesired Recirculation Actuation (JE)(BP).

2. Emergency lighting is being added for performing necessary operations in Auxiliary Relay Cabinet ZAA-C03 (CAB). The cabinet is located on the 120 foot elevation of the Auxiliary Building. A disconnect switch (JS) is required to be opened in order to prevent spurious signals from opening of Auxiliary Spray Valve CHA-HV-205 (CB)(V) and subsequent uncontrolled cool down.
3. Emergency lighting is being installed for six (6) valves which are required to be operated in order to sample Reactor Coolant System (RCS)(AB) boron concentration:
  - a. Valves EW-HCV-146 and EW-HCV-66, "Nuclear Cooling Water System (NCWS)(CC) Supply Isolations" are located in the Shutdown Heat Exchanger (BP)(HX) Valve (V) Gallery on the 70 foot elevation of the Auxiliary Building. These valves are required to be unlocked and opened in order to provide a source of cooling water (Essential Cooling Water System (BI)) to the Nuclear Sampling System sample cooler (CLR).
  - b. Valve SSN-V819, "RCS Hot Leg Loop 1 Sample Line Isolation Valve (SSN-HV15) Bypass" (V) is located on the 88 foot elevation of the Auxiliary Building. This valve is required to be opened to provide a flow path for the RCS water since valve SSN-HV15, "RCS Hot Leg Loop 1 Sample Line Isolation Valve" (V) fails shut upon a loss of power.
  - c. Valves NC-V049, "Sample Cooler AX-9 Inlet" (CLR) and NC-V054, "Sample Cooler AX-9 Outlet" are located on the 140 foot elevation of the Auxiliary Building. These valves are required to be checked open in order to ensure that the RCS sample is sufficiently cooled.
  - d. Valve NCN-UV-99, "Normal Chillers Return to Nuclear Cooling Isolation" is located on the 77 foot elevation of the Auxiliary Building. This valve is required to be shut in order to isolate the Normal Chillers



# LICENSEE EVENT REPORT (LER) TEXT CONTINUATION

FACILITY NAME	DOCKET NUMBER	LER NUMBER			PAGE		
Palo Verde Unit 1		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER			
	0 5 0 0 0 5 2 8	8 9	0 1 2	0 2	0 5	OF	1 1

TEXT

(KM)(CHU) so that an excessive demand is not placed on the Essential Cooling Water System.

4. Emergency lighting is being installed for flow indicator NC-FI-55, "Sample Cooler AX-9 Nuclear Cooling Water Flow Indication" (FI). The flow indicator is located on the 140 foot elevation of the Auxiliary Building. The flow indicator is required to be monitored during boron sampling to ensure that Nuclear Cooling Water System flow is present.
5. Emergency lighting is being added for performing necessary actions in Direct Current (DC) Control Centers E-PKA-M41 and E-PKB-M42 (EJ). The DC Control Centers are located on the 100 foot elevation of the Control Building (NA). Several control switches and breakers are required to be operated inside the control centers in order to prevent spurious actuations. These actions are required to preclude steam generator (SG) overfilling, uncontrolled RCS cool-down, degraded core cooling, and to isolate spurious control room signals.
6. Emergency lighting is being added for monitoring Emergency Diesel Generator "B". (EK)(DG) operation on panel J-DGB-B01 (PNL). The panel is located on the 100 foot elevation of the Diesel Generator Building (NB).
7. Emergency lighting is being installed for breakers E-NAN-S01L, E-NAN-S01M, E-NAN-S02L, and E-NAN-S02M, "13 kv Supply Breakers to Reactor Coolant Pumps (RCPs)" (BKR)(EA). The breakers are located on the 100 foot elevation of the Turbine Building (NM). The breakers are required to be opened to stop the RCP's and remove fuses (FU) in order to prevent inadvertent pump restarts.
8. Emergency lighting is being added for performing necessary actions in Motor Control Center E-PHB-M32 (ED). The control center is located on the 100 foot elevation of the Control Building. Breaker PHB-M3222 (BKR) is required to be closed following an Emergency Diesel Generator start in order to sequence on the Engineered Safety Features (ESF) Equipment Room Essential Air Handling Units (VI)(AHU).
9. Emergency lighting is being added for performing necessary actions in Auxiliary Relay Cabinet ZJB-C01 (CAB). The cabinet is located on the 100 foot elevation of the Control Building. Disconnect switches are required to be operated

# LICENSEE EVENT REPORT (LER) TEXT CONTINUATION

FACILITY NAME  Palo Verde Unit 1	DOCKET NUMBER  05000528	<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <th colspan="3">LER NUMBER</th> </tr> <tr> <td style="width: 33%;">YEAR</td> <td style="width: 33%;">SEQUENTIAL NUMBER</td> <td style="width: 33%;">REVISION NUMBER</td> </tr> <tr> <td>89</td> <td>012</td> <td>02</td> </tr> </table>	LER NUMBER			YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	89	012	02	<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <th colspan="2">PAGE</th> </tr> <tr> <td>06</td> <td>OF 11</td> </tr> </table>	PAGE		06	OF 11
LER NUMBER																
YEAR	SEQUENTIAL NUMBER	REVISION NUMBER														
89	012	02														
PAGE																
06	OF 11															

## TEXT

in order to prevent spurious signals from opening of ESF Switchgear Room Isolation Dampers (DMP). This is required in order to ensure continued habitability of the ESF Switchgear Rooms and Remote Shutdown Rooms.

10. Emergency lighting is being added for determining the level in the "B" Train Essential Chilled Water System (EC)(KM) surge tank. The EC Surge Tank is located on the 74 foot elevation of the Control Building. The EC Surge Tank Level Indicator (LI) is required to be periodically checked to ensure adequate Chilled Water System inventory.
11. Emergency lighting is being added for opening and racking-out non-class 1E Pressurizer (AB)(PZR) Heater (HTR) Breakers (EA)(BKR) in load center E-NGN-L11. The load center is located on the 100 foot elevation of the Auxiliary Building. This is required in order to prevent spurious signals causing heater operation.
12. Emergency lighting is being added for performing necessary actions in Auxiliary Relay Cabinets ZAN-C01 and ZAN-C02. The cabinets are located at the 120 foot elevation of the Auxiliary Building. Disconnect switches are required to be operated in order to prevent spurious signals from inadvertently operating Charging System valves (CB)(V). This is required in order to maintain control of RCS inventory and boron concentration, and to prevent inadvertent Loss of Auxiliary Spray Flow.
13. Emergency lighting is being added for operating CH-HV-524, "Charging Line Isolation Valve" (CB)(V). The valve is located on the 80 foot level of the Auxiliary Building. The valve is required to be opened in order to ensure a Charging System flowpath for boration.
14. Emergency lighting is being added for illuminating the "B" Emergency Diesel Generator Jacket Cooling Water Surge Tank Level Indicator (LB)(LI); Drain Line N-033-HBDA; valve P-DGB-V013, "Jacket Water Make-up Combined Header Stop"; valve P-DGB-V064, "Jacket Water Make-up Combined Header Solenoid Stop Bypass"; and valve P-DGB-V072, "Jacket Water Standpipe Drain." These components are located on the 100 foot elevation of the Emergency Diesel Generator Building. These components are required to be illuminated in order to support local jacket cooling water make-up requirements.



# LICENSEE EVENT REPORT (LER) TEXT CONTINUATION

FACILITY NAME	DOCKET NUMBER	LER NUMBER			PAGE		
Palo Verde Unit 1		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER			
		0	5	0	0	5	2
		8	9	-	0	1	2
		-	0	2	0	7	OF 1
		1	1				

TEXT

15. Emergency lighting is being added for ensuring Safe Shutdown access/egress pathways in the following locations:
  - a. Turbine Building 100 foot elevation, Room T101.
  - b. Auxiliary Building 70 foot elevation, Room A-B27.
  - c. Control Building east stairwell from the 74 foot elevation to the 100 foot elevation, corridor J-A08, Stairway B.
  - d. Control Building/Turbine Building breezing access/egress on the 100 foot elevation near room J-123.
  - e. Auxiliary Building 70 foot elevation, Room A-B18.
  
16. Existing 1-1/2 hour lighting is being upgraded to 8 hour emergency lighting in the following areas for access/egress:
  - a. Control Building 100 foot elevation, Room J-103.
  - b. Auxiliary Building 100 foot elevation west hallway near Room A-101.
  - c. Auxiliary Building 120 foot level: Room A-202, corridor near Room A-216, and corridor near Room A-236.
  
17. Emergency lighting is being added for performing necessary operations in Auxiliary Relay Cabinet ZAA-C06 (CAB). The cabinet is located on the 120 foot elevation of the Auxiliary Building. Disconnect switch DS-21-08 is required to be opened in order to prevent spurious signals from inadvertently opening an RCS vent valve resulting in an uncontrolled loss of RCS inventory.
  
18. Emergency lighting is being added for E-PKD-H14, "Channel 'D' Battery Charger" (EJ)(BYC). The charger is located on the 100 foot elevation of the Control Building. The charger is required to be disconnected in order to prevent spurious signals from inadvertently actuating the battery charger.

Lighting deficiencies similar to those described above were subsequently determined to exist in Units 1 and 3. No problems in areas other than those described above were discovered.





# LICENSEE EVENT REPORT (LER) TEXT CONTINUATION

FACILITY NAME	DOCKET NUMBER	LER NUMBER				PAGE	
Palo Verde Unit 1		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER			
	0   5   0   0   0   5   2   8	8   9	-   0   1   2	-   0   2	0   8	OF 1   1	

TEXT

- C. Status of structures, systems, or components that were inoperable at the start of the event that contributed to the event:

Other than the emergency lighting deficiencies described above, no structures, systems, or components were inoperable at the start of this event which contributed to the event.

- D. Cause of each component of system failure, if known:

Not applicable - no component or system failures were involved.

- E. Failure mode, mechanism, and effect of each failed component, if knows:

Not applicable - no component failures were involved.

- F. For failures of components with multiple functions, list of systems or secondary functions that were also affected:

Not applicable - no component failures were involved.

- G. For failures that rendered a train of a safety system inoperable, estimated time elapsed from the discovery of the failure until the train was returned to service:

Not applicable - no failures were involved.


- H. Method of discovery of each component or system failure or procedural error:

Not applicable - there were no component or system failures or procedural errors.

- I. Cause of Event:

An independent investigation of this event was conducted in accordance with the PVNGS Incident Investigation Program. As a result of this investigation, it was determined that several factors contributed to the emergency lighting system inadequacies described in Section I.B., in summary these are:

1. No specific walkdown procedure was written or utilized for a 1984 emergency lighting system design verification walkdown.

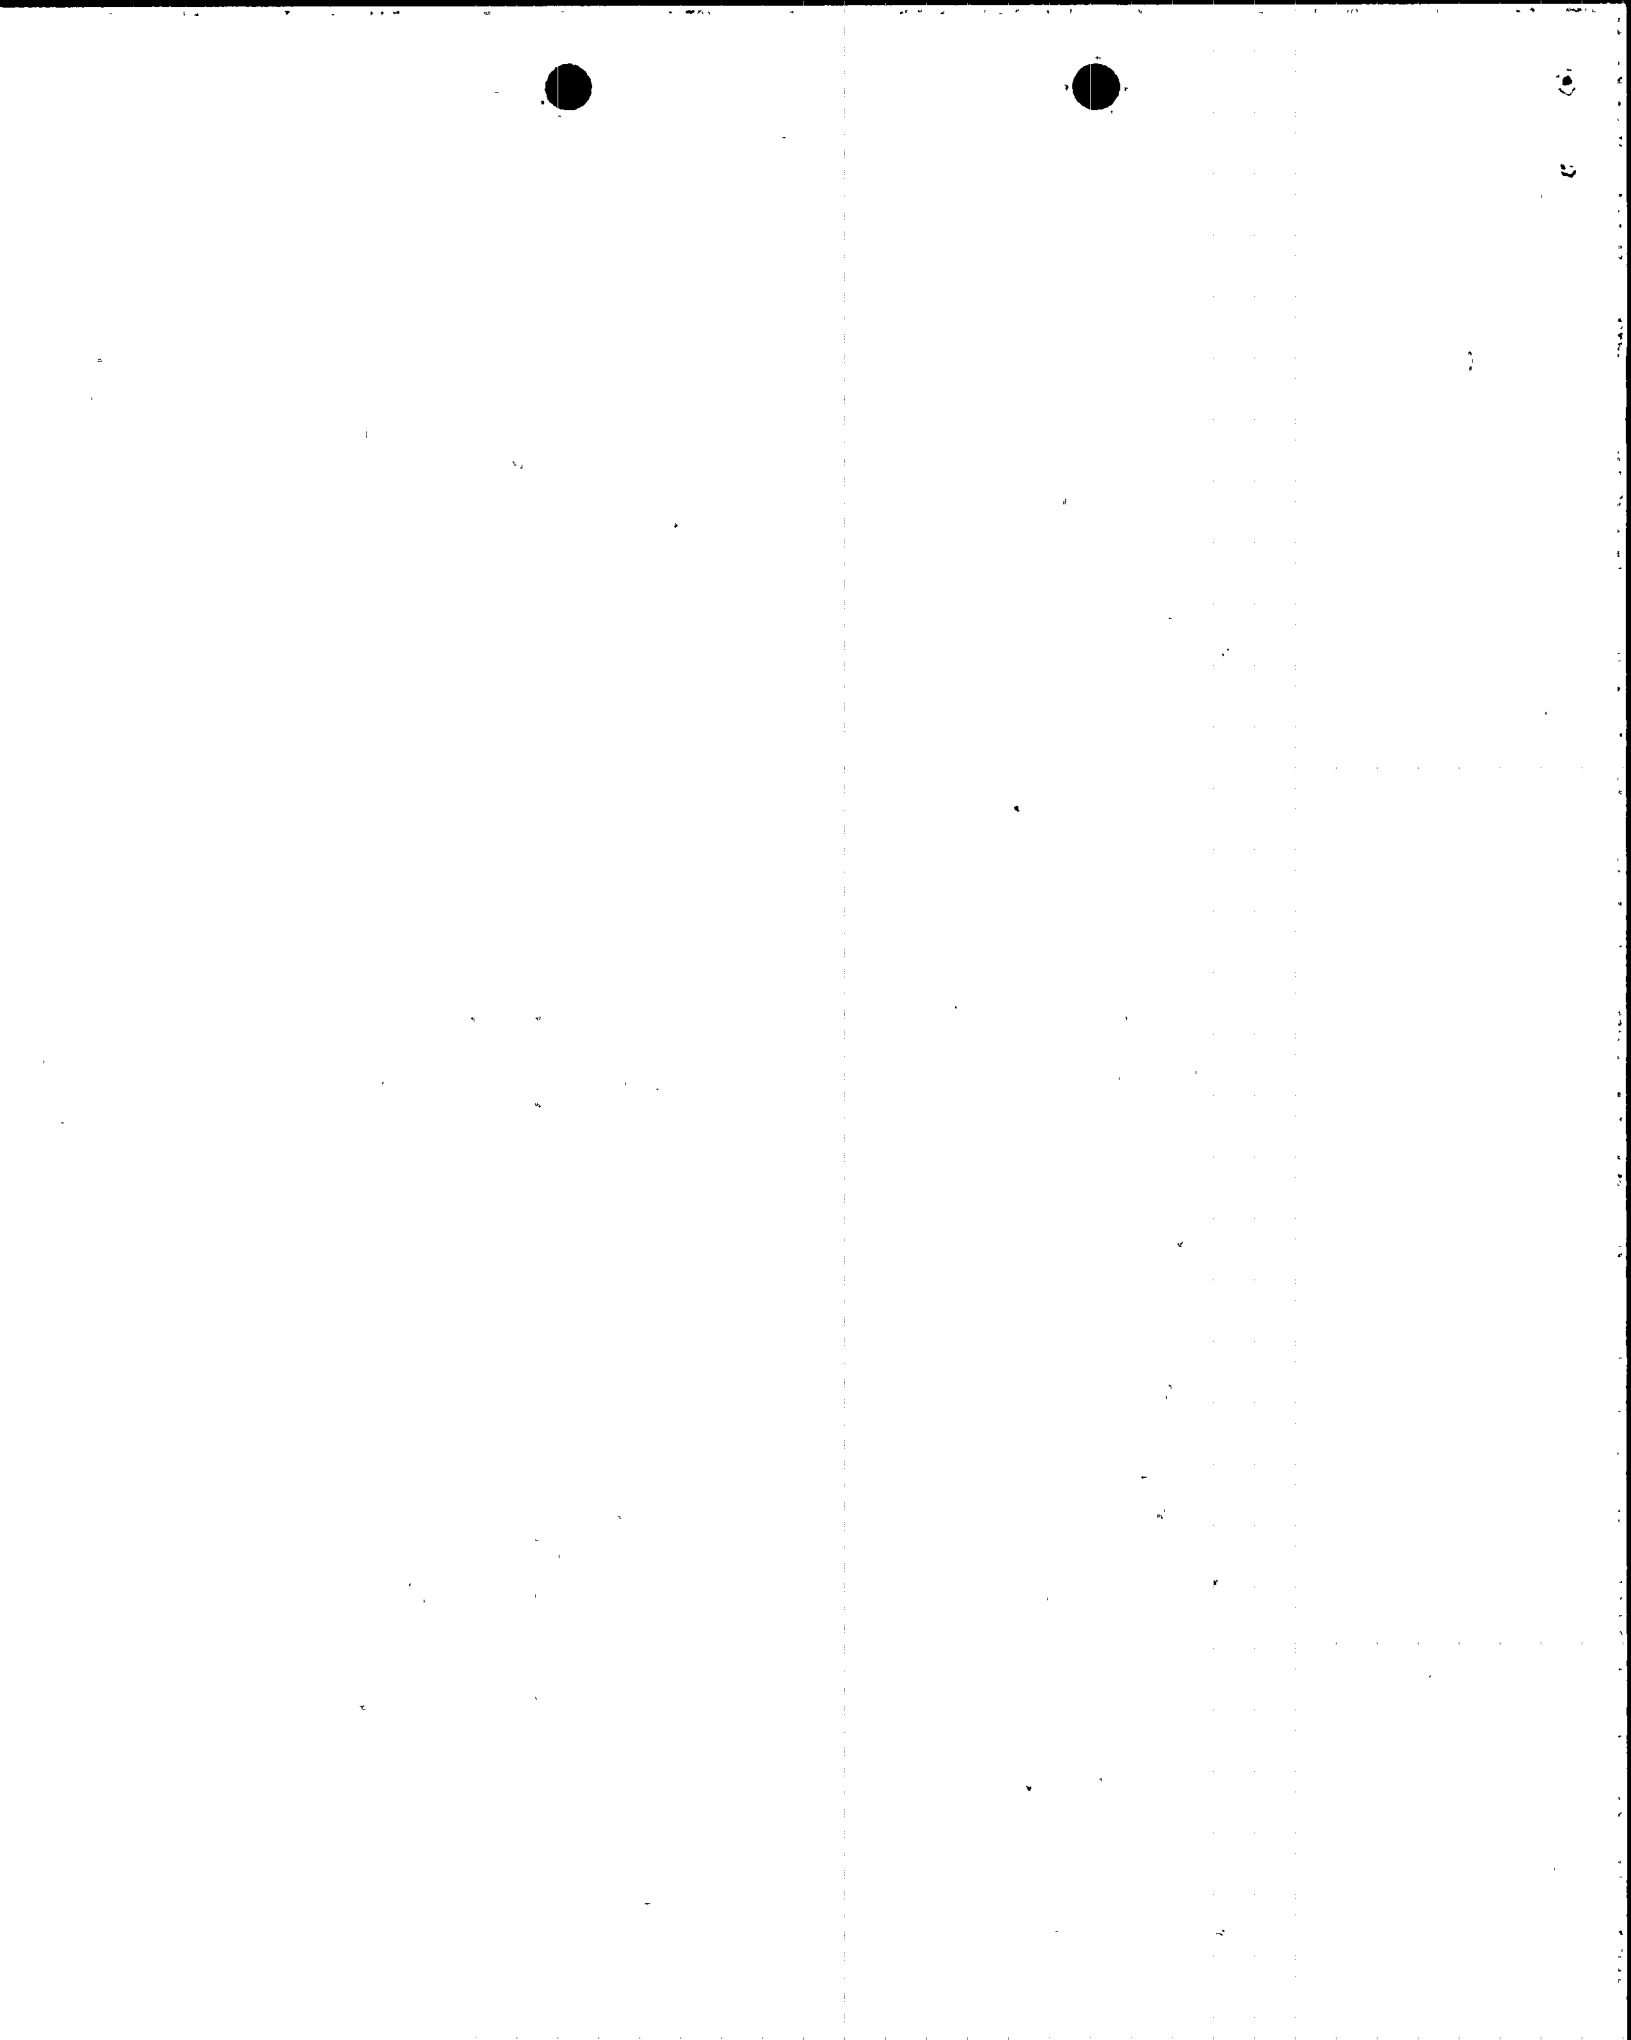

# LICENSEE EVENT REPORT (LER) TEXT CONTINUATION

FACILITY NAME	DOCKET NUMBER	LER NUMBER			PAGE		
Palo Verde Unit 1		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER			
	0 5   0 0   0 5   2   8 8   9	-	0   1   2	-	0   2	0   9	OF 1   1

TEXT

2. No training was provided to the 1984 walkdown team which resulted in incorrect assumptions being made regarding the requirements for adequate lighting.
3. The 1984 design walkdown was completed before all emergency lighting fixtures were installed. This resulted in the team having to make assumptions about the lighting that was scheduled to be installed.
4. After the 1984 design verification walkdown was performed, no followup safe shutdown walkdown was performed to verify that the lighting installed satisfied lighting requirements.
5. The walkdown was performed in Unit 1 only and the results generically applied to the other units based upon the assumption that the units would be identical.
6. Design and design interfaces were inadequate (i.e., inadequate cross-disciplinary reviews, utilizing incomplete design input documents, and design changes to the plant since 1984 were not reviewed for effect in emergency lighting).

**J. Safety System Response:**


There were no safety system responses and none were necessary.

**K. Failed Component Information:**

Not applicable - no component failures were involved.

**II. ASSESSMENT OF THE SAFETY CONSEQUENCES AND IMPLICATIONS OF THIS EVENT:**

10CFR50 Appendix R paragraph III.J states, "Emergency Lighting Units with at least an 8-hour battery power supply shall be provided in all areas needed for operation of safe shutdown equipment and in access and egress routes thereto." The PVNGS UFSAR Section 9.5.1.1.1 Safety Design Basis Eighteen for the unit lighting system states, "Emergency lighting systems shall be provided in accordance with the guidance provided in NRC Branch Technical Position APCS 9.5-1 (revised February 2, 1977) and 10CFR50 Appendix R Section III.J (issued September 1, 1982), in areas needed for operation of safe shutdown equipment and in access and egress routes thereto..."

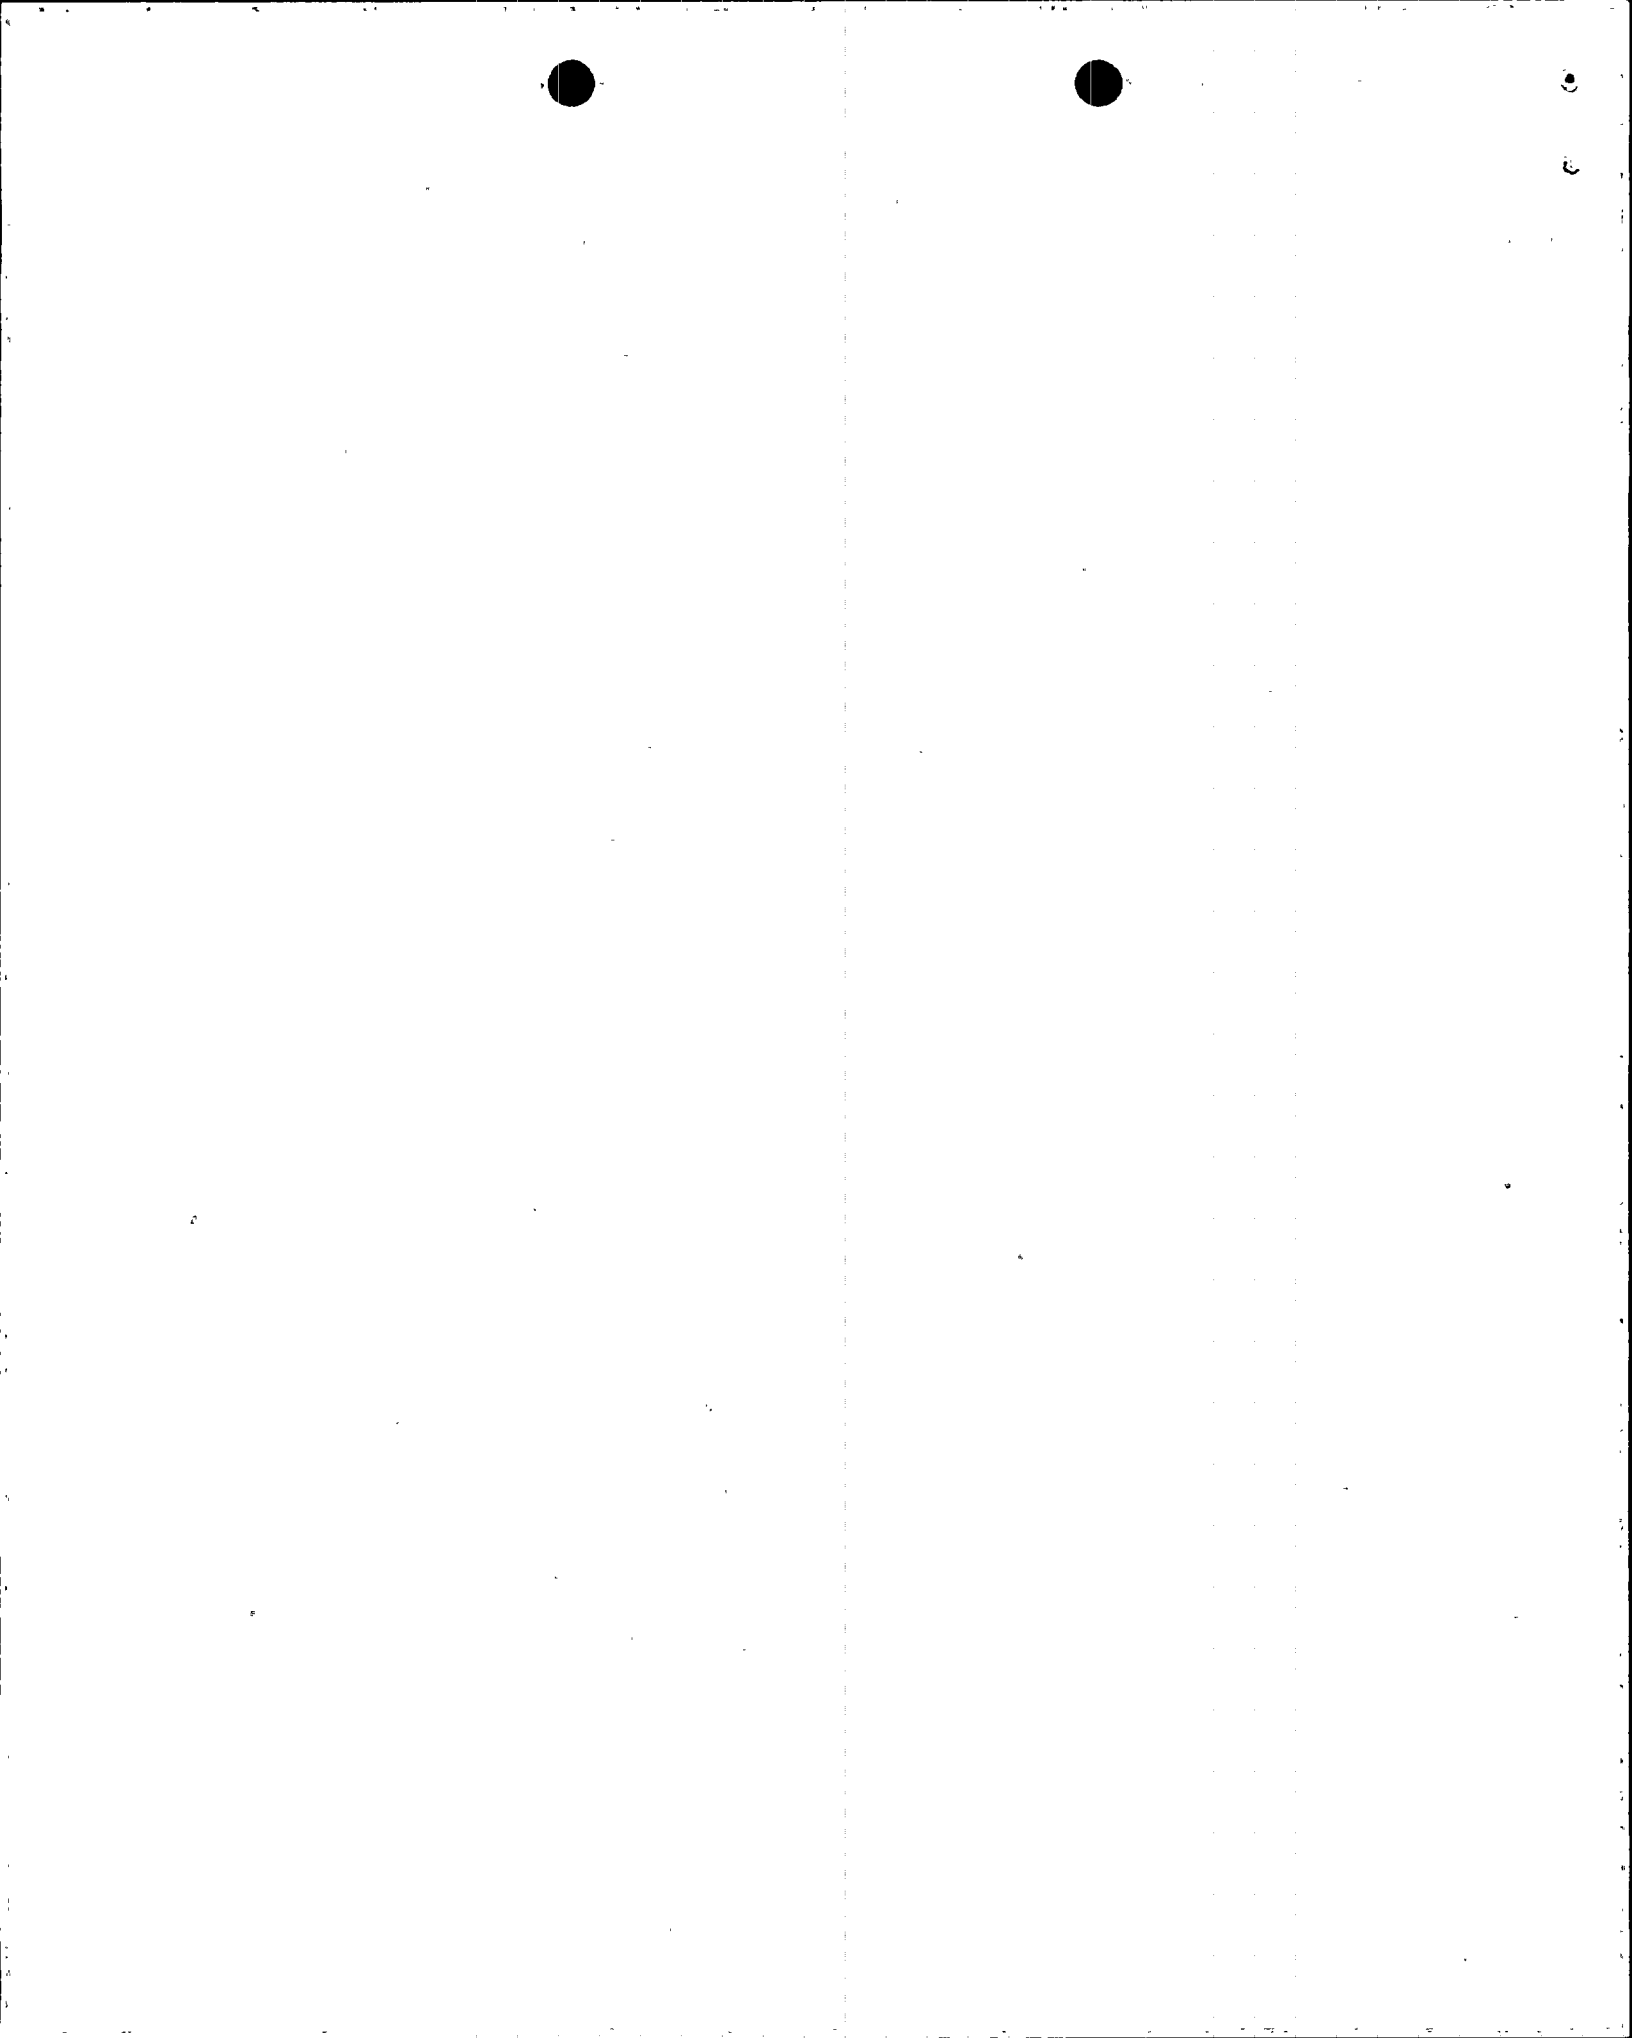

# LICENSEE EVENT REPORT (LER) TEXT CONTINUATION

FACILITY NAME	DOCKET NUMBER	LER NUMBER			PAGE	
Palo Verde Unit 1		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER		
		0	5	0	0	5
		8	9	0	1	2
		0	2	1	0	OF 1 1

TEXT

The lighting deficiencies discussed in Section I.B could have resulted in operations personnel not being able to expeditiously perform required shutdown activities in the event that a plant shutdown was required due to a fire in the control room with a concurrent loss of off-site power. However, it should be noted that flashlights were available for use by operations personnel which could have been utilized to perform the required activities.

## III. CORRECTIVE ACTIONS:

### A. Immediate:


Immediate corrective action was taken to prepare appropriate documentation for installing emergency lighting in Unit 2.

### B. Action to Prevent Recurrence:

As action to prevent recurrence, APS engineering and operations department personnel have performed comprehensive lighting system walkdowns in Units 1, 2 and 3. Emergency lighting has been appropriately installed and/or modified in Unit 2 to correct the lighting system deficiencies described in Section I.B. Appropriate emergency lighting will be installed and/or modified to correct the lighting deficiencies prior to restarting Units 1 and 3 from their current shutdowns.

As described in Section I.I, an investigation of this event was conducted in accordance with the PVNGS Incident Investigation Program. Based upon the results of this investigation, the following corrective actions were developed:

1. A sample review of previous regulatory related verification walkdowns performed by engineering will be completed to determine if any were completed without a required procedure and acceptance criteria. Appropriate actions will be taken based upon the results of these walkdowns.
2. The Design Criteria Manual will be revised to more clearly state the requirement that emergency lighting is required to be adequate for operating Safe Shutdown equipment as well as providing access/egress lighting.
3. 81DP-4CC05, "Design and Technical Document Control," will be revised to specifically require a technical review to ensure

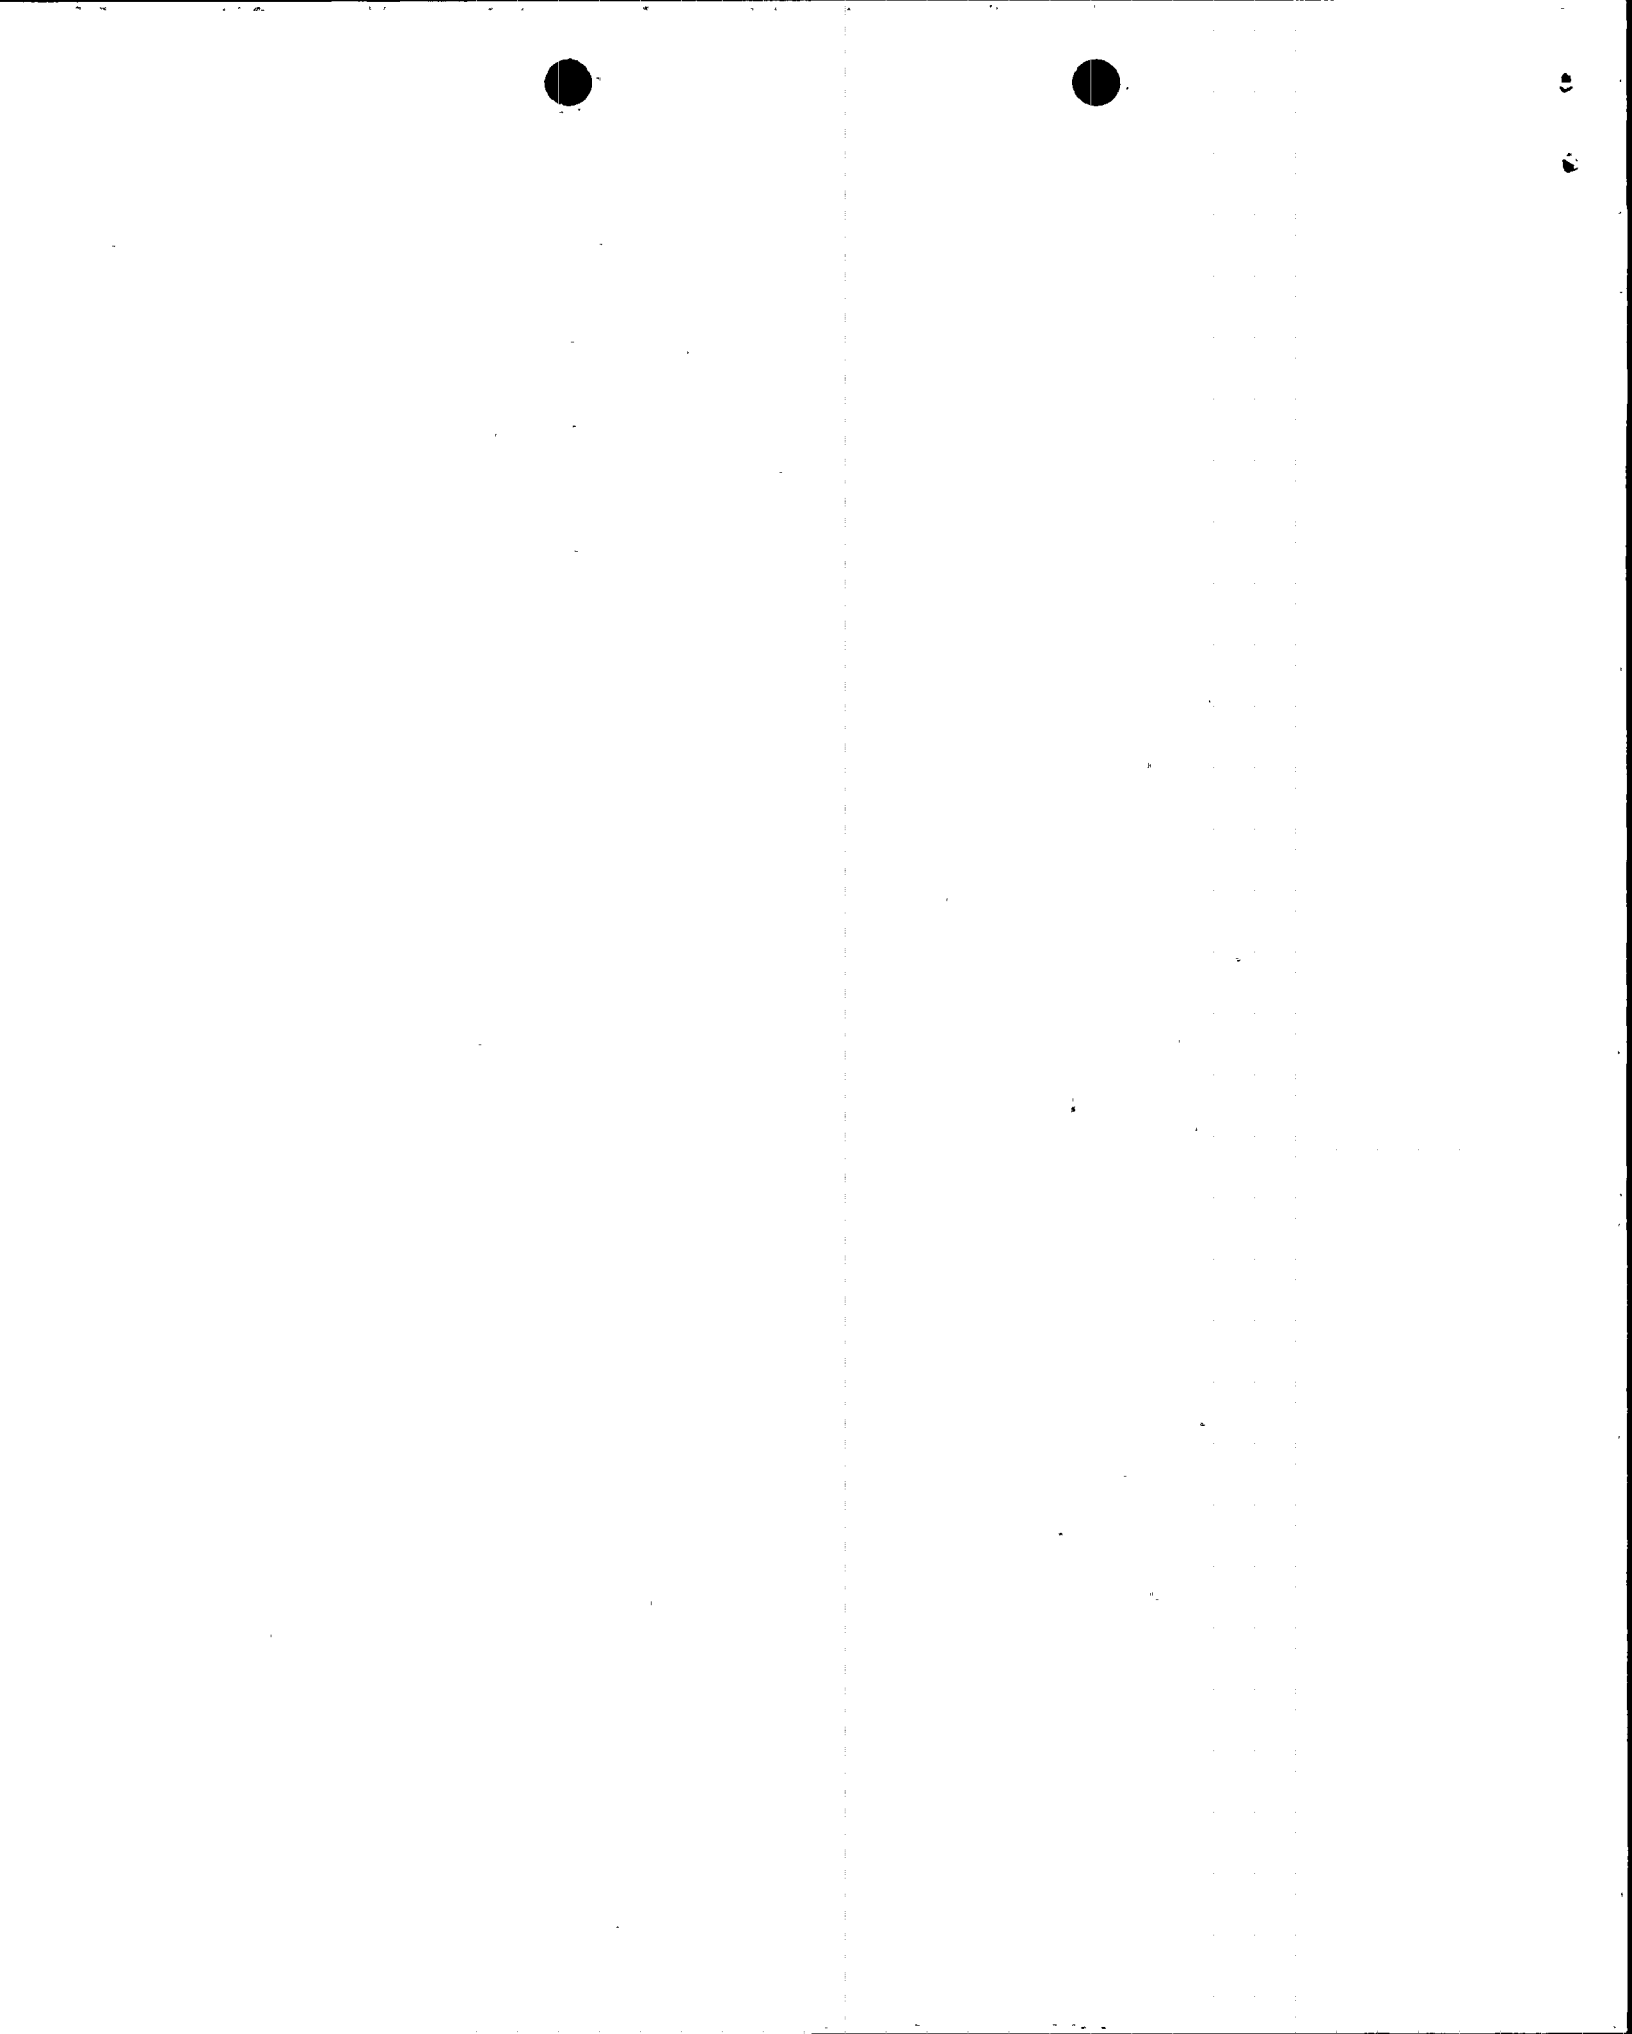

# LICENSEE EVENT REPORT (LER) TEXT CONTINUATION

FACILITY NAME	DOCKET NUMBER	LER NUMBER			PAGE		
Palo Verde Unit 1		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER			
	0 5 0 0 0 5 2 8 8 9	-	0 1 2	-	0 2	1 1	OF 1 1

TEXT

adequate illumination associated with Safe Shutdown equipment when incorporating changes to the emergency lighting system.

The above changes are expected to be implemented by May 30, 1990.

IV. PREVIOUS SIMILAR EVENTS:

There have been no previous similar events reported pursuant to 10CFR50.73.



