

LICENSEE EVENT REPORT

(PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

0	1	M	I	D	C	C	1	2	0	0	0	0	0	0	0	0	0	0	3	4	1	1	1	1	4			5	
7	8	LICENSEE CODE						14	15	LICENSE NUMBER										25	26	LICENSE TYPE				30	57	CAT	58

REPORT SOURCE

REPORT SOURCE 0 1 7 8 L 6 0 5 0 0 0 3 1 5 7 0 2 1 8 7 9 8 0 3 1 3 7 9 9 60 61 DOCKET NUMBER 68 69 EVENT DATE 74 75 REPORT DATE 80

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (10)

0 2 | DURING NORMAL OPERATION WHILE VALVING OUT THE WEST CENTRIFUGAL CHARGING PUMP FOR
0 3 | MAINTENANCE, THE SUCTION VALVE WAS FOUND CLOSED CONTRARY TO T.S. 3.5.2.
0 4 | INVESTIGATION REVEALED THAT THE VALVE HAD BEEN MISTAKENLY CLOSED FOLLOWING
0 5 | SURVEILLANCE TESTING. THE WEST TRAIN WAS INOPERABLE FOR A PERIOD OF 52.5 HOURS.
0 6 | DURING THIS TIME THE EAST PUMP WAS CONTINUOUSLY OPERABLE.
0 7 |
0 8 |

SYSTEM CODE 9 10		CAUSE CODE 11		CAUSE SUBCODE 12		COMPONENT CODE 13 14				COMP. SUBCODE 15		VALVE SUBCODE 16					
S F		A		B		V A L V E X				E		D					
7 8																	
LER/RO REPORT NUMBER 17		EVENT YEAR 21 22		SEQUENTIAL REPORT NO. 24 25 26		OCCURRENCE CODE 28 29		REPORT TYPE 30		REVISION NO. 32							
7 9		—		0 0 7		10 13		L		0							
ACTION TAKEN 33		FUTURE ACTION 34		EFFECT ON PLANT 35		SHUTDOWN METHOD 36		HOURS 37 38 39 40		ATTACHMENT SUBMITTED 41		NPRD-4 FORM SUB. 42		PRIME COMP. SUPPLIER 43		COMPONENT MANUFACTURER 44 45 46 47	
X		H		Z		Z		0 0 0		Y		N		Z		2 9 9 9	
18		19		20		21		22		23		24		25		26	

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)

1 0 | UPON COMPLETION OF THE SURVEILLANCE TEST RUN OF THE PUMP, AN AUXILIARY EQUIPMENT

1 1 | OPERATOR WAS INSTRUCTED TO PLACE THE PUMP BACK IN ITS NORMAL CONDITION. HE OPENED

1 2 | THE DISCHARGE VALVE AND CLOSED THE SUCTION VALVE WHICH IS THE CONDITION IN WHICH

1 3 | HE FOUND THE PUMP BEFORE THE TEST RUN. (CONTINUED -- PAGE 2)

1 4 |

FACILITY STATUS		% POWER		OTHER STATUS		METHOD OF DISCOVERY		DISCOVERY DESCRIPTION	
1	5	E	10	1	0	0	NA	A	OPERATOR OBSERVATION
7	8	9	10	11	12	13	44	45	80
ACTIVITY RELEASED		CONTENT OF RELEASE		AMOUNT OF ACTIVITY		LOCATION OF RELEASE			
1	6	Z	10	Z	NA	NA			
7	8	9	10	11	12	13	44	45	80
PERSONNEL EXPOSURES		NUMBER		TYPE		DESCRIPTION		7903190293	
1	7	0	11	0	0	0	NA		
7	8	9	10	11	12	13	44	45	80
PERSONNEL INJURIES		NUMBER		DESCRIPTION					
1	8	0	11	0	0	0	NA		
7	8	9	10	11	12	13	44	45	80
LOSS OF OR DAMAGE TO FACILITY		TYPE		DESCRIPTION					
1	9	Z	10		NA				
7	8	9	10	11	12	13	44	45	80
PUBLICITY ISSUED		DESCRIPTION						NRC USE ONLY	
2	0	N	10		NA				
7	8	9	10	11	12	13	44	45	80

NAME OF PREPARER H. M. Chadwell

PHONE: (616) 465-5901 X-316

1945-1946

CONTINUATION OF LER #79-007/03L-0

PAGE 2

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS

THE SUCTION VALVE HAD BEEN CLOSED BY A DIFFERENT OPERATOR TO PERFORM ANOTHER TEST. THE SECOND OPERATOR RETURNED THE PUMP TO THE CONDITION WHICH HE FOUND IT. THE ERROR OCCURRED BECAUSE OF A LACK OF COORDINATION BETWEEN THE TWO AUXILIARY EQUIPMENT OPERATORS AND ALSO BECAUSE THE INSTRUCTIONS WERE NOT EXPLICIT ENOUGH. A LETTER HAS BEEN SENT TO EACH SHIFT OPERATING ENGINEER REQUESTING A REVIEW OF THIS INCIDENT WITH HIS PERSONNEL.