

LICENSEE EVENT REPORT

CONTROL BLOCK: 1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80

(PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

0 1 M I D C C 1 2 0 0 - 0 0 0 0 0 0 - 0 0 3 4 1 1 1 1 4 5
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80

CON'T

0 1 REPORT SOURCE L 6 0 5 0 0 0 3 1 5 7 0 3 0 3 7 9 8 0 3 2 0 7 9 9
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (10)

0 2 DURING THIS STARTUP, AUX. FEED VALVE FMO-212 WOULD NOT SHUT FROM CONTROL

0 3 ROOM. THIS CONSTITUTED AN INOPERABLE AUX. FEED FLOW PATH PER TECH. SPEC.

0 4 3.7.1.2 A BROKEN WIRE WAS FOUND IN THE VALVE'S MOTOR OPERATOR. REACTOR

0 5 POWER WAS HELD LESS THAN 10 PERCENT FOR TWO HOURS DURING REPAIRS. PUBLIC

0 6 HEALTH AND SAFETY WERE NOT JEOPARDIZED. SIMILAR EVENTS: RO 78-018/03-L-0,

0 7 78-063/03-L-0 AND 79-002/03-L-0.

0 8

0 9 C H 11 E 12 A 13 V A L V O P 14 A 15 Z 16
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80

17 LER/RO REPORT NUMBER 7 9 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80

ACTION TAKEN FUTURE ACTION EFFECT ON PLANT SHUTDOWN METHOD HOURS ATTACHMENT SUBMITTED NPD-4 FORM SUB. PRIME COMP. SUPPLIER COMPONENT MANUFACTURER
A 18 F 19 B 20 Z 21 0 0 0 2 22 N 23 N 24 A 25 L 2 0 0 26
33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)

1 0 THE BROKEN WIRE WAS REPLACED. CAUSE OF BREAKAGE APPEARS TO BE A COMBINATION

1 1 OF VIBRATION AND THE USE OF SOLID CONDUCTOR WIRE. DESIGN CHANGE 12-2364

1 2 WILL REPLACE SOLID CONDUCTOR WIRE WITH STRANDED WIRE IN AUX. FEED MOTOR

1 3 OPERATED VALVES. A PROGRAM OF QUARTERLY INSPECTION OF AFFECTED WIRES

1 4 WILL BE FOLLOWED PENDING INSTALLATION OF THE DESIGN CHANGE.

1 5 C 28 0 0 6 29 OTHER STATUS N/A 30 METHOD OF DISCOVERY A 31 OPERATOR OBSERVATION 32
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 801 6 Z 33 Z 34 AMOUNT OF ACTIVITY N/A 35 LOCATION OF RELEASE 36
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 801 7 0 0 0 37 Z 38 N/A 39
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 801 8 0 0 0 40 N/A 41
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 801 9 Z 42 N/A 43
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 802 0 N 44 N/A 45
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80

NAME OF PREPARER M. S. BROWN

PHONE: 616-465-5901, EXT. 398

