

LICENSEE EVENT REPORT

(PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

CON'T

0	1
7	8

REPORT SOURCE

L	6	0	5	0	0	0	3	1	6	7	0	3	0	3	7	9	8	0	4	0	2	7	9	9
60	61	DOCKET NUMBER					68	69	EVENT DATE					74	75	REPORT DATE					80			

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (10)

2W ESSENTIAL SERVICE WATER PUMP WAS STARTED AND MOTOR AMPS PEGGED

METER. PUMP WAS STOPPED. THIS CONSTITUTED AN INOPERABLE ESW PUMP

REQUIRED BY TECH. SPEC. 3.7.4.1. THE EAST ESW PUMP REMAINED OPERABLE

DURING REPAIRS TO THE WEST ESW PUMP. THE PUBLIC HEALTH AND SAFETY

WERE NOT JEOPARDIZED. NO SIMILAR EVENTS.

7 8 9		SYSTEM CODE		CAUSE CODE		CAUSE SUBCODE		COMPONENT CODE				COMP. SUBCODE		VALVE SUBCODE	
0 9		W A		B		B		P U M P X				B		Z	
7 8		9 10		11 12		13 14		15 16 17 18				19 20		21 22	
17 LER/RO REPORT NUMBER		EVENT YEAR		23		SEQUENTIAL REPORT NO.		27		OCCURRENCE CODE		REPORT TYPE		REVISION NO.	
		7 9				0 0 9				0 3		L		NO.	
ACTION TAKEN		FUTURE ACTION		EFFECT ON PLANT		SHUTDOWN METHOD		HOURS		ATTACHMENT SUBMITTED		NPRD-4 FORM SUB.		PRIME COMP. SUPPLIER	
A		E		Z		Z		0 0 0		Y		N		A	
18 19		20 21		22 23		24 25		26 27		28 29		30 31		32 33	
33 34		35 36		37 38		39 40		41 42		43 44		45 46		47 48	
ACTION TAKEN		FUTURE ACTION		EFFECT ON PLANT		SHUTDOWN METHOD		HOURS		ATTACHMENT SUBMITTED		NPRD-4 FORM SUB.		PRIME COMP. SUPPLIER	
A		E		Z		Z		0 0 0		Y		N		A	
18 19		20 21		22 23		24 25		26 27		28 29		30 31		32 33	
33 34		35 36		37 38		39 40		41 42		43 44		45 46		47 48	

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)

IMPELLER CLEARANCES SET IN ACCORDANCE WITH JOHNSTON PUMP MANUAL WERE TOO

SMALL AND A BURR FORMED BETWEEN IMPELLER WEAR RING AND PUMP BOWL, BINDING

THE PUMP. PUMP SHAFT AND BOWL WERE REPLACED. RETEST WAS SATISFACTORY.

PROCEDURE REVISED STATING INCREASED IMPELLER CLEARANCES. OTHER PUMPS SET.

WITH SMALL CLEARANCES WILL BE SET AT LARGER CLEARANCE AS RECOMMENDED BY

7		8		9		FACILITY STATUS		% POWER		OTHER STATUS		METHOD OF DISCOVERY		DISCOVERY DESCRIPTION		OPERATOR OBSERVATION			
1		5		E		28		0		8		29		A		31		32	
7		8		9		10		11		12		13		45		46		80	
ACTIVITY		CONTENT		RELEASED		OF RELEASE		AMOUNT OF ACTIVITY		35		N/A		LOCATION OF RELEASE		36		80	
1		6		Z		33		Z		34		44		45		80		80	
PERSONNEL EXPOSURES		NUMBER		TYPE		DESCRIPTION		39		N/A		7904090156		80		80		80	
1		7		0		0		0		37		Z		38		41		41	
PERSONNEL INJURIES		NUMBER		DESCRIPTION		40		N/A		43		43		43		43		43	
1		8		0		0		0		40		43		43		43		43	
LOSS OF OR DAMAGE TO FACILITY		TYPE		DESCRIPTION		42		N/A		45		45		45		45		45	
1		9		Z		42		N/A		45		45		45		45		45	
PUBLICITY		ISSUED		DESCRIPTION		44		N/A		45		45		45		45		45	
2		0		N		44		N/A		45		45		45		45		45	
7		8		9		10		11		12		13		45		46		80	
NRC USE ONLY		NRC USE ONLY		NRC USE ONLY		NRC USE ONLY		NRC USE ONLY		NRC USE ONLY		NRC USE ONLY		NRC USE ONLY		NRC USE ONLY		NRC USE ONLY	
78		79		80		81		82		83		84		85		86		87	

NAME OF PREPARER M. S. BROWN

PHONE: (616) 465-5901, EXT. 398

SUPPLEMENT TO LER #79-009/03L-0

SUPPLEMENT TO CAUSE DESCRIPTION AND CORRECTIVE ACTIONS:

JOHNSTON PUMP COMPANY AND COGNIZANT ENGINEER. ADJUSTMENTS ARE
TO BE COMPLETED BY MAY 1, 1979.