

LICENSEE EVENT REPORT

CONTROL BLOCK: 1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80

(PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

0 1 M I D C C 2 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 3 4 1 1 1 1 4 5
7 8 9 14 15 25 26 30 57 CAT 58

CONT

0 1 REPORT SOURCE L 6 0 5 0 0 0 3 1 6 7 1 1 0 2 7 9 8 0 2 2 9 8 0 9
7 8 60 61 DOCKET NUMBER 68 69 EVENT DATE 74 75 REPORT DATE 80

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (10)

0 2 A REVIEW (CONDUCTED ON 02-01-80) OF A SURVEILLANCE TEST PROCEDURE (PERFORMED
0 3 ON 11-02-79) INDICATED THAT THE AS FOUND DATA FOR LOOP 1 CHANNEL 1, REACTOR
0 4 COOLANT FLOW TRANSMITTER WAS FOUND TO BE 3.8 PER CENT OUT OF CALIBRATION.
0 5 THIS CONDITION WAS NON-CONSERVATIVE WITH RESPECT TO T.S. TABLE 2.2-1 ITEM 12.
0 6
0 7
0 8

0 9 SYSTEM CODE I A 11 CAUSE CODE E 12 CAUSE SUBCODE E 13 COMPONENT CODE I N S T R U 14 COMP. SUBCODE T 15 VALVE SUBCODE Z 16
7 8 9 10 11 12 13 18 19 20
17 LER/RO REPORT NUMBER 8 0 21 22 SHUTDOWN METHOD Z 21 0 0 0 0 22 HOURS 23 Y 23 ATTACHMENT SUBMITTED Y 24 PRIME COMP. SUPPLIER N 25 COMPONENT MANUFACTURER F 1 1 8 10 26
23 24 25 26 27 28 29 30 31 32
ACTION TAKEN E 18 FUTURE ACTION X 19 EFFECT ON PLANT Z 20
33 34 35 36 37 38 39 40 41 42 43 44 45 46 47

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)

1 0 THE 3.8 PER CENT TRANSMITTER ERROR WAS DUE TO TRANSMITTER DRIFT. THE TRANSMITTER
1 1 WAS IMMEDIATELY RECALIBRATED TO WITHIN ACCEPTABLE TOLERANCES. IN ORDER TO PROVIDE
1 2 A GREATER MARGIN FOR TRANSMITTER DRIFT THE REACTOR COOLANT LOW FLOW ALARM SETPOINT
1 3 WAS INCREASED IN THE CONSERVATIVE DIRECTION FROM 90 PER CENT TO 93 PER CENT FLOW.
1 4 THE T.S. LCO VALUE IS 89 PER CENT FLOW. SEE ATTACHED SUPPLEMENT.

1 5 FACILITY STATUS H 28 % POWER 0 0 0 29 OTHER STATUS NA 30 METHOD OF DISCOVERY B 31 DISCOVERY DESCRIPTION INSTRUMENT MAINTENANCE PROCEDURE 32
7 8 9 10 11 12 13 44 45 46 80
1 6 ACTIVITY CONTENT Z 33 Z 34 AMOUNT OF ACTIVITY NA 35 LOCATION OF RELEASE NA 36
7 8 9 10 11 12 13 44 45 80
1 7 PERSONNEL EXPOSURES NUMBER 0 0 0 37 TYPE Z 38 DESCRIPTION NA 39
7 8 9 10 11 12 13 44 45 80
1 8 PERSONNEL INJURIES NUMBER 0 0 0 40 DESCRIPTION NA 41
7 8 9 10 11 12 13 44 45 80
1 9 LOSS OF OR DAMAGE TO FACILITY TYPE Z 42 DESCRIPTION NA 43
7 8 9 10 11 12 13 44 45 80
2 0 PUBLICITY ISSUED N 44 DESCRIPTION NA 45
7 8 9 10 11 12 13 44 45 80

8003060602

NRC USE ONLY

NAME OF PREPARER S. D. DeLong

PHONE 616-465-5901

SUPPLEMENT TO LER # 80-008/03L-0

SUPPLEMENT TO CAUSE DESCRIPTION

THE ACTION REQUIREMENT OF T.S. TABLE 2.2-1 ITEM 12 WAS
FULFILLED.

THE TRANSMITTER WAS A FOXBORO DP MODEL NUMBER E13 DH-HSAH1

