

PRIORITY 1

(ACCELERATED RIDS PROCESSING)

REGULATORY INFORMATION DISTRIBUTION SYSTEM (RIDS)

ACCESSION NBR:9509290006 DOC.DATE: 95/09/25 NOTARIZED: NO DOCKET #
FACIL:50-316 Donald C. Cook Nuclear Power Plant, Unit 2, Indiana M 05000316
AUTH.NAME AUTHOR AFFILIATION
WEBER,G.A. Indiana Michigan Power Co. (formerly Indiana & Michigan Ele
BLIND,A.A. Indiana Michigan Power Co. (formerly Indiana & Michigan Ele
RECIP.NAME RECIPIENT AFFILIATION

SUBJECT: LER 95-004-00:on 950826,reactor tripped.Caused by turbine
trip on high moisture separator reheater level.Installed
temporary mod,removing turbine trip function from level
switches 2-MLS-418 & 2-MLS-420.W/950925 ltr.

DISTRIBUTION CODE: IE22T COPIES RECEIVED:LTR 1 ENCL 1 SIZE: S
TITLE: 50.73/50.9 Licensee Event Report (LER), Incident Rpt, etc.

NOTES:

	RECIPIENT ID CODE/NAME	COPIES LTTR ENCL	RECIPIENT ID CODE/NAME	COPIES LTTR ENCL
	PD3-1 PD	1 1	HICKMAN,J	1 1
INTERNAL:	AEOD/SPD/RAB	2 2	AEOD/SPD/RRAB	1 1
	FILE CENTER	1 1	NRR/DE/ECGB	1 1
	NRR/DE/EELB	1 1	NRR/DE/EMEB	1 1
	NRR/DISP/PIPB	1 1	NRR/DRCH/HHFB	1 1
	NRR/DRCH/HICB	1 1	NRR/DRCH/HOLB	1 1
	NRR/DRPM/PECB	1 1	NRR/DSSA/SPLB	1 1
	NRR/DSSA/SPSB/B	1 1	NRR/DSSA/SRXB	1 1
	RES/DSIR/EIB	1 1	RGN3 FILE 01	1 1
EXTERNAL:	L ST LOBBY WARD	1 1	LITCO BRYCE,J H	2 2
	NOAC MURPHY,G.A	1 1	NOAC POORE,W.	1 1
	NRC PDR	1 1	NUDOCS FULL TXT	1 1

NOTE TO ALL "RIDS" RECIPIENTS:

PLEASE HELP US TO REDUCE WASTE! CONTACT THE DOCUMENT CONTROL
DESK, ROOM OWFN 5D8 (415-2083) TO ELIMINATE YOUR NAME FROM
DISTRIBUTION LISTS FOR DOCUMENTS YOU DON'T NEED!

FULL TEXT CONVERSION REQUIRED
TOTAL NUMBER OF COPIES REQUIRED: LTTR 26 ENCL 26

Indiana Michigan
Power Company
Cook Nuclear Plant
One Cook Place
Bridgman, MI 49106
616 465 5901



September 25, 1995

United States Nuclear Regulatory Commission
Document Control Desk
Rockville, Maryland 20852

Operating Licenses DPR-74
Docket No. 50-316

Document Control Manager:

In accordance with the criteria established by
10 CFR 50.73 entitled Licensee Event Report System, the
following report is being submitted:

95-004-00

Sincerely,

A. A. Blind
A. A. Blind
Plant Manager

/clc

Attachment

c: H. J. Miller, Region III
E. E. Fitzpatrick
P. A. Barrett
R. F. Kroeger
M. A. Bailey - Ft. Wayne
S. J. Brewer
M. R. Padgett
G. Charnoff, Esq.
D. Hahn
Records Center, INPO
NRC Resident Inspector

9509290006 950925
PDR ADDCK 05000316
S PDR

JE22

LICENSEE EVENT REPORT (LER)

(See reverse for required number of digits/characters for each block)

ESTIMATED BURDEN PER RESPONSE TO COMPLY WITH THIS INFORMATION COLLECTION REQUEST: 50.0 HRS. FORWARD COMMENTS REGARDING BURDEN ESTIMATE TO THE INFORMATION AND RECORDS MANAGEMENT BRANCH (MN88 7714), U.S. NUCLEAR REGULATORY COMMISSION, WASHINGTON, DC 20555-0001, AND TO THE PAPERWORK REDUCTION PROJECT (3150-0104), OFFICE OF MANAGEMENT AND BUDGET, WASHINGTON, DC 20503.

FACILITY NAME (1) D.C. Cook Nuclear Plant - Unit 2	DOCKET NUMBER (2) 05000 316	PAGE (3) 1 OF 4
-------------------------------------------------------	--------------------------------	--------------------

TITLE (4) Rx Trip Caused by a Turbine Trip on High Moisture Separator Reheater Level

EVENT DATE (5)			LER NUMBER (6)			REPORT NUMBER (7)			OTHER FACILITIES INVOLVED (8)	
MONTH	DAY	YEAR	YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	MONTH	DAY	YEAR	FACILITY NAME	DOCKET NUMBER
8	26	95	95	-- 004 --	00	9	25	95	FACILITY NAME	DOCKET NUMBER
										05000
										05000

OPERATING MODE (9) 1	THIS REPORT IS SUBMITTED PURSUANT TO THE REQUIREMENTS OF 10 CFR §: (Check one or more) (11)												
POWER LEVEL (10) 100%	20.402(b)					20.405(c)					X	50.73(a)(2)(iv)	73.71(b)
	20.405(a)(1)(i)					50.36(c)(1)						50.73(a)(2)(v)	73.71(c)
	20.405(a)(1)(ii)					50.36(c)(2)						50.73(a)(2)(vii)	OTHER
	20.405(a)(1)(iii)					50.73(a)(2)(i)						50.73(a)(2)(viii)(A)	(Specify in Abstract below and in Text, NRC Form 366A)
	20.405(a)(1)(iv)					50.73(a)(2)(ii)						50.73(a)(2)(viii)(B)	
	20.405(a)(1)(v)					50.73(a)(2)(iii)						50.73(a)(2)(x)	

LICENSEE CONTACT FOR THIS LER (12)									
NAME G.A. Weber, Plant Engineering Superintendent								TELEPHONE NUMBER (Include Area Code) 616-465-5901 x2511	

COMPLETE ONE LINE FOR EACH COMPONENT FAILURE DESCRIBED IN THIS REPORT (13)										
CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO NPROS		CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO NPROS
BG	1B	LS	Magnetrol	N						

SUPPLEMENTAL REPORT EXPECTED (14)								EXPECTED SUBMISSION DATE (15)		MONTH	DAY	YEAR
YES (If yes, complete EXPECTED SUBMISSION DATE)								X NO				

ABSTRACT (Limit to 1400 spaces, i.e., approximately 15 single-spaced typewritten lines) (16)

At 0149 hours on August 26, 1995 while at 100 percent Rated Thermal Power, Unit 2 received a turbine trip/reactor trip signal from a Main Turbine Moisture Separator High Level. At the time of the trip, turbine valve testing was in progress with no abnormal alarms standing. Level alarms which normally precede the MSR High Level trip signal did not actuate. The turbine trip signal caused the reactor trip.

After the reactor trip, all safety systems operated normally in response to the trip signal. With the exception of the failure of the Nuclear Instrumentation Channel I Source Range to indicate the correct counts per second due to abnormally low indication, all post reactor trip responses were normal. The reactor was stabilized in Mode 3, Hot Standby, and repairs were performed. This event was determined to have no actual or potential adverse effect on the health and safety of the public.

LICENSEE EVENT REPORT (LER)
TEXT CONTINUATION

ESTIMATED BURDEN PER RESPONSE TO COMPLY WITH THIS INFORMATION COLLECTION REQUEST: 500 HRS. FORWARD COMMENTS REGARDING BURDEN ESTIMATE TO THE RECORDS AND REPORTS MANAGEMENT BRANCH (P-530), U.S. NUCLEAR REGULATORY COMMISSION, WASHINGTON, DC 20555, AND TO THE PAPERWORK REDUCTION PROJECT (3150-0104) OFFICE OF MANAGEMENT AND BUDGET, WASHINGTON, DC 20503.

FACILITY NAME (1)

DOCKET NUMBER (2)

LER NUMBER (6)

PAGE (3)

D.C. Cook Nuclear Plant - Unit 2

0 | 5 | 0 | 0 | 0 | 3 | 1 | 6

YEAR SEQUENTIAL NUMBER REVISION NUMBER

9 | 5 | — | 0 | 0 | 4 | — | 0 | 0 | 0 | 2 | OF | 0 | 4

TEXT (If more space is required, use additional NRC Form 366A's) (17)

Conditions Prior to Occurrence

Unit 2 in Mode 1, Power Operation, at 100 percent Rated Thermal Power

Description of Event

Unit 2 experienced a turbine trip and reactor trip from 100% power at 0149 hours on August 26, 1995 during the performance of main turbine valve testing. The turbine trip was initiated by actuation of 2-MLS-418, RIGHT MOISTURE SEPARATOR REHEATER OME-80R MOISTURE SEPARATOR LEVEL SWITCH. Following a 5 second time delay, this switch simultaneously actuates the "W (R) MOIST SEP DRN LVL HI-HI TURBINE TRIP" annunciator (Panel 216, Drop 38) and initiates a turbine trip. No other annunciators associated with the Right MSR or Right Moisture Separator Drain Tank (MSDT) were received with this trip.

The Moisture Separator region of the Right MSR, along with several drain points from the crossunder piping, drains to the Right MSDT. The Right MSDT then drains normally to Heater 4B or alternately to Condenser "C". A similar configuration exists for the Left MSR. If flooding conditions actually exist in this system, several actions should occur prior to actuation of 2-MLS-418 as level rises in the MSDT and its Inlet piping. Level alarm switch 2-MLA-414 should actuate the "W (R) MOIST SEP DRAIN TANK LEVEL HIGH" annunciator, level alarm switch 2-MLA-413 should actuate the "W (R) MOIST SEP DRAIN TANK LEVEL HI-HI" annunciator, and level controller 2-MLC-407 should open valve 2-MRV-427 to provide an alternate drain path to Condenser "C". None of these precursor actions occurred prior to the turbine trip. The two level alarm switches and the level controller were verified to be functioning properly during post-trip investigation.

Cause of Event

It was concluded that the trip was caused by spurious actuation of 2-MLS-418.

As all three devices were found functional during the post-trip investigation, an actual level increase in the MSR drain lines is not felt to be a reasonable scenario. For an actual water level to rise to the setpoint of 2-MLS-418, the Right MSDT would have to flood completely, which should initiate 2 annunciators and one automatic valve manipulation. The water would continue to fill long horizontal and vertical runs of 10", 12", and 16" pipe to an elevation more than 8 feet above the MSDT Hi-Hi Level alarm setpoint.

The configuration of the sensing lines for 2-MLS-418 is a likely contributor to the actuation of this level switch. These 1" sensing lines tap into one of the 12" drain lines from the shell of the Right MSR and include more than 26 feet of horizontal piping.

LICENSEE EVENT REPORT (LER)
TEXT CONTINUATION

ESTIMATED BURDEN PER RESPONSE TO COMPLY WITH THIS INFORMATION COLLECTION REQUEST: 500 HRS. FORWARD COMMENTS REGARDING BURDEN ESTIMATE TO THE RECORDS AND REPORTS MANAGEMENT BRANCH (P-530), U.S. NUCLEAR REGULATORY COMMISSION, WASHINGTON, DC 20555, AND TO THE PAPERWORK REDUCTION PROJECT (3150-0104), OFFICE OF MANAGEMENT AND BUDGET, WASHINGTON, DC 20503.

FACILITY NAME (1)	DOCKET NUMBER (2)	LER NUMBER (6)		PAGE (3)	
		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	
D.C. Cook Nuclear Plant - Unit 2	0 5 0 0 0 3 1 6	9 5	0 0 4	0 0	0 3 OF 0 4

TEXT (If more space is required, use additional NRC Form 366A's) (17)

Further evidence of sensing line configuration contributing to this event was discovered during the post-trip investigation. With Unit 2 in Mode 3 and no significant flow through the MSRs or MSDTs, a functional check of both Right and Left Moisture Separator Level Switches (2-MLS-418 and 2-MLS-420) was performed by isolating the sensing lines from the 12" process lines and filling the sensing lines with water to cause switch actuation and verify switch setpoints. After the switches were verified functional, the sensing line isolation valves were re-opened to restore normal system lineup. During opening of the low side isolation valve for 2-MLS-420 the associated annunciator and turbine trip for this switch were received, indicating that the float in the level switch had been lifted for more than 5 seconds with no actual level existing in the process piping.

Analysis of Event

This event is being reported per 10 CFR 50.73(a)(2)(iv), as an event that resulted in automatic actuation of Engineered Safety Features (ESF), including the Reactor Protection System (RPS).

A reactor trip occurred when the main turbine tripped above 10 percent Rated Thermal Power on Main Turbine Moisture Separator High Level. All control rods fully inserted, both Motor Driven Auxiliary Feedwater Pumps started, and a feedwater isolation occurred, all as designed.

Normal offsite power was available, the emergency diesel generators were in standby, and no safety equipment was out of service prior to the trip. This event did not have any actual or potential adverse impact on the health and safety of the public.

Corrective Actions

A Temporary Modification (TM) was installed following this trip. The TM removed the turbine trip function from level switches 2-MLS-418 and 2-MLS-420, and preserves the alarm function (Annunciator Panel 216, Drops 28 and 38) for these switches.

The TM also included a change to the Annunciator Response Procedures for these 2 annunciators. Upon receipt of either of these annunciators, Operations is directed to manually trip the turbine if either of the associated MSDT level alarms is also standing. This ensures plant protection in the event of an actual high level in the MSR Moisture Separator drain system, while preventing spurious trips from erroneous actuation of the level switches.

The basis and continued need for this automatic turbine trip are being evaluated. Once this evaluation is complete it will be determined if a modification to the sensing lines for the Moisture Separator Level Switches and the level switch circuitry would be necessary.

LICENSEE EVENT REPORT (LER)
TEXT CONTINUATION

ESTIMATED BURDEN PER RESPONSE TO COMPLY WITH THIS INFORMATION COLLECTION REQUEST: 50.0 HRS. FORWARD COMMENTS REGARDING BURDEN ESTIMATE TO THE RECORDS AND REPORTS MANAGEMENT BRANCH (P-530), U.S. NUCLEAR REGULATORY COMMISSION, WASHINGTON, DC 20555, AND TO THE PAPERWORK REDUCTION PROJECT (3150-0104) OFFICE OF MANAGEMENT AND BUDGET, WASHINGTON, DC 20503.

FACILITY NAME (1)	DOCKET NUMBER (2)	LER NUMBER (6)				PAGE (3)			
		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER					
D.C. Cook Nuclear Plant - Unit 2	0 5 0 0 0 3 1 6	9 5	— 0 0 4	— 0 0	0 4	OF	0 4		

TEXT (If more space is required, use additional NRC Form 368A's) (17)

Failed Component Identification

Component Name: 2-MLS-418
Manufacturer: Magnetrol International
Model: 602-SP-X

Previous Similar Events

LER 316/94-008-00