

LICENSEE EVENT REPORT (LER)

ESTIMATED BURDEN PER RESPONSE TO COMPLY WITH THIS INFORMATION COLLECTION REQUEST: 50.0 HRS. FORWARD COMMENTS REGARDING BURDEN ESTIMATE TO THE INFORMATION AND RECORDS MANAGEMENT BRANCH (HNB8 7714), U.S. NUCLEAR REGULATORY COMMISSION, WASHINGTON, DC 20555-0001, AND TO THE PAPERWORK REDUCTION PROJECT (3150-0104), OFFICE OF MANAGEMENT AND BUDGET, WASHINGTON, DC 20503.

FACILITY NAME (1)
Donald C. Cook Nuclear Plant - Unit 2DOCKET NUMBER (2)
50-316

Page 1 of 1

TITLE (4)

Interim LER Revision- Dual Train Component Cooling Water Outage During Unit 2 Refueling Outage Results in Condition Outside the Design Basis

EVENT DATE (5)			LER NUMBER (6)			REPORT DATE (7)			OTHER FACILITIES INVOLVED (8)	
MONTH	DAY	YEAR	YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	MONTH	DAY	YEAR	FACILITY NAME	DOCKET NUMBER
08	26	97	97	-- 003 --	01	10	21	97	None	
OPERATING MODE (9)			THIS REPORT IS SUBMITTED PURSUANT TO THE REQUIREMENTS OF 10 CFR II: (Check one or more) (11)							
1			20.2201(b)			20.2203(a)(3)(i)			50.73(a)(2)(iii)	
POWER LEVEL (10)			20.2203(a)(1)			20.2203(a)(3)(ii)			50.73(a)(2)(iv)	
100			20.2203(a)(2)(i)			20.2203(a)(4)			50.73(a)(2)(v)	
			20.2203(a)(2)(ii)			50.36(c)(1)			50.73(a)(2)(vii)	
			20.2203(a)(2)(iii)			50.36(c)(2)			50.73(a)(2)(viii)(A)	
			20.2203(a)(2)(iv)			50.73(a)(2)(i)			50.73(a)(2)(viii)(B)	
			20.2203(a)(2)(v)			X 50.73(a)(2)(ii)			50.73(a)(2)(x)	
(Specify in Abstract below and in Text, NRC Form 366A)										

LICENSEE CONTACT FOR THIS LER (12)

NAME

Mr. Jeb Kingseed, Nuclear Safety and Analysis Manager

TELEPHONE NUMBER (Include Area Code)

616/697-5106

COMPLETE ONE LINE FOR EACH COMPONENT FAILURE DESCRIBED IN THIS REPORT (13)

CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO NPRDS		CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO NPRDS

SUPPLEMENTAL REPORT EXPECTED (14)

X YES

NO

EXPECTED SUBMISSION DATE (15)

MONTH

11

DAY

17

YEAR

97

ABSTRACT (Limit to 1400 spaces, i.e., approximately 15 single-spaced typewritten lines) (16)

On August 26, 1997, with Unit 2 at 100 percent Rated Thermal Power, it was determined that the unit had operated outside the design basis during the Unit 2 1996 refueling outage. It was determined that this event was reportable under 10CFR50.72(b)(1)(ii)(B) as a condition outside the design basis, and an ENS notification was made at 1553 on August 26, 1997. This interim LER is being submitted under 10CFR50.73(a)(2)(ii).

A safety evaluation had been performed for the Unit 2 full core offload, assuming one train of Spent Fuel Pool (SFP) Cooling available. This safety evaluation covered the 1996 Unit 2 refueling outage schedule which included a dual train Component Cooling Water (CCW) outage. The safety review addressed the FSAR Section 9.4 attributes of the SFP dealing with bulk pool temperature requirements, however, failed to address FSAR Section 9.5 attributes on associated CCW cooling requirements, such as the assumption that the CCW supply to the SFP heat exchanger is from the non-accident unit.

Investigation into this event is continuing. In the interim, information concerning this condition has been made available to Engineering and Scheduling personnel. Scheduling has reviewed the outage schedule for the upcoming Unit 2 refueling outage and verified that no dual train CCW outage is planned, and the appropriate procedure is being revised to require 1 train of CCW to be operable in support of Spent Fuel Pool Cooling during Modes 5, 6 and when defueled. Evaluation of the safety consequences of this condition, and other similar conditions reported separately via ENS during the period August 8, 1997 to September 12, 1997, is ongoing. An update to this interim LER will be issued by November 17, 1997.

9710290121 971023
PDR ADOCK 05000316
S PDR