

ACCELERATED DISTRIBUTION DEMONSTRATION SYSTEM

REGULATORY INFORMATION DISTRIBUTION SYSTEM (RIDS)

ACCESSION NBR: 9003220074 DOC. DATE: 90/03/08 NOTARIZED: NO DOCKET #
 FACIL: 50-316 Donald C: Cook Nuclear Power Plant, Unit 2, Indiana & 05000316
 AUTH. NAME AUTHOR AFFILIATION
 BEILMAN, T.P. Indiana Michigan Power Co. (formerly Indiana & Michigan Ele
 BLIND, A.A. Indiana Michigan Power Co. (formerly Indiana & Michigan Ele
 RECIP. NAME RECIPIENT AFFILIATION

SUBJECT: LER 88-003-07: on 880111, repetitive violation of ESF
 instrumentation limiting condition for operation tolerances.
 W/9 ltr.

DISTRIBUTION CODE: IE22T COPIES RECEIVED: LTR ENCL SIZE: 5
 TITLE: 50.73/50.9 Licensee Event Report (LER), Incident Rpt, etc.

NOTES:

	RECIPIENT ID CODE/NAME	COPIES LTTR ENCL	RECIPIENT ID CODE/NAME	COPIES LTTR ENCL
	PD3-1 LA	1 1	PD3-1 PD	1 1
	GIITTER, J.	1 1		
INTERNAL:	ACNW	2 2	AEOD/DOA	1 1
	AEOD/DSP/TPAB	1 1	AEOD/ROAB/DSP	2 2
	DEDRO	1 1	NRR/DET/ECMB 9H	1 1
	NRR/DET/EMEB9H3	1 1	NRR/DET/ESGB 8D	1 1
	NRR/DLPQ/LHFB11	1 1	NRR/DLPQ/LPEB10	1 1
	NRR/DOEA/OEAB11	1 1	NRR/DREP/PRPB11	2 2
	NRR/DST/SELB 8D	1 1	NRR/DST/SICB 7E	1 1
	NRR/DST/SPLB8D1	1 1	NRR/DST/SRXB 8E	1 1
	REG-FILE 02	1 1	RES/DSIR/EIB	1 1
	RGN3 FILE 01	1 1		
EXTERNAL:	EG&G WILLIAMS, S	4 4	L ST LOBBY WARD	1 1
	LPDR	1 1	NRC PDR	1 1
	NSIC MAYS, G	1 1	NSIC MURPHY, G.A	1 1
	NUDOCS FULL TXT	1 1		

NOTE TO ALL "RIDS" RECIPIENTS:

PLEASE HELP US TO REDUCE WASTE! CONTACT THE DOCUMENT CONTROL DESK,
 ROOM P1-37 (EXT. 20079) TO ELIMINATE YOUR NAME FROM DISTRIBUTION
 LISTS FOR DOCUMENTS YOU DON'T NEED!

FULL TEXT CONVERSION REQUIRED
 TOTAL NUMBER OF COPIES REQUIRED: LTTR 35 ENCL 35

Indiana Michigan
Power Company
Cook Nuclear Plant
P.O. Box 458
Bridgman, MI 49106
616 465 5901



March 9, 1990

United States Nuclear Regulatory Commission
Document Control Desk
Rockville, Maryland 20852

Operating License DPR-74
Docket No. 50-316

Document Control Manager:

In accordance with the criteria established by 10 CFR 50.73
entitled Licensee Event Reporting System, the following
report is being submitted:

88-003-07

Sincerely,

A.A. Blind
Plant Manager

AAB:clw

Attachment

cc: D.H. Williams, Jr.
A.B. Davis, Region III
M.P. Alexich
P.A. Barrett
J.E. Borggren
R.F. Kroeger
NRC Resident Inspector
J.G. Gitter, NRC
R.C. Callen
G. Charnoff, Esq.
Dottie Sherman, ANI Library
D. Hahn
INPO
S.J. Brewer/B.P. Lauzau

9003220074 900308
PDR ADOCK 05000316
S PDC

TE22
1/1

bcc: J.D. Allard
T.P. Beilman
P.F. Carteaux
J.B. Droste
M.L. Horvath
L.J. Matthias
T.K. Postlewait
J.R. Sampson
J.T. Wojcik
H.H. Bolinger
Information and Records Center
E.A. Smarrella - Visitor's Center
S&A Department File

LICENSEE EVENT REPORT (LER)

ESTIMATED BURDEN PER RESPONSE TO COMPLY WITH THIS INFORMATION COLLECTION REQUEST: 60.0 HRS. FORWARD COMMENTS REGARDING BURDEN ESTIMATE TO THE RECORDS AND REPORTS MANAGEMENT BRANCH (P-530), U.S. NUCLEAR REGULATORY COMMISSION, WASHINGTON, DC 20555, AND TO THE PAPERWORK REDUCTION PROJECT (3150-0104), OFFICE OF MANAGEMENT AND BUDGET, WASHINGTON, DC 20503.

FACILITY NAME (1) D. C. COOK NUCLEAR PLANT - UNIT 2										DOCKET NUMBER (2) 0 5 0 0 0 3 1 6				PAGE (3) 1 OF 0 4		
TITLE (4) REPETITIVE VIOLATION OF ESF INSTRUMENTATION LIMITING CONDITIONS FOR OPERATION TOLERANCES DUE TO HIGHLY RESTRICTIVE ALLOWABLE VALUES																
EVENT DATE (5)			LER NUMBER (6)				REPORT DATE (7)			OTHER FACILITIES INVOLVED (8)						
MONTH	DAY	YEAR	YEAR	SEQUENTIAL NUMBER	REVISION NUMBER	MONTH	DAY	YEAR	FACILITY NAMES				DOCKET NUMBER(S)			
0 1	1 1	8 8	8 8	0 0 3	0 7	0 3	0 8	9 0	D.C. COOK - UNIT 1				0 5 0 0 0 3 1 5			
OPERATING MODE (9) 1			THIS REPORT IS SUBMITTED PURSUANT TO THE REQUIREMENTS OF 10 CFR §: (Check one or more of the following) (11)													
POWER LEVEL (10) 0 8 0		20.402(b)				20.405(c)				50.73(a)(2)(iv)				73.71(b)		
		20.405(a)(1)(i)				50.36(c)(1)				50.73(a)(2)(v)				73.71(c)		
		20.405(a)(1)(ii)				50.36(c)(2)				50.73(a)(2)(vii)				OTHER (Specify in Abstract below and in Text, NRC Form 366A)		
		20.405(a)(1)(iii)				50.73(a)(2)(i)				50.73(a)(2)(viii)(A)						
		20.405(a)(1)(iv)				50.73(a)(2)(ii)				50.73(a)(2)(viii)(B)						
		20.405(a)(1)(v)				50.73(a)(2)(iii)				50.73(a)(2)(x)						
LICENSEE CONTACT FOR THIS LER (12)																
NAME T. P. BEILMAN MAINTENANCE DEPARTMENT SUPERINTENDENT										TELEPHONE NUMBER						
										AREA CODE 6 1 6		4 6 5 - 5 9 0 1				
COMPLETE ONE LINE FOR EACH COMPONENT FAILURE DESCRIBED IN THIS REPORT (13)																
CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO NPRDS		CAUSE	SYSTEM	COMPONENT	MANUFACTURER	REPORTABLE TO NPRDS						
SUPPLEMENTAL REPORT EXPECTED (14)												EXPECTED SUBMISSION DATE (15)		MONTH	DAY	YEAR
YES (If yes, complete EXPECTED SUBMISSION DATE)												X NO				

ABSTRACT (Limit to 1400 spaces, i.e., approximately fifteen single-space typewritten lines) (16)

This revision is being submitted to reflect an update on the results of the increased frequency (monthly) calibration checks performed to date.

On March 11, 1988 an equipment trend investigation was being performed on 4KV Bus Loss of Voltage relays and the 4KV Bus Degraded Voltage relays (EIIS/EK-27). The 'as found' condition of these relays during past calibration checks has generally been found to be beyond the Technical Specification (T.S.) allowable values. Each relay was adjusted to within allowable values at the time it was discovered out of specification. All relays were functional and would have performed the ESF function, although at a slightly different voltage than specified in T.S.

An engineering review has determined a plus or minus 3 percent tolerance (as opposed to the current 0.5 percent) to be acceptable for the Loss of Voltage application. The Degraded Voltage application will accept a plus or minus 1.5 percent tolerance and will require installation of more accurate undervoltage relays (Design Change currently underway). A T.S. change request has been submitted. As stated in the original LER, we have increased the calibration frequency from every eighteen months to monthly.

LICENSEE EVENT REPORT (LER)
TEXT CONTINUATION

ESTIMATED BURDEN PER RESPONSE TO COMPLY WITH THIS INFORMATION COLLECTION REQUEST: 500 HRS. FORWARD COMMENTS REGARDING BURDEN ESTIMATE TO THE RECORDS AND REPORTS MANAGEMENT BRANCH (P-530), U.S. NUCLEAR REGULATORY COMMISSION, WASHINGTON, DC 20555, AND TO THE PAPERWORK REDUCTION PROJECT (3150-0104), OFFICE OF MANAGEMENT AND BUDGET, WASHINGTON, DC 20503.

FACILITY NAME (1)

DOCKET NUMBER (2)

LER NUMBER (6)

PAGE (3)

D. C. COOK NUCLEAR PLANT - UNIT 2

0 5 0 0 0 3 1 6 8 8 — 0 0 3 — 0 7 0 2 OF 0 4

TEXT (If more space is required, use additional NRC Form 366A's) (17)

This revision is being submitted to reflect an update on the results of the increased frequency (monthly) calibration checks performed to date.

Conditions Prior To Occurrence

Unit 1 and Unit 2 were operating at 90 percent and 80 percent reactor thermal power, respectively, throughout the event. There were no inoperative structures, components, or systems that contributed to this event.

Description of Event

On March 11, 1988, an equipment trend investigation was being performed on the 4KV Bus Loss of Voltage relays (EIIS/EK-27) and the 4KV Bus Degraded Voltage relays (EIIS/EK-27). The setpoints for these relays have been found to be outside of the Technical Specification (T.S.) allowable values (T.S. 3.3.2.1 Table 3.3-4, items 8a and 8b). Of 144 individual calibrations on the loss of voltage relays over a seven year period, 68 were found to be outside of the T.S. tolerances. Of the 66 individual calibrations performed on the degraded voltage relays over a seven year period, 41 were found to be outside of the T.S. tolerances. The amount of deviation from the allowable setpoint band was limited and distribution among the relays was random, indicating no particular relay to be defective. A survey of other utilities which use this type of relay revealed that the performance of our relays is consistent with their experience and within manufacturer's specifications. Each relay was readjusted to within allowable values at the time it was discovered out of specification.

The Loss of Voltage relays are installed to sense a loss of offsite or normal auxiliary power to the ESS 4KV buses. Once the loss of voltage has been sensed and after a two-second time delay, these relays in a 2/3 phases logic initiate load shedding and emergency diesel generator starting. The Degraded Bus Voltage relays are installed to sense degraded reserve power feed to the ESS 4KV buses and, on a 2/3 phases logic with a two-minute time delay, trip open the reserve feed breakers and start the emergency diesel generators. Once the emergency diesel generator has restored bus voltage to normal, safety loads are sequenced on to the safety buses. The Technical Specifications for Units 1 and 2 have existing setpoints of 80 percent (+.5 %, -1.0%) for the Loss of Voltage and 90 percent (+1.0%, -.5%) for the Degraded Grid detection. The tolerance on these setpoints are tighter than the relays can obtain, and more importantly, tighter than required for performing their intended function, i.e., sensing loss of normal voltage, initiating load shedding, and diesel starting.

LICENSEE EVENT REPORT (LER)
TEXT CONTINUATION

ESTIMATED BURDEN PER RESPONSE TO COMPLY WITH THIS INFORMATION COLLECTION REQUEST: 500 HRS. FORWARD COMMENTS REGARDING BURDEN ESTIMATE TO THE RECORDS AND REPORTS MANAGEMENT BRANCH (P-530), U.S. NUCLEAR REGULATORY COMMISSION, WASHINGTON, DC 20555, AND TO THE PAPERWORK REDUCTION PROJECT (3150-0104), OFFICE OF MANAGEMENT AND BUDGET, WASHINGTON, DC 20503.

FACILITY NAME (1)

DOCKET NUMBER (2)

LER NUMBER (6)

PAGE (3)

D. C. COOK NUCLEAR PLANT - UNIT 2

0 5 0 0 0 3 1 6 88 — 0 0 3 — 0 7 0 3 OF 0 4

TEXT (If more space is required, use additional NRC Form 366A's) (17)

Cause of the Event

Calibration history shows a performance record in line with undervoltage relays used at other plants. We have reviewed the application of undervoltage relays for this function with other utilities and various relay manufacturers.

We have concluded that the undervoltage relays are being properly applied in this mode as a conventional protective relay. This use would not normally involve having an acceptance band. Many utilities consulted had no Technical Specification required tolerances for this function and others had broader allowance values which more closely reflect the manufacturer's expected performance tolerances.

Analysis of Event

American Electric Power's System voltage studies have been performed and indicate that the worst case voltage on the ESS buses at the Cook Nuclear Plant would be 87.3 percent. We do not expect the ESS bus voltage to drop to a lower voltage than this unless a complete plant blackout condition occurred. Under a blackout condition, the ESS bus voltage would quickly drop well below the 80 percent undervoltage relay setpoint and initiate load shedding and diesel start. The only function of the 80 percent voltage relays is to sense a total loss of ESS bus voltage. Therefore, the setpoint deviations we've experienced translate into a different line voltage and time than the Technical Specification calls for, but the time involved for this additional voltage drop is insignificant.

The function of the degraded bus relays are to disconnect the plant from the grid for a sustained degraded condition, i.e., less than 90 percent voltage for at least two minutes. They are armed only when the plant is fed from offsite power. Plant normal configuration is to be fed from the generator auxiliary transformers except for short periods during startup and shutdown. Therefore, these relays are not normally active during unit operation.

Again, relating to our system studies, we do not believe the slight out of tolerance to be a safety problem for the degraded bus relays. Our studies indicate that the lowest possible offsite voltage to our buses would be 93.3 percent except for the short period during Reactor Coolant Pump (RCP) starting, which is less than one minute. During RCP starting, the bus voltage can dip to 87.3 percent, however, we are protected from an unnecessary trip by the two-minute time delay on this circuit.

LICENSEE EVENT REPORT (LER)
TEXT CONTINUATION

ESTIMATED BURDEN PER RESPONSE TO COMPLY WITH THIS INFORMATION COLLECTION REQUEST: 500 HRS. FORWARD COMMENTS REGARDING BURDEN ESTIMATE TO THE RECORDS AND REPORTS MANAGEMENT BRANCH (P-530), U.S. NUCLEAR REGULATORY COMMISSION, WASHINGTON, DC 20555, AND TO THE PAPERWORK REDUCTION PROJECT (3150-0104), OFFICE OF MANAGEMENT AND BUDGET, WASHINGTON, DC 20503.

FACILITY NAME (1) D. C. COOK NUCLEAR PLANT - UNIT 2	DOCKET NUMBER (2) 0 5 0 0 0 3 1 6	LER NUMBER (6)			PAGE (3)		
		YEAR	SEQUENTIAL NUMBER	REVISION NUMBER			
		8 8	— 0 0 3	— 0 7	0 4	OF	0 4

TEXT (If more space is required, use additional NRC Form 365A's) (17)

An engineering review has determined a plus or minus 3 percent tolerance (as opposed to the current 0.5 percent) to be acceptable for the Loss of Voltage application. Most of the calibration history data is within 3 percent of the required setpoint. The few exceptions are considered normal random failures. The Degraded Voltage application will accept a plus or minus 1.5 percent tolerance. This value is suitable for the installation of more accurate undervoltage relays.

Based on the above, it has been concluded that there is no jeopardy to the health and safety of the public as a result of this event.

Corrective Action

The relays were recalibrated to within the allowable values at the time of discovery during the calibration. An engineering review has determined a plus or minus 3 percent tolerance to be acceptable for the Loss of Voltage application and a plus or minus 1.5 percent tolerance for the Degraded Voltage application. A Technical Specification change request has been submitted. In addition, a Design Change regarding the replacement of the currently installed Degraded Voltage relays with more accurate relays is scheduled to be completed at the next refueling outages for both units. As stated in the original LER, we have increased the calibration frequency from every eighteen months to monthly until the trend indicates a different frequency is justified.

Monthly calibration checks have yielded the following results to date:

4KV Loss of Voltage - 456 calibrations -- 11.2 percent
51 failures

4KV Degraded Voltage - 228 calibrations -- 17.1 percent
39 failures

Failed Component Identification

None.

Previous Similar Events

LER 316/81-015	LER 316/82-108
LER 315/81-017	LER 315/83-069
LER 315/82-051	LER 315/83-094
LER 315/82-059	
LER 316/82-100	