


CONTROL BLOCK: 1 1 1 1 1 (1) (PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

தேவ

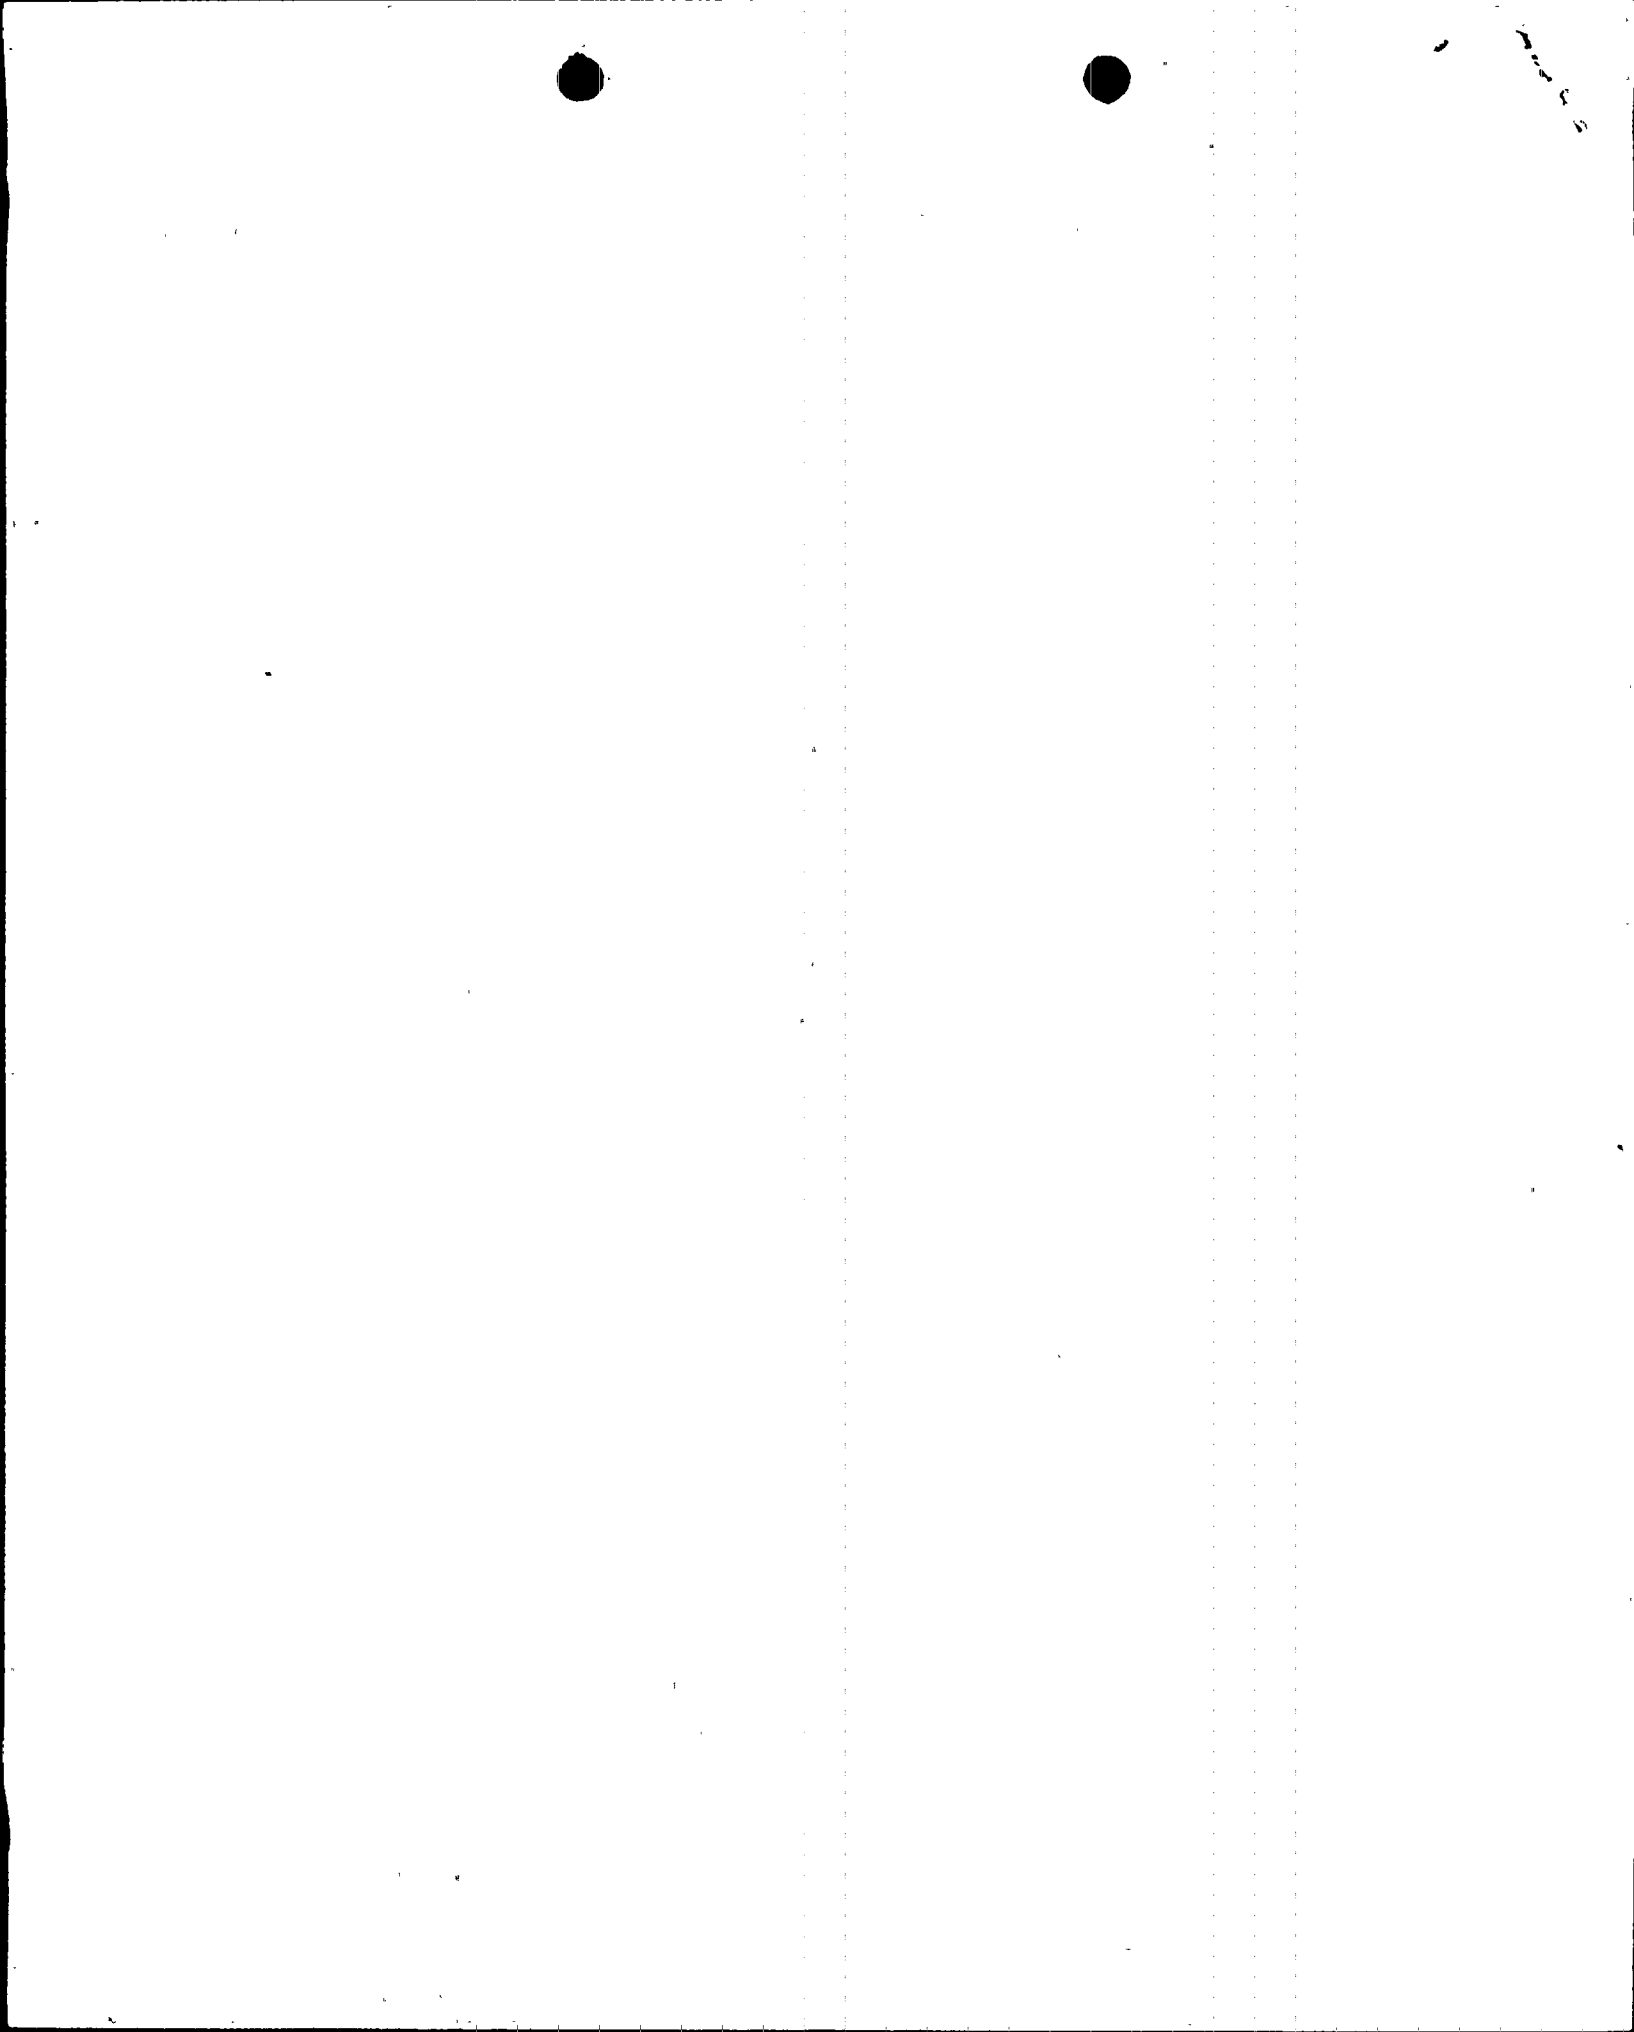

Additional Cause Description and Corrective Actions:

The root cause of the problem was a broken drive belt on the agitator (mixer for the cold lime softener in the Water Treatment Plant). Due to inadequate spare parts, the agitator motor had to be remounted to accept a drive belt that was available on site.

Corrective action will include a review of spare parts required for critical portions of the Water Treatment Plant. Additional modifications are currently scheduled which will reduce the potential exposure to events of this type. Additional water storage capacity is being provided as a part of the planned upgrade of the demineralized water/deaeration system. This modification is currently scheduled to be completed during the first quarter of 1981. A steam generator blowdown recovery system will be installed on each of the nuclear units. This modification is currently scheduled to be completed on Unit 4 during the second quarter of 1981 and on Unit 3 during the second quarter of 1982.

