

## LICENSEE EVENT REPORT

CONTROL BLOCK: 1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

(PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

0 1 V A S P S 2 0 0 - 0 0 0 0 0 0 - 0 0 3 4 1 1 1 1 4 5  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

CONT

0 1 REPORT SOURCE L 6 0 5 0 0 0 2 8 1 7 0 1 1 8 8 1 8 0 2 1 7 8 1 9  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (10)

0 2 With Unit 2 at 100 percent power, one of two required flow paths to the core became  
0 3 unavailable and BIT Recirc was terminated due to the loss of Boric Acid Transfer  
0 4 Pump 1-CH-P-2D. This is contrary to T.S. 3.2.B.4 and 3.3.A.3, and is reportable per  
0 5 T.S. 6.6.2.b.(2). The redundant transfer pump was placed in service within 6  
0 6 minutes; therefore, the health and safety of the public were not affected.  
0 7  
0 8  
0 9

0 9  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

SYSTEM CODE CH 11 CAUSE CODE E 12 CAUSE SUBCODE B 13 COMPONENT CODE P U M P X X 14 COMP. SUBCODE B 15 VALVE SUBCODE Z 16  
17 LER/RO REPORT NUMBER 8 1 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)

1 0 Pump's oil seal failed, thereby causing bearing failure and subsequent loss of pump.  
1 1 Transfer Pump 1-CH-P-2C was placed in service. Transfer Pump 1-CH-P-2D was repaired,  
1 2 tested, and returned to service.  
1 3  
1 4

1 5  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

1 6 FACILITY STATUS E 28 % POWER 1 0 0 29 OTHER STATUS NA 30 METHOD OF DISCOVERY A 31 DISCOVERY DESCRIPTION Annunciator 32  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

1 7 ACTIVITY CONTENT Z 33 Z 34 AMOUNT OF ACTIVITY NA 35 LOCATION OF RELEASE NA 36  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

1 8 PERSONNEL EXPOSURES NUMBER 0 0 0 37 TYPE Z 38 DESCRIPTION NA 39  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

1 9 PERSONNEL INJURIES NUMBER 0 0 0 40 DESCRIPTION NA 41  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

1 0 LOSS OF OR DAMAGE TO FACILITY TYPE Z 42 DESCRIPTION NA 43  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

1 1 PUBLICITY ISSUED N 44 DESCRIPTION NA 45  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

2 0  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

NRC USE ONLY

8102190590

NAME OF PREPARER

J. L. Wilson

PHONE:

(804) 357-3184

ATTACHMENT (PAGE 1 OF 1)  
SURRY POWER STATION, UNIT 2  
REPORT NO: 81-012/03L-0  
EVENT DATE: 01-18-81

TITLE OF REPORT: BORIC ACID TRANSFER PUMP FAILURE

1. DESCRIPTION OF EVENT:

With Unit Two operating steady state at 100% power, boric acid flow to the blender and Boron Injection Tank were lost due to Boric Acid Transfer Pump 1-CH-P-2D tripping off the line. This resulted in unavailability of one of two boration flow paths to the core and the loss of continuous recirculation of the Boron Injection Tank for approximately 6 minutes until 1-CH-P-2C was placed in service.

This event is contrary to Technical Specifications 3.2.B.4 and 3.3.A.3, and is reportable as per T.S. 6.6.2.b.(2).

2. PROBABLE CONSEQUENCES AND STATUS OF REDUNDANT SYSTEMS:

During an accident condition, the normal boric acid supply is isolated and boric acid is supplied from the Refueling Water Storage Tank. Boron Injection Tank Recirc flow interruption is permitted for up to two hours as per T.S. 3.3.B.1D. Therefore, the health and safety of the public were not affected.

3. CAUSE:

Evidence indicates that the pump's oil seal failed, thereby causing bearing failure and subsequent loss of pump.

4. IMMEDIATE CORRECTIVE ACTION:

The immediate corrective actions taken were to start a unit ramp down and line up and start Boric Acid Transfer Pump 1-CH-P-2C. As soon as the second boric acid flow path to the core was established, the ramp down was terminated and the unit returned to full power.

5. SUBSEQUENT CORRECTIVE ACTION:

Boric Acid Transfer Pump 1-CH-P-2D was repaired, tested, and returned to service.

6. ACTION TAKEN TO PREVENT RECURRENCE:

None

7. GENERIC IMPLICATIONS:

None.