

REPORT OF ABNORMAL OCCURRENCE AND/ INCIDENT

NRC DISTRIBUTION FOR PART 50 DOCKET MATERIAL
(TEMPORARY FORM)

CONTROL NO: 9588

FILE: INCIDENT REPORT FILE

FROM: Metropolitan Edison Co. Reading, Pa. R.C. Arnold		DATE OF DOC 9-5-75	DATE REC'D 9-10-75	LTR XX	TWX	RPT	OTHER
TO:		ORIG	CC	OTHER	SENT AEC PDR XXX		
NRC		1 Signed			SENT LOCAL PDR XXX		
CLASS	UNCLASS	PROP INFO	INPUT	NO CYS REC'D	DOCKET NO:		
	XXX			1	50-289		

DESCRIPTION:

A/O # 75-30, on 8-27-75, Concerning Failure of Core Flood Tank "B" Sample line Isolation Valve (CF-V-23) to close on an Engineered Safeguards Actuation Signal.....

(1 Copy Enclosure Received)

PLANT NAME: Three Mile Island

ENCLOSURES:

FOR ACTION/INFORMATION

SAB 9-12-75

BUTLER (L) W/ Copies	SCHWENCER (L) W/ Copies	ZIEMANN (L) W/ Copies	REGAN (E) W/ Copies
CLARK (L) W/ Copies	STOLZ (L) W/ Copies	DICKER (E) W/ Copies	LEAR (L) W/3 Copies
PARR (L) W/ Copies	VASSALLO (L) W/ Copies	KNIGHTON (E) W/ Copies	SPELS W/ Copies
KNIEL (L) W/ Copies	PURPLE (L) W/ Copies	YOUNGBLOOD (E) W/ Copies	

DO NOT REMOVE

ACKNOWLEDGED

INTERNAL DISTRIBUTION

REG FILE	TECH REVIEW	DENTON	LIC ASST	A/T IND.
NRC PDR	SCHROEDER	GRIMES	R. DIGGS (L)	BRAITMAN
OGC, ROOM P-506A	MACCARY	GAMMILL	H. GEARIN (L)	SALTZMAN
GOSSICK/STAFF	KNIGHT	KASTNER	E. GOULBOURNE (L)	MELTZ
CASE	PAWLICKI	BALLARD	P. KREUTZER (E)	
GIAMBUSSO	SHAO	SPANGLER	J. LEE (L)	PLANS
BOYD	** STELLO		M. RUSHBROOK (L)	MCDONALD
MOORE (L)	** HOUSTON	ENVIRO	S. REED (E)	CHAPMAN
DEYOUNG (L)	** NOVAK	MULLER	M. SERVICE (L)	DUBE (Ltr)
SKOVHOLT (L)	ROSS	DICKER	S. SHEPPARD (L)	E. COUPE
GOLLER (L) (Ltr)	IPPOLITO	KNIGHTON	M. SLATER (E)	PETERSON
P. COLLINS	TEDESCO	YOUNGBLOOD	H. SMITH (L)	HARTFIELD (2)
DENISE	J. COLLINS	REGAN	S. TEETS (L)	KLECKER
REG OPR	LAINAS	PROJECT LDR	G. WILLIAMS (E)	EISENHUT
FILE & REGION (2)	BENAROYA		V. WILSON (L)	'WIGGINTON'
MPC/PE (3)	VOLLMER	HARLESS	R. INGRAM (L)	F. WILLIAMS
STEELE			M. DUNCAN (E)	HANAUER

EXTERNAL DISTRIBUTION

1 - LOCAL PDR Harrisburg, PA.	1 - NATIONAL LABS	1 - PDR-SAN/LA/NY
1 - TIC (ABERNATHY) (1)(2)(10)	1 - W. PENNINGTON, Rm E-201 GT	1 - BROOKHAVEN NAT LAB
1 - NSIC (BUCHANAN)	1 - CONSULTANTS	1 - G. ULRIKSON, ORNL
1 - ASLB	NEWMARK/BLUME/AGBABIAN	1 - AGMED (RUTH GUSSMAN)
1 - Newton Anderson		Rm B-127 GT
5 - ACRS SENT TO LIC ASST S. Teets		1 - J. D. RUNKLES, Rm E-201
** SEND ONLY TEN DAY REPORTS		GT

1476 258-

7910240

938

5



Regulatory

Edison Co.

METROPOLITAN EDISON COMPANY

POST OFFICE BOX 542 READING, PENNSYLVANIA 19603

TELEPHONE 215 - 929-3601

September 5, 1975
GQL 1482

Director
Division of Reactor Licensing
U. S. Nuclear Regulatory Commission
Washington, D. C. 20555

Docket No. 50-289
Operating License No. DPR-50

Dear Sir:

In accordance with the Technical Specifications of our Three Mile Island Nuclear Station Unit 1 (TMI-1), we are reporting the following abnormal occurrence.

- (1) Report Number: AO 50-289/75-30
- (2a) Report Date: September 5, 1975
- (2b) Occurrence Date: August 27, 1975
- (3) Facility: Three Mile Island Nuclear Station Unit 1
- (4) Identification of Occurrence:

Title: Failure of Core Flood Tank "B" Sample Line
Isolation Valve (CF-V-2B) to close on an Engineered
Safeguards Actuation Signal

Type: An abnormal occurrence as defined by the Technical
Specifications, paragraph 1.8d, in that failure of
CF-V-2B to close constituted a failure of one
component of an engineered safety feature that
threatened to cause that feature to be incapable of
performing its intended function.

- (5) Conditions Prior to Occurrence:

Power: Core: 99%
Elect.: 826 Mwe (Gross)

RC Flow: 139×10^6 lb/hr

RC Press: 2155 psig

RC temp: 580°F



1476 259

3593

TO: Director
Division of Reactor Licensing
U. S. Nuclear Regulatory Commission

- 2 -

PRZR level: 245 inches

PRZR temp: 655°F

(6) Description of Occurrence:

At 1130 hours on August 27, 1975 while performing the Reactor Building Cooling and Isolation Component and Logic Surveillance Test, CF-V-2B (Core Flood Tank "B" Sample Line Isolation Valve) failed to close upon receipt of an Engineered Safeguards actuation signal. Immediately prior to this failure, the valve operated satisfactorily upon receipt of two separate auto Engineered Safeguards test actuation signals.

An attempt was made to close CF-V-2B using the remote pushbutton, but the valve failed to close. CF-V-2B was then closed locally by use of its handwheel, after which the valve cycled properly using the remote pushbutton.

The redundant isolation valve for the sample line CF-V-2B was cycled to verify its operability. CF-V-2B was manually cycled and the valve stem lubricated. An inspection was made of the valve's auxiliary contact blocks to determine if they were binding the opening and closing contactors in any way.

(7) Designation of Apparent Cause of Occurrence:

Initial investigation indicated CF-V-2B failed to close as a result of the valve packing binding against the valve stem, causing it to stop travel by opening the closing torque switch prematurely.

Further troubleshooting revealed that CF-V-2B may have failed to close due to the closing torque switch apparently physically being held open intermittently by splice insulating caps associated with wiring located next to the switch. The wiring adjacent to the switch provides 120 VAC to the valve limit switch compartment heater which is used to remove moisture. Excess wire associated with the heater was coiled in close proximity to the valve closing torque switch contacts, hence the interference of the wire insulating caps with the switch contacts may have in turn caused the valve not to fully close. It is postulated that either one or both of the above problems caused the closing torque switch contacts to open early, preventing CF-V-2B from closing.

1476 260

TO: Director
Division of Reactor Licensing
U. S. Nuclear Regulatory Commission

- 3 -

(8) Analysis of Occurrence:

It is believed that the failure of CF-V-2B did not represent a threat to the health and safety of the public in that:

- a. One containment isolation valve is sufficient to isolate the Core Flood Tank "B" Sample Line in the event of a loss of coolant accident.
- b. The redundant containment isolation valve for the Core Flood Tank "B" Sample Line was operable.
- c. The redundant isolation valve was closed at the time of the occurrence.

(9) Corrective Actions:

In addition to the corrective actions mentioned above long term corrective actions were:

- a. CF-V-2B's torque switch settings have been increased, yet are within acceptable limits, and any wires that would possibly interfere with proper torque switch contact operation have been relocated.
- b. The valve CF-V-2B will be repacked to further reduce the possibility of any abnormal binding.

The Plant Operations Review Committee and the Station Superintendent have reviewed and approved the above listed corrective actions and have taken steps to ensure completion of the yet to be completed long term corrective actions.

(10) Failure Data:

Valve Operator:

Limitorque SMB-000

Valve:

Rockwell 3624(F316)JM
Type-Globe

 
1476 261

TO: Director
Division of Reactor Licensing
U. S. Nuclear Regulatory Commission

- 4 -

Similar Occurrences: None

Sincerely,



R. C. ARNOLD
Vice President

RCA:CWS:rk
cc: Office of Inspection and ENforcement, Region 1
File: 7.7.3.5.1/20.1.1

1476 262