

LICENSEE EVENT REPORT

CONTROL BLOCK:

--	--	--	--	--	--

(PLEASE PRINT ALL REQUIRED INFORMATION)

LICENSEE NAME					LICENSE NUMBER					LICENSE TYPE					EVENT TYPE			
01	P	A	T	M	=	1	00	-	000000	-	00	4	/	/	/	/	03	
7	8	9				14	15					25	26				31	32

CATEGORY		REPORT TYPE	REPORT SOURCE	DOCKET NUMBER					EVENT DATE					REPORT DATE				
01	CON'T		4	05	0	-	0289	03	0	9	77	04	0	8	77			
7	8	57	58	59	60	61		68	69			74	75			80		

EVENT DESCRIPTION

02 During normal operation, while performing the R.B. Spray System Channel
7 8 9 80

03 Test, The R.B. Spray Pump Section Isolation Valve failed to close with
7 8 9 80

04 a remote control signal. The valve was manually closed, failed to open
7 8 9 80

05 with a remote signal, and was manually opened. The valve motor was
7 8 9 80

06 replaced and the spring pack was changed.
7 8 9 80

SYSTEM CODE			CAUSE CODE		COMPONENT CODE					PRIME COMPONENT SUPPLIER		COMPONENT MANUFACTURER			VIOLATION			
0	7		5	A	E						A		R	1	6	5	N	
7	8	9	10		11	12	13	14	15	16	17	43		44	45	46	47	48

CAUSE DESCRIPTION

08 Grease in the spring pack prevented the torque switch from stopping
09 the motor when the valve seated causing the motor to overheat and
10 fail

FACILITY STATUS		% POWER		OTHER STATUS		METHOD OF DISCOVERY		DISCOVERY DESCRIPTION	
11	5	100		NA		A		NA	
7	8	9	10	11	12	13	14	15	

FORM OF ACTIVITY RELEASED 12 2 Z

CONTENT OF RELEASE Z AMOUNT OF ACTIVITY NA LOCATION OF RELEASE NA

PERSONNEL EXPOSURES

NUMBER				TYPE	DESCRIPTION
13	000	Z		NA	

PERSONNEL INJURIES

NUMBER				DESCRIPTION	
1	4	0	0	0	NA

OFFSITE CONSEQUENCES

15 NA

LOSS OR DAMAGE TO FACILITY

TYPE			DESCRIPTION
16	2		NA

7 8 9 10

POOR ORIGINAL

PLURALITY

17 | Included in weekly news release | 1476 356 | 80

ADDITIONAL FACTORS

18 Value motor was replaced and excess grease was removed from
7 8 9 80

19 | the spring pack 7810250566 S

NAME: W. E. Batts

PHONE: 929-3100 ext. 114