

LICENSEE EVENT REPORT

CONTROL BLOCK:

--	--	--	--	--	--	--

 ①

(PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

[illegible]

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (10)

012 The installation dimensions of condensing pots 2B21-D004A and B were discovered not
013 to be installed per design. The actual installation caused an 11.2 inch error in the
014 calibration of the 2B21-N017A-D level switches. The switches were set higher than
015 intended which resulted in the RCIC and HPCI high level trips exceeding the Tech Spec
016 requirement of less than or equal to + 58 inches. (Technical Specifications table
017 3.3.2-1)
018

SYSTEM CODE I B (11)		CAUSE CODE B (12)		CAUSE SUBCODE C (13)		COMPONENT CODE I N S T R U (14)		COMP. SUBCODE S (15)		VALVE SUBCODE Z (16)	
EVENT YEAR 7 8 (17)		SEQUENTIAL REPORT NO. 0 6 2 (18)		OCCURRENCE CODE 0 1 (19)		REPORT TYPE T (20)		REVISION NO. 1 (21)		ACTION TAKEN E (22)	
FUTURE ACTION Z (23)		EFFECT ON PLANT Z (24)		SHUTDOWN METHOD Z (25)		HOURS 0 0 0 (26)		ATTACHMENT SUBMITTED N (27)		NPRO-4 FORM SUB. N (28)	
PRIME COMP. SUPPLIER N (29)		COMPONENT MANUFACTURER G 0 8 0 (30)		CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (31)							

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)

1 0 | The cause of the error was the installation deviant from design. Specification
1 1 | action was initiated and completed to recalibrate all instruments affected. An As-Built
1 2 | Notice was issued to correct the installation detail drawings after an engineering
1 3 | evaluation determined the proper operation of the instrumentation had not been
1 4 | effected. There were no effects on the environs and no equipment damaged.

FACILITY STATUS (1) 5 (2) B (3) 28
 % POWER (4) 0 (5) 0 (6) 0 (7) 29
 OTHER STATUS (8) N/A (9) 30
 METHOD OF DISCOVERY (10) 31
 DISCOVERY DESCRIPTION (11) Operator Observation (12) 32

ACTIVITY CONTENT
RELEASED OF RELEASE

1 6 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50

AMOUNT OF ACTIVITY N/A

LOCATION OF RELEASE N/A

PERSONNEL EXPOSURES									
NUMBER			TYPE		DESCRIPTION				
1	2	3	4	5	6	7	8	9	10
0	0	0	37	Z	38	N/A			

PERSONNEL INJURIES		NUMBER		DESCRIPTION	
1	2	3	4	5	6
		01	01	01	40
				N/A	

7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

LOSS OF OR DAMAGE TO FACILITY
TYPE DESCRIPTION (43)

7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

7907260 8/3 5

N/A

DO NOT WRITE

PUBLICITY
 ISSUED DESCRIPTION (45) **POOR ORIGINAL**
 2 0 14 454 200 N/A
 NRC USE ONLY

NAME OF PREPARER

R. T. ONIX

PHONE

912-367-7781

NRC USE ONLY