

# LICENSEE EVENT REPORT

CONTROL BLOCK:                      (PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

467 319

0 1 N C B E P 2 0 0 - 0 0 0 0 0 - 0 0 3 4 1 1 1 1 4 5  
7 8 9 14 15 25 26 30 37 CAT 38

0 1 REPORT SOURCE L 0 5 0 - 0 3 2 4 0 6 0 2 7 9 0 7 1 8 7 9 9  
7 8 60 61 68 69 74 75 80

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (10)

0 2 While performing an inspection of pipe supports and hangers in accordance with IE  
0 3 Bulletin 79-07, the following snubbers were found inoperable: 1) 2E21-3SS48, Core  
0 4 Spray to vessel; 2) 2B32-SSB9B, 2B Recirc. pump suction; 3) 2PSN-B3SS46, main steam  
0 5 line "B"; 4) 2G41-12SS98, RHR to fuel pool cooling; 5) 2PS-3613, instrumentation top.  
0 6 Technical Specification 3.7.5, 6.9.1.9.b  
0 7  
0 8

0 9 SYSTEM CODE SH 11 CAUSE CODE X 12 CAUSE SUBCODE X 13 COMPONENT CODE SUPORT 14 COMP. SUBCODE D 15 VALVE SUBCODE Z 16  
7 8 9 10 11 12 13 18 19 20  
17 LER/RO REPORT NUMBER 7 9 0 2 9 0 3 X 1  
21 22 23 24 26 27 28 29 30 31 32  
ACTION TAKEN FUTURE ACTION EFFECT ON PLANT SHUTDOWN METHOD HOURS ATTACHMENT SUBMITTED NPD-4 FORM SUB. PRIME COMP. SUPPLIER COMPONENT MANUFACTURER  
X 18 Z 19 Z 20 Z 21 0 0 0 0 y 23 y 24 A 25 B 2 0 9 26  
33 34 35 36 37 40 41 42 43 44 47

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)

1 0 2B32-SSB9B, 2PSN-B3SS46, and 2PS-3613 had low fluid level due to seal leakage. These  
1 1 were rebuilt, functionally tested, and returned to service. 2G41-12SS98 had a loose  
1 2 pipe clamp. The snubber was aligned and the clamp tightened per procedure. 2E21-  
1 3 3SS48 was found missing. This snubber was immediately replaced. This snubber was  
1 4 removed and rebuilt during the performance of the drywell visual inspection, (CON'T)

1 5 FACILITY STATUS 3 28 % POWER 0 0 0 29 NA OTHER STATUS 30 METHOD OF DISCOVERY C 31 Hanger Inspection DISCOVERY DESCRIPTION 32  
7 8 9 10 11 12 13 44 45 46 80  
1 6 ACTIVITY CC INTENT RELEASED OF RELEASE Z 33 Z 34 NA AMOUNT OF ACTIVITY 35 LOCATION OF RELEASE 36  
7 8 9 10 11 44 45 80  
1 7 PERSONNEL EXPOSURES NUMBER TYPE DESCRIPTION 39 0 0 0 37 Z 38 NA  
7 8 9 11 12 13 80  
1 8 PERSONNEL INJURIES NUMBER DESCRIPTION 41 0 0 0 40 NA  
7 8 9 11 12 80  
1 9 LOSS OF OR DAMAGE TO FACILITY TYPE DESCRIPTION 43 Z 42 NA  
7 8 9 10 12 80  
2 0 PUBLICITY ISSUED DESCRIPTION 45 N 44 NA  
7 8 9 10 80

7807230618

NAME OF PREPARER A. C. Tollison, Jr.

PHONE: 919-457-9521

Facility: BSEP Unit No. 2

Event Date: 6-2-79

PT 19.6.0.1, during the 1979 refueling outage. The snubber was to have been installed by contract maintenance personnel who were shown the proper location for reinstallation. They failed to install the snubber. Management personnel of that contract maintenance company have been informed of the seriousness of this job omission. This has also been reviewed by plant maintenance foreman and will be reviewed by all mechanics. Testing of snubbers will continue per Technical Specifications. Maintenance procedures are being revised such that when a snubber is removed for maintenance, it will be verified reinstalled and operable.