

LICENSEE EVENT REPORT

CONTROL BLOCK: (PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

0 1 M D C C N 1 0 0 - 0 0 0 0 0 - 0 0 3 4 1 1 1 1 4 5
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

CON'T
0 1 REPORT SOURCE L 0 5 0 0 0 0 3 1 7 0 7 0 6 7 9 0 7 1 9 7 9 9
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (10)

0 2 At 0920 while performing a post modification test on the reactor coolant system
0 3 power operated relief valves, RC-402-ERV failed to fully close after lifting.
0 4 The valve was isolated and placed out of service (T.S.3.4.9.3). At 1540 RC-402-
0 5 ERV was returned to service. The redundant power operated relief remained
0 6 operable during the event. This is not a repetitive occurrence. RCS pressure
0 7 decreased from approximately 260 to 220 psia during this event.
0 8
0 9
1 0

0 5 SYSTEM CODE C B 11 CAUSE CODE E 12 CAUSE SUBCODE X 13 COMPONENT CODE V A L V E X 14 COMP. SUBCODE H 15 VALVE SUBCODE B 16
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

17 LER/RO REPORT NUMBER 7 9 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

ACTION TAKEN E 18 FUTURE ACTION Z 19 EFFECT ON PLANT Z 20 SHUTDOWN METHOD Z 21 HOURS 0 0 0 0 22 ATTACHMENT SUBMITTED Y 23 NPRD-4 FORM SUB. N 24 PRIME COMP. SUPPLIER N 25 COMPONENT MANUFACTURER D 2 4 3 26

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)

1 0 Both pressurizer power operated relief valves were disassembled and modified during
1 1 the recent refueling outage. Since it was not possible to stroke test the valves
1 2 without the reactor coolant system pressurized, this test was performed earliest
1 3 opportunity during the unit startup. RC-402-ERV failed to fully close after lifting
1 4 and was isolated. The pilot valve stroke was adjusted and the relief valve (CONT)
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

1 5 FACILITY STATUS G 28 % POWER 0 0 0 29 OTHER STATUS NA 30 METHOD OF DISCOVERY B 31 DISCOVERY DESCRIPTION Operator Observation 32
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

1 6 ACTIVITY CONTENT Z 33 RELEASED OF RELEASE Z 34 AMOUNT OF ACTIVITY NA 35 LOCATION OF RELEASE NA 36
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

1 7 PERSONNEL EXPOSURES NUMBER 0 0 0 37 TYPE Z 38 DESCRIPTION NA 39
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

1 8 PERSONNEL INJURIES NUMBER 0 0 0 40 DESCRIPTION NA 41
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

1 9 LOSS OF OR DAMAGE TO FACILITY TYPE Z 42 DESCRIPTION NA 43
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

2 0 PUBLICITY ISSUED N 44 DESCRIPTION NA 45
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

NAME OF PREPARER S. M. Davis/M. J. Miernicki

PHONE (301) 234-7942/7962

510 097

7907250

7907250 298

NRC USE ONLY

LER NO. 79-20/3L
DOCKET NO. 50-317
EVENT DATE 7-6-79
REPORT DATE 7-19-79
ATTACHMENT

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS: (CONTINUED)

was stroked several times satisfactorily and returned to service. (Dresser
Type 31533VX-30)