

LICENSEE EVENT REPORT UPDATE REPORT, PREVIOUS
REPORT DATE 05-07-79

CONTROL BLOCK: 1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

(PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

0 1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

CON'T
0 1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (10)

0 2 1 On 4-2-79 at 1700 while performing procedure HNP-1-311, B21-F028A closed in 2.9
0 3 2 seconds, B21-F028B closed in 2.4 seconds, actual time should have been 3 to 5 seconds.
0 4 3 This procedure was being performed as part of normal surveillance. There was no
0 5 4 effect on plant operations or to public safety.
0 6 5
0 7 6
0 8 7
0 9 8

0 9 9
SYSTEM CODE 11 CAUSE CODE 12 CAUSE SUBCODE 13 COMPONENT CODE 14 COMP. SUBCODE 15 VALVE SUBCODE 16
LER/RO REPORT NUMBER 17 EVENT YEAR 21 22 SEQUENTIAL REPORT NO. 24 26 OCCURRENCE CODE 28 29 REPORT TYPE 30 31 REVISION NO. 32
ACTION TAKEN 33 FUTURE ACTION 34 EFFECT ON PLANT 35 SHUTDOWN METHOD 36 HOURS 37 40 ATTACHMENT SUBMITTED 41 NPD-4 FORM SUB. 42 PRIME COMP. SUPPLIER 43 COMPONENT MANUFACTURER 44 47

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)

1 0 1 Preventative Maintenance was performed on all eight MSIV'S. Hydraulic fluid was
1 1 2 checked, packing and gasket areas were checked during vessel hydro, limit switches
1 2 3 were set and inspected. The B21-F028A valve was found low on hydraulic fluid, fluid
1 3 4 was added and the speed was recovered at 4 seconds. The B21-F028B needle valve was
1 4 5 adjusted to correct closing speed, speed was recovered at 3.8 seconds.

1 5 6 FACILITY STATUS 28 % POWER 29 OTHER STATUS 30 METHOD OF DISCOVERY 31 DISCOVERY DESCRIPTION 32
1 6 7 ACTIVITY CONTENT 33 RELEASED OF RELEASE 34 AMOUNT OF ACTIVITY 35 LOCATION OF RELEASE 36
1 7 8 PERSONNEL EXPOSURES NUMBER 37 TYPE 38 DESCRIPTION 39
1 8 9 PERSONNEL INJURIES NUMBER 40 DESCRIPTION 41
1 9 0 LOSS OF OR DAMAGE TO FACILITY TYPE 42 DESCRIPTION 43
1 9 1 PUBLICITY 44

1 9 2 SUBJECT DESCRIPTION 45 7908130 415 561 178 NRC USE ONLY
1 9 3 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

NAME OF PREPARED R. T. Nix PHONE: 912-367-7781