

LICENSEE EVENT REPORT

CONTROL BLOCK:

(PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

0	1	C	0	F	S	V	1	2	0	0	-	0	0	0	0	0	-	0	0	3	4	1	1	2	0	4		5
7	8	LIC-ONSEE CODE							14	LICENSE NUMBER										25	LICENSE TYPE					30	57 CAT 58	

CON'T

REPORT SOURCE L 6 0 5 0 0 0 2 6 7 7 0 9 1 3 7 9 8 1 0 0 3 7 9 9

60 61 DOCKET NUMBER 68 69 EVENT DATE 74 75 REPORT DATE 80

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (10)

During testing, it was discovered that four of twelve helium circulator seal malfunction pressure differential switch units either would not trip or tripped outside the limits of LCO 4.4.1, Table 4.4-3. Reportable per Technical Specification AC 7.5.2(b)1 and AC 7.5.2(b)2. No effect on public health or safety. Redundant system available and operable. Similar reports RO 77-47 and RO 78-27.

0 7

0 8

09		SYSTEM CODE		CAUSE CODE		CAUSE SUBCODE		COMPONENT CODE				COMP. SUBCODE		E CODE									
7	8	C	B	11	E	12	E	13	I	N	S	T	R	U	14	S	15	Z	16				
17		EVENT YEAR		SHUTDOWN METHOD		SEQUENTIAL REPORT NO.		OCCURRENCE CODE		REPORT TYPE		REVISION NO.											
LER/RO REPORT NUMBER		7	9	21	22	23	0	3	2	24	25	26	27	0	3	28	29	X	30	31	1	32	
ACTION TAKEN		FUTURE ACTION		EFFECT ON PLANT		HOURS		ATTACHMENT SUBMITTED		NPRD-4 FORM SUB.		PRIME COMP. SUPPLIER		COMPONENT MANUFACTURER									
X	18	X	19	Z	20	Z	21	0	0	0	0	22	Y	23	N	24	N	25	B	0	8	0	26
33	34	35	36	37	38	39	40	41	42	43	44	45	46	47									

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)

1 0 ITT Barton Model 289 pressure differential switches failed to actuate at trip point

1 1 due to dirt accumulation in electrical switches. Affected switches readjusted to

1 2 proper trip points. Trip settings being checked on a monthly basis. Problem under

1 3 investigation.

1 4 7 8 80

1 5 E 28 0 0 0 29 N/A C 31 Operability Test

ACTIVITY CONTENT
RELEASED OF RELEASE AMOUNT OF ACTIVITY (35) LOCATION OF RELEASE (36)

1 6 Z 33 Z 34 N/A N/A

PERSONNEL EXPOSURES									
NUMBER			TYPE	DESCRIPTION					
1	7	0	0	0	(37)	Z	(38)	N/A	(39)

PERSONNEL INJURIES	
NUMBER	DESCRIPTION (41)
000 (40)	N/A

1		2		3		4		5		6		7		8		9		10		11		12												
LOSS OF OR DAMAGE TO FACILITY																																		
TYPE		DESCRIPTION																																
1	9	Z	42	N/A																				43	1271 344									

7911060 48/

ISSUED DESCRIPTION (45)

(2) (0) (N) (44) N/A

NRC USE ONLY

NAME OF PREPARER

J. W. Gahm

PHONE: (303) 785-2253

NRC USE ONLY

7911060 48/

1271 344

OCCURRENCE REPORT DISTRIBUTION

	<u>Number of Copies</u>	
Department of Energy - - - - - San Francisco Operations Office Attn: California Patent Group 1333 Broadway Oakland, California 94612	1	(P Letter)
Department of Energy - - - - - Office of Nuclear Engineering Programs Washington, D.C. 20545	1	(P Letter)
Department of Energy - - - - - Nuclear Reactor Programs Branch Nuclear Power Development Division Main Stop F309 Washington, D.C. 20545	1	(P Letter)
Department of Energy - - - - - Attn: Senior Program Coordinator P. O. Box 81325 San Diego, California 92138	1	(P Letter)
Mr. Karl V. Seyfrit, Director - - - - - Region IV Office of Inspection and Enforcement Nuclear Regulatory Commission 611 Ryan Plaza Drive Suite 1000 Arlington, Texas 76012	1	(Original of P Letter and Copy of LER)
Director - - - - - Office of Management Information and Program Control U. S. Nuclear Regulatory Commission Washington, D.C. 20555	1	(P Letter, LER)
W. M. Hawkins, Site Manager - - - - - General Atomic Company P. O. Box 426 Platteville, Colorado 80651	10	(Original of FPLG Letter plus Two Copies, One Copy of P Letter, One Copy of LER)
NRC Resident Site Inspector - - - - -	1	(P Letter, LER)

1271 345