

## LICENSEE EVENT REPORT

CONTROL BLOCK: 1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

(PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

0 1 M D C C N 1 2 0 0 - 0 0 0 0 0 0 - 0 0 3 4 1 1 1 1 1 4 5  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

CON'T

0 1 REPORT SOURCE L 6 0 5 0 0 0 3 1 1 7 7 0 8 0 6 7 9 8 0 8 3 1 1 7 9 9  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES 10

0 2 At 0845, 12 charging pump was placed out of service because of pump trips due to

0 3 low suction pressure and unsuccessful attempts to restart the pumps and maintain

0 4 it in operation. Placing this pump out of service reduced the number of operable

0 5 charging pumps to one (as number 11 charging pump was isolated because of a packing

0 6 leak). #11 charging pump was repaired and placed back into service at 1530 on 8/6/79,

0 7 bringing the number of operable pumps to two as required by T.S.3.1.2.4. #13

0 8 charging pump remained operable during event. This is not a repetitive occurrence.

7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

0 9 SYSTEM CODE P C 11 CAUSE CODE E 12 CAUSE SUBCODE F 13 COMPONENT CODE I N S T R U 14 COMP. SUBCODE E 15 VALVE SUBCODE Z 16

17 LER NO REPORT NUMBER 7 9 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

ACTION TAKEN A 18 FUTURE ACTION Z 19 EFFECT ON PLANT Z 20 SHUTDOWN METHOD Z 21 HOURS 0 0 0 0 22 ATTACHMENT SUBMITTED N 23 NPD-4 FORM SUB. N 24 PRIME COMP. SUPPLIER A 25 COMPONENT MANUFACTURER A 5 0 1 26

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS 27

1 0 #12 charging pump low suction pressure trips were cause by a faulty pressure

1 1 indicating switch: 1-PC-224Y. This Ashcroft model 1379 TAXEF was repaired by

1 2 replacement of gauge internals which were worn. This is being considered as an

1 3 isolated failure and no further corrective action is to be taken.

7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

1 5 FACILITY STATUS E 28 % POWER 0 8 7 29 OTHER STATUS NA 30 METHOD OF DISCOVERY A 31 DISCOVERY DESCRIPTION Operator Observation 32

1 6 ACTIVITY CONTENT RELEASED OF RELEASE Z 33 Z 34 AMOUNT OF ACTIVITY NA 35 LOCATION OF RELEASE NA 36

1 7 PERSONNEL EXPOSURES NUMBER 0 0 0 37 TYPE Z 38 DESCRIPTION NA 39

1 8 PERSONNEL INJURIES NUMBER 0 0 0 40 DESCRIPTION NA 41

1 9 LOSS OF OR DAMAGE TO FACILITY TYPE Z 42 DESCRIPTION NA 43

2 0 PUBLICITY ISSUED Z 44 DESCRIPTION NA 45

2 1 NAME OF PREPARER R. P. Heibel/P. G. Rizzo

NAME OF PREPARER R. P. Heibel/P. G. Rizzo

PHONE (301) 234-7942/7986

NRC USE ONLY

POOR  
ORIGINAL

7909140 444

343360