

## LICENSEE EVENT REPORT

CONTROL BLOCK: 

--	--	--	--	--	--

 ①

(PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

1	I	L	D	R	95	2	0	0	-	0	0	0	0	-	0	0	3	4	1	1	1	1	4	5	
8	9	LICENSEE CODE				14	15	LICENSE NUMBER								25	26	LICENSE TYPE				30	57	CAT	58

N'T

REPORT SOURCE 1 6 0 5 0 0 0 2 3 7 7 0 5 0 1 7 9 8 0 5 3 0 7 9 9

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (10)

2 | IRM's 17 and 18 in the "A" trip system were found downscale during rod pulls to heat-  
3 | ing power. Since T.S. Table 3.1.1 requires three operable instrument channels per  
4 | trip system, operator immediately initiated a manual half-scam. Event had minimal  
5 | safety significance since remaining two channels in the "A" trip system were operable.  
6 | No effect on public health or safety.  
7 |  
8 |

9	SYSTEM CODE		CAUSE CODE		CAUSE SUBCODE		COMPONENT CODE				COMP. SUBCODE		VALVE SUBCODE										
8	I	A	11	E	12	A	13	I	N	S	T	R	U	14	X	15	Z	16					
	9	10	11	12	13	14	15	16	17	18	19	20											
17	LER/RO REPORT NUMBER		EVENT YEAR		SEQUENTIAL REPORT NO.		OCCURRENCE CODE		REPORT TYPE		REVISION NO.												
	7	9	21	22	23	0	3	2	24	25	0	3	26	27	L	28	29	30	31	32			
ACTION TAKEN		FUTURE ACTION		EFFECT ON PLANT		SHUTDOWN METHOD		HOURS		ATTACHMENT SUBMITTED		NPRD-4 FORM SUB.		PRIME COMP. SUPPLIER		COMPONENT MANUFACTURER							
A	18	Z	19	C	20	Z	21	0	0	0	0	N	22	Y	23	N	24	25	G	0	8	0	26
33	34	35	36	37	38	39	40	41	42	43	44	45	46	47	48	49	50	51	52	53	54	55	56

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)

IRM 17 failed because of a faulty connector, due to apparent minor damage during re-fueling. Connector was replaced and tested satisfactorily. IRM 18 had a loose input preamp connector. It was tightened and the downscale alarm cleared. This was the first occurrence of this type on Unit 2. IRM's will continue to be tested monthly using surveillance DIS 700-4.

FACILITY STATUS (5) C (28) 8 9 10 11 12 13 14  
 % POWER 0 0 0 29 10 11 12 13 14  
 OTHER STATUS (30) 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44  
 METHOD OF DISCOVERY (A) (31) 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60  
 DISCOVERY DESCRIPTION (32) 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80  
 ACTIVITY CONTENT RELEASED OF RELEASE (6) Z (33) 8 9 10 11 12 13 14  
 AMOUNT OF ACTIVITY (35) 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44  
 LOCATION OF RELEASE (36) 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60

PERSONNEL EXPOSURES				DESCRIPTION	
NUMBER	TYPE	DESCRIPTION			
7	000	37	Z	38	NA

PERSONNEL INJURIES				2266 229	
NUMBER			DESCRIPTION		
0	0	0	(40)	NA	

LOSS OF OR DAMAGE TO FACILITY		DESCRIPTION		43	
TYPE		DESCRIPTION			
9	Z	42	NA	7906050248 S	
8	9	10			

PUBLICITY (45)  
ISSUED (1) N (1) NA DESCRIPTION (45)  
NRC USE ONLY

NFC USE ONLY

NAME OF PREPARER P. Holland

PHONE: X-421