

1 A L J M F 1 2 0 0 - 0 0 0 0 0 0 - 0 0 3 4 1 1 1 1 4 5  
8 9 LICENSEE CODE 14 15 LICENSE NUMBER 25 26 LICENSE TYPE 30 57 CAT 58

CN'T

1 REPORT SOURCE L 6 0 5 0 0 0 3 4 8 7 0 5 2 9 8 1 8 0 6 3 0 8 1 9  
8 60 61 DOCKET NUMBER 68 69 EVENT DATE 74 75 REPORT DATE 80

## EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (10)

2 At 2235 on 5-29-81, diesel generator 1-2A was declared inoperable as a result of its  
3 being incapable of auto-starting due to the mode selector switch being placed in Mode 3.  
4 Tech. Spec. 3.8.1.1, in part, requires D.G. 1-2A to be operable. Tech. Spec. 3.8.1.1  
5 action statement requirements were met. Health/safety of the public was not affected.  
6 (Note: This LER is applicable to both Units 1 and 2 at FNP.)

9 SYSTEM CODE CAUSE CODE CAUSE SUBCODE COMPONENT CODE COMP. SUBCODE VALVE SUBCODE  
E E 11 A 12 A 13 ENGINE 14 Z 15 Z 16  
9 10 11 12 13 18 19 20  
17 LER/RO REPORT NUMBER EVENT Y 8 1 21 22 SEQUENTIAL REPORT NO. 0 4 0 23 OCCURRENCE CODE 0 3 28 29 REPORT TYPE L 30 REVISION NO. 0 32  
ACTION TAKEN FUTURE ACTION EFFECT ON PLANT SHUTDOWN METHOD HOURS 22 ATTACHMENT SUBMITTED Y 23 NPRD-4 FORM SUB. N 24 PRIME COMP. SUPPLIER A 25 COMPONENT MANUFACTURER F 0 1 0 26  
33 34 35 36 37 40 41 42 43 44 47

## CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)

0 At approximately 1200 on 5-29-81, the 1-2A D.G. was being run for preventative main-  
1 tenance purposes when it was noted that the lube oil strainer differential pressure had  
2 reached the value normally used as a guideline for cleaning the strainer. The plant  
3 operator was instructed by the Shift Supervisor to shut down the D.G. The plant operator  
4 assumed the D.G. was to be removed from service at the time of shutdown for cleaning

5 FACILITY STATUS E 28 % POWER 0 2 1 29 OTHER STATUS 30 N/A METHOD OF DISCOVERY A 31 Shift Supervisor Observation  
8 9 10 11 12 13 44 45 46 80  
6 ACTIVITY CONTENT RELEASED OF RELEASE Z 33 Z 34 AMOUNT OF ACTIVITY 35 N/A LOCATION OF RELEASE 36 N/A  
8 9 10 11 12 13 44 45 80  
7 PERSONNEL EXPOSURES NUMBER TYPE DESCRIPTION 39 0 0 0 37 Z 38 N/A  
8 9 10 11 12 13 44 45 80  
8 PERSONNEL INJURIES NUMBER DESCRIPTION 41 0 0 0 40 N/A  
8 9 10 11 12 13 44 45 80  
9 LOSS OF OR DAMAGE TO FACILITY TYPE DESCRIPTION 43 Z 42 N/A  
8 9 10 11 12 13 44 45 80  
0 PUBLICITY ISSUED DESCRIPTION 45 N/A  
8 9 10 11 12 13 44 45 80  
10 N 44 N/A  
8 9 10 11 12 13 44 45 80

NAME OF PREPARER W. G. Hairston, III

PHONE: [205] 899-5156

NRC USE ONLY

LER 81-040/03L-0 (6-30-81)

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (Continued)

the strainer; therefore, the plant operator placed the mode selector switch in Mode 3. The Shift Supervisor had intended to simply stop the D.G. and clean the strainer in a routine manner. During the shift turnover, the on-coming Shift Supervisor observed the position of the mode selector switch and it was placed in Mode 1 and D.G. 1-2A was returned to service at 2300 on 5-29-81. Individuals involved have been counseled regarding this event in order to prevent recurrence.