

(PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

CONT

0	1
---	---

REPORT SOURCE

L	6	0	5	0	0	0	2	6	0	7	0	7	2	0	8	1	8	0	8	0	7	8	1	9
---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---

DOCKET NUMBER

EVENT DATE

REPORT DATE

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (10)

SYSTEM CODE CAUSE CODE CAUSE SUBCODE COMPONENT CODE COMP. SUBCODE VALVE SUBCODE
 C E 11 E 12 B 13 H T E X C H 14 Z 15 Z 16
 9 10 11 12 13 14 15 16 17 18 19 20

17 LER/RO REPORT NUMBER		EVENT YEAR 8 1		23		24 SEQUENTIAL REPORT NO. 0 3 9		27		28 OCCURRENCE CODE 0 3		29		30 REPORT TYPE L		31		32 REVISION NO. 0	
ACTION TAKEN A 18 X 19		FUTURE ACTION		EFFECT ON PLANT Z 20		SHUTDOWN METHOD Z 21		HOURS 0 0 0 0 22		ATTACHMENT SUBMITTED Y 23		NPRD-4 FORM SUB. Y 24		PRIME COMP. SUPPLIER L 25		COMPONENT MANUFACTURER G 2 1 C			

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)

0 1

ACTIVITY CONTENT

PERSONNEL EXPOSURES

8108130191 810807
Gene Holder

LER SUPPLEMENTAL INFORMATION

BFRO 50-260 / 81039 Technical Specification Involved 3.5.E.1

Reported Under Technical Specification 6.7.2.b(2) Date due NRC: 8/19/81

Date of Occurrence 7/20/81 Time of Occurrence 1410 Unit 2

Identification and Description of Occurrence:

While performing SI 4.2.A-3 the HPCI gland seal condenser upper head gasket began leaking. The HPCI was removed from service to replace the gasket.

Conditions Prior to Occurrence:

Unit 1 in refueling outage.

Unit 2 at 98%.

Unit 3 at 97%.

Action specified in the Technical Specification Surveillance Requirements not due to inoperable equipment. Describe.

Requirements of T.S. 3.5.E.2 were met.

Apparent Cause of Occurrence:

Overpressurizing tube side of HPCI gland seal condenser.

Analysis of Occurrence:

There was no danger to the health or safety of the public, no release of activity, no damage to the plant or equipment, and no resulting significant chain of events.

Corrective Action:

Replaced upper head gasket. A DCR has been written to replace the discharge check valve to solve this problem. Instrumentation will be installed to monitor piping pressures to determine cause of overpressurization.

Failure Data: BFRO-50-260/74016W, 74017W, 74024W, 81021; 296/81019.

Attention: Period - Lifetime; Responsibility - Document Control Supervisor

*Revision: 