

LICENSEE EVENT REPORT

CONTROL BLOCK: 1

(PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

01 N Y I P S 2 0 0 - 0 0 0 0 - 0 0 3 4 1 1 1 1 4 5

LICENSEE CODE

LICENSE NUMBER

LICENSE TYPE

CAT 58

CON'T

REPORT
SOURCE

L 6 0 5 0 0 0 2 4 7 7 0 7 0 5 8 1 8 0 4 8 1 9

DOCKET NUMBER

EVENT DATE

REPORT DATE

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES 10

02 During a routine check of the crankcase oil level on No. 23 Diesel
03 Generator, water was found in the crankcase. The water resulted from
04 a leak in the lube oil cooler. The generator was removed from service.
05 Probable consequences would have been loss of the diesel generator due
06 to loss of lubrication and subsequent bearing failure. Since Nos. 21
07 and 22 Diesel Generators were available there was not adverse effect
08 on unit reliability.

09 L E 11 E 12 B 13 E N G I N E 14 Z 15 Z 16

17 LER/RO REPORT NUMBER 8 1 - 0 1 6 0 3 L - 0

ACTION TAKEN B 18 Z 19 Z 20 Z 21 0 0 0 0 N 23 Z 24 Z 25 Z 26

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS 27

10 During a routine check No. 23 Diesel Generator water was found to be
11 leaking from the lube oil cooler into the lube oil. An operability check
12 showed Nos. 21 and 22 Diesel Generators to be available. The leaking
13 tube was plugged and the lubricating oil was changed. Following repairs
14 No. 23 Diesel Generator was retested and met the acceptance criteria.

15 E 28 1 1 0 0 N/A B 31 R o u t i n e O i l L e v e C h e c k

16 Z 33 Z 34 N/A N/A

17 0 0 0 Z 38 N/A

18 0 0 0 N/A

19 Z 42 N/A

20 N/A

8108140372 810804
PDR ADOCK 05000247
S PDR

NRC USE ONLY

(914) 526-5182

NAME OF PREPARER

Malcom C. Smith

PHONE