

(PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

100

Event Description and Probable Consequences (cont'd)

and 2 RCS subcooling margin monitors to be operable. Tech. Spec. 3.4.4, in part, requires 2 groups of pressurizer heaters to be operable. Tech. Spec. 3.2.5, in part, requires the pressurizer pressure to be greater than or equal to 2220 psia. Tech. Spec. action statement requirements were met. Health/safety of the public was not affected.

Cause Description and Corrective Actions (cont'd)

state condition by the operators taking manual control of the affected control loops. The short to ground was corrected, the pressurizer heaters were energized, the pressurizer level restored and the pressurizer pressure returned to a value within the Tech. Spec. limit at 0754 on 7/18/81. Personnel involved have been instructed to calibrate their equipment prior to connecting the instrument channels.