

LICENSEE EVENT REPORT

CONTROL BLOCK:

--	--	--	--	--	--

 (1)

(PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

0	1	M I D C C 2												0	0	0	0	0	0	0	0	0	0	0	0	3	4	1	1	1	1	4			5																	
7	8	LICENSEE CODE												14	LICENSE NUMBER												25	LICENSE TYPE												30	CAT 58											

CON'T

REPORT
SOURCE

60 61 DOCKET NUMBER 68 69 EVENT DATE 74 75 REPORT DATE 80

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (10)

0 2 DURING NORMAL OPERATION, WHILE PERFORMING A SURVEILLANCE TEST, A CONTAINMENT PRESSURE

0 3 HIGH-HIGH BISTABLE WAS FOUND TO TRIP AT A VALUE EQUIVALENT TO 3.1 PSIG ON TWO OCCAS-

0 4 SIONS, 07-28-81 and 07-29-81. THIS IS NON-CONSERVATIVE IN RESPECT TO T.S. TABLE

0 5 3.3-4 ITEM 2.C. (3.0 PSIG). THE APPROPRIATE ACTION REQUIREMENTS WERE FULFILLED.

0 6 PREVIOUS OCCURRENCES OF A SIMILAR NATURE INCLUDE: 050-316/80-31; 79-07 AND 22.

0	9	8	I	B	11	E	12	E	13	I	N	S	T	R	U	14	S	15	Z	16		
			EVENT YEAR		SEQUENTIAL REPORT NO.		OCCURRENCE CODE		REPORT TYPE		REVISION NO.											
LER RD. REPORT NUMBER			8	1	—	0	3	7	—	0	3	L	—	0								
			21	22	23	24	25	26	27	28	29	30	31	32								
ACTION TAKEN		FUTURE ACTION		EFFECT ON PLANT		SHUTDOWN METHOD		HOURS		ATTACHMENT SUBMITTED		NPRD-4 FORM SUB.		PRIME COMP. SUPPLIER		COMPONENT MANUFACTURER						
E	18	Z	19	Z	20	Z	21	0	0	0	0	Y	23	Y	24	N	25	F	1	8	0	26
33	34	35	36	37	38	39	40	41	42	43	44	45	46	47	48	49	50	51	52	53	54	

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)

1 1 0 AFTER RECALIBRATING THE BISTABLE ON 07-28-81, A RETEST ON 07-29-81 ALSO FOUND THE
1 1 1 BISTABLE ACTUATION POINT TO EXCEED THE L.C.O. VALUE. THE BISTABLE (FOXBORO 63U-BC-
1 1 2 OHEA-F) WAS EXERCISED, RECALIBRATED AND RETURNED TO SERVICE. ADDITIONAL CHECKS WERE
1 1 3 PERFORMED ON 07-30-81 AND 07-31-81 WITH NO INSTRUMENT DRIFT INDICATED. ANOTHER CHECK
1 1 4 WAS PERFORMED ON 08-19-81, THE BISTABLE ACTUATION (SEE ATTACHED SUPPLEMENT)

FACILITY STATUS % POWER OTHER STATUS METHOD OF DISCOVERY DISCOVERY DESCRIPTION

(1) (2) E (28) 1 0 0 (29) NA B (31) SURVEILLANCE TEST (32)

C 8 3 10 12 13 44 45 46 8

ACTIVITY CONTENT
RELEASED OF RELEASE

1 6 2 3 4 5 6 7 8 9 10 11 12 13 14

NA

AMOUNT OF ACTIVITY (35)

45 60 75 90

LOCATION OF RELEASE (36)

PERSONNEL EXPOSURES									
NUMBER			TYPE	DESCRIPTION					
1	2	3	4	5	6	7	8	9	10
0	0	0	0	37	Z	38	NA		

PERSONNEL INJURIES		NUMBER		DESCRIPTION	
1	2	3	4	5	6
1	2	0	0	0	NA

PUBLICITY
 ISSUED DESCRIPTION (45) NA

NRC USE ONLY

8109030245 810825 J. L. Rischling
PDR ADDCK 05000316
S PDR

PHONE 616-465-5901

0.000

ATTACHMENT TO LER#81-037/03L-0

SUPPLEMENT TO CAUSE DESCRIPTION

SETPOINT DRIFTED IN A CONSERVATIVE DIRECTION AND THE BISTABLE WAS DECLARED INOPERABLE. THE APPROPRIATE ACTION REQUIREMENTS WERE COMPLETED AND THE BISTABLE WAS REPLACED. AFTER BEING CALIBRATED THE NEW BISTABLE WAS PLACED IN SERVICE.