

CONTROL BLOCK:

0	1	N	J	S	C	S	2	(2)	o	o	-	o	o	o	o	o	-	o	o	(3)	4	1	1	1	1	(4)			(5)			
7	8	LICENSEE CODE						14	15	LICENSE NUMBER									25	26	LICENSE TYPE						30	31	32	33	34	35

CONT

0	1
---	---

REPORT SOURCE

1	6	0	5	0	0	0	3	1	1	7	0	8	1	4	8	1	8	0	8	2	8	8	1	9
---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---

60 61 DOCKET NUMBER 66 69 EVENT DATE 74 75 REPORT DATE 80

02 | During the performance of surveillance procedure SP(0)4.8.1.1.2, on August 14, 1981,

03 | 2A diesel generator failed to meet the starting time requirements, ≤ 10 seconds, of

04 | technical specification 3.8.1.1. The starting time was 12 seconds. At 0505 hours,

05 | August 14, 1981, 2A diesel generator was declared inoperable and action statement

06 | 3.8.1.1.a was entered and the provisions of the action statement were complied with.

07 |

08 |

C		P	SYSTEM CODE		E	E	(11)	CAUSE CODE		E	(12)	CAUSE SUBCODE		B	(13)	COMPONENT CODE					M	E	C	F	U	N	(14)	COMP SUBCODE		Z	(15)	VALVE SUBCODE		Z	(16)
7	8		9	10				11				12				13										15									
(17) LER NO REPORT NUMBER		EVENT YEAR		8	1					SEQUENTIAL REPORT NO		0	8	1		OCCURRENCE CODE		0	3		REPORT TYPE		L			REVISION NO		0							
21	22							23			24				26		27				28					30									
ACTION TAKEN		FUTURE ACTION		EFFECT ON P.		SHUTDOWN METHOD				HOURS		(22)	ATTACHMENT SUBMITTED		Y	(23)	NPR-4 FORM SUB		Y	(24)	PRIME COMP. SUPPLIER		L	(25)	COMPONENT MANUFACTURER		Q	0	0	8	(26)				
33	34			35				36			37					40					42					43									
CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)																																			

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)

1 0 The turbo boost air reservoir was down in pre-ure because the hydraulic unloader
1 1 valve on the air compressor was sticking, preventing the compressor from charging
1 2 the reservoir. It was repaired. The compressor was tested satisfactorily and
1 3 returned to service. The surveillance was performed within starting time require-
1 4 ments. At 0742, August 14, 1981, action statement 3.8.1.1.a was terminated.

FACILITY STATUS			% POWER			OTHER STATUS (30)			METHOD OF DISCOVERY		DISCOVERY DESCRIPTION (32)	
1	5	E (28)	0	9	1 (29)	N/A			B (31)	Surveillance Test		
7	8	9	10	11	12	13	14	15	16	17	18	

ACTIVITY CONTENT
RELEASED OF RELEASE AMOUNT OF ACTIVITY (35) LOCATION OF RELEASE (36)

1 6 9 33 2 34 NA NA

7 8 9 10 11 45

PERSONNEL EXPOSURES		NUMBER		TYPE	DESCRIPTION
1	7	0	0	37	2 38 NA

		11		12		13	
		PERSONNEL INJURIES					
		NUMBER		DESCRIPTION			
1	H	0	0	0	40	NA	

9		11		12			
LOSS OF OR DAMAGE TO FACILITY				(43)			
TYPE		DESCRIPTION					
1	9	2	(42)	NA			

7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60

PUBLICITY
ISSUED DESCRIPTION (45)
2 0 [N] (44) NA
S PDR
PDR
NRC USE ONLY

NAME OF PREPARER Frank Dickey

PHONE 609-935-5100

NRC USE ONLY