

LICENSEE EVENT REPORT

CONTROL BLOCK

(PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

0 1 N E C P R 1 2 0 0 - 0 0 0 0 0 0 - 0 0 3 4 1 1 1 1 4 5
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

CONT

0 1 REPORT SOURCE L 6 0 5 0 0 0 2 9 8 7 0 7 2 8 8 1 8 0 8 2 5 8 1 9
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (10)

0 2 During the performance of a surveillance procedure on #2 diesel generator, an injec-
0 3 tor line failed. #2 DG was shut down and declared inoperable. Redundant #1 DG was in-
0 4 operable at the time of this occurrence. Applicable surveillance procedures were com-
0 5 menced per RTS 3.5.F.2 for both DG's being inoperable. This event is not repetitive.
0 6 There were no adverse effects on the public health and safety.
0 7
0 8
0 9

0 9
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

SYSTEM CODE

CAUSE CODE

CAUSE SUBCODE

COMPONENT CODE

COMP. SUBCODE

VALVE SUBCODE

0 9 E E 11 E 12 B 13 E N G I N E 14 Z 15 Z 16
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

LER/RO
REPORT
NUMBER

EVENT YEAR

SEQUENTIAL
REPORT NO.OCCURRENCE
CODEREPORT
TYPEREVISION
NO.

ACTION TAKEN

FUTURE ACTION

EFFECT ON PLANT

SHUTDOWN METHOD

HOURS

ATTACHMENT SUBMITTED

NPRD-4 FORM SUB.

PRIME COMP. SUPPLIER

COMPONENT MANUFACTURER

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)

1 0 Cause of failure of fuel injector supply line is believed to be metal fatigue and vi-
1 1 bration. Piping is heavy wall, SS, 1/2" tubing (3/16" wall thickness). Applicable part
1 2 number is KSV-13-1B. Tubing severed completely near injector compressor fitting. Com-
1 3 ponent was immediately replaced. All fuel injector supply lines on #1 & #2 DG will be
1 4 replaced if dictated by the inspection of individual injector lines.
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

FACILITY STATUS

% POWER

OTHER STATUS

METHOD OF DISCOVERY

DISCOVERY DESCRIPTION

1 5 E 28 0 9 6 29 NA B 31 Surveillance Testing
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

ACTIVITY CONTENT

AMOUNT OF ACTIVITY

LOCATION OF RELEASE

1 6 Z 33 Z 34 NA
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

PERSONNEL EXPOSURES

NUMBER

TYPE

DESCRIPTION

1 7 0 0 0 37 Z 38 NA
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

PERSONNEL INJURIES

NUMBER

DESCRIPTION

1 8 0 0 0 40 NA
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

LOSS OF OR DAMAGE TO FACILITY

TYPE

DESCRIPTION

1 9 Z 42 NA
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

PUBLICITY

NUMBER

DESCRIPTION

2 0 N 44 NA
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

8109150504 810825
PDR ADOCK 05000298
S PDR

NRC USE ONLY

NAME OF PREPARER Scott Freborg

PHONE 402-825-3811