

## 471

(PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

ON'T

0 2 | Unit 1 in Mode 1 at 100% RTP. Ice condenser intermediate deck door in bay 14  
0 3 | was discovered iced over. This event required entry into LCO 3.6.5.3. There  
0 4 | was no effect upon public health or safety. Previous Occurrences - 6 (reference  
2 5 | SQBO-50-327/81073, 81008, 81002, 80205, 80203, and 80170)  
0 6 |  
1 7 |  
1 8 |

9

10 Air handling unit condensate drain pan heater mat failed and subsequent defrost  
11 cycles allowed the drain pan to ice over. During later defrost cycles, water  
12 spilled from the frozen drain pan onto the door. The heater mat was replaced  
13 and the ice removed from the door. The door was returned operable within nine (9)  
14 hours.

1