

LICENSEE EVENT REPORT

EXHIBIT A

CONTROL BLOCK: 1 (PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

0 1 N C M G S 4 0 0 - 0 0 0 0 0 - 0 0 0 4 1 1 1 1 4 5
7 8 9 LICENSEE CODE 14 15 LICENSE NUMBER 25 26 LICENSE TYPE 29 30 CAT 34

CONT
0 1 REPORT SOURCE L 5 0 5 0 0 0 3 6 9 7 0 8 2 1 8 1 8 0 9 1 8 8 3
7 8 9 10 DOCKET NUMBER 11 12 EVENT DATE 13 14 REPORT DATE 15

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES 10

0 2 While in mode 2, the radiation monitor for the Control Room outside air intake,
0 3 (EMF-43A) was declared inoperable due to periodic, spurious alarms. This vio-
0 4 lates T.S. 3.3.3.1 which is reportable pursuant to T.S. 6.9.1.13(b). Because of
0 5 the availability of the redundant EMF-43B monitor, in addition to no radioac-
0 6 tive gaseous waste releases being made just prior to or at the time of this in-
0 7 cident, neither the safe operation of the plant nor the health and safety of the
0 8 public were affected.
7 8 9

0 9 SYSTEM CODE CAUSE CODE CAUSE SUBCODE COMPONENT CODE COMP SUBCODE VALVE SUBCODE
B B 11 X 12 Z 13 I N S T R U 14 E 15 Z 16
7 8 9 10 11 12 13 14 15 16

17 LER/RO REPORT NUMBER 18 19 EVENT YEAR 20 21 SEQUENTIAL REPORT NO. 22 23 OCCURRENCE CODE 24 25 REPORT TYPE 26 27 REVISION NO. 28
A 18 Z 19 8 1 20 1 4 3 21 0 3 22 L 23 0
7 8 9 10 11 12 13 14 15 16 17 18

ACTION TAKEN 19 Z 20 EFFECT ON PLANT 21 SHUTDOWN METHOD 22 HOURS 23 ATTACHMENT SUBMITTED 24 NPROW ACRMSUB 25 PRIME COMP. SUPPLIER 26 COMPONENT MANUFACTURER
A 19 Z 20 Z 21 0 0 0 0 22 N 23 N 24 L 25 G 0 6 3 26
7 8 9 10 11 12 13 14 15 16 17 18 19 20

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS 27

1 0 Examination of the monitor found that its vacuum pump had tripped off, appar-
1 1 ently caused by high system vacuum. The alarms were apparently caused by dirt
1 2 accumulation on the monitor's pre-filter, attributable to a greater number of
1 3 personnel entering the Control Room recently due to plant start-up. The filter
1 4 was changed, the instrument calibrated, and a channel functional test performed.
7 8 9

1 5 FACILITY STATUS 16 % POWER 17 OTHER STATUS 18 METHOD OF DISCOVERY 19 DISCOVERY DESCRIPTION 20
X 15 0 0 0 0 16 Mode 2 17 A 18 Annunciator
7 8 9 10 11 12 13 14 15 16

1 5 ACTIVITY RELEASED OF RELEASE 16 CONTENT 17 AMOUNT OF ACTIVITY 18 LOCATION OF RELEASE 19
Z 15 Z 16 N/A 17 N/A 18
7 8 9 10 11 12 13 14 15 16

1 7 PERSONNEL EXPOSURES 18 NUMBER 19 TYPE 20 DESCRIPTION 21
0 0 0 17 Z 18 N/A
7 8 9 10 11 12 13 14 15 16

1 8 PERSONNEL INJURIES 19 NUMBER 20 DESCRIPTION 21
0 0 0 18 N/A
7 8 9 10 11 12 13 14 15 16

1 9 LOSS OF OR DAMAGE TO FACILITY 20 TYPE 21 DESCRIPTION 22
Z 19 N/A
7 8 9 10 11 12 13 14 15 16

2 0 PUBLICITY 21 ISSUE 22 DESCRIPTION 23
N 20 N/A
7 8 9 10 11 12 13 14 15 16

NRC USE ONLY

NAME OF PREPARER Phillip B. NardociPHONE: (704) 373-74328109240592 810918
PDR ADOCK 05000369
S PDR