

LICENSEE EVENT REPORT

CONTROL BLOCK:

1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28	29	30	31	32	33	34	35	36	37	38	39	40	41	42	43	44	45	46	47	48	49	50	51	52	53	54	55	56	57	58	59	60	61	62	63	64	65	66	67	68	69	70	71	72	73	74	75	76	77	78	79	80
---	---	---	---	---	---	---	---	---	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----

(PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

0	1	M	D	C	C	N	1	2	0	0	-	0	0	0	0	0	0	0	0	3	4	1	1	1	1	4			5
---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	--	--	---

7 8 9 14 15 25 26 30 57 CAT 58

CON'T

0	1	L	6	0	5	0	0	0	3	1	7	7	0	5	2	4	8	3	8	0	6	2	3	8	3	9
---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---	---

7 8 60 61 68 69 74 75 80

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (10)

0 2 | During normal operation, surveillance testing indicated neither 11 nor 12

0 3 | spent fuel pool exhaust fans would maintain the required negative press-

0 4 | ure in the spent fuel pool area (T.S. 4.9.12.d.2). The fans were declared

0 5 | operable on 6/7/83 after replacing the HEPA and the roughing filters.

0 6 | While the fans were inoperable no fuel was moved and no loads were moved

0 7 | over irradiated fuel in the spent fuel pool. Similar events: None

0 8 |

0	9	A	A	11	X	12	Z	13	F	I	L	T	E	R	14	Z	15	Z	16	17	8	3	0	2	9	0	3	L	0	A	18	Z	19	Z	20	Z	21	0	0	0	0	N	23	N	24	A	25	A	2	2	0	26
---	---	---	---	----	---	----	---	----	---	---	---	---	---	---	----	---	----	---	----	----	---	---	---	---	---	---	---	---	---	---	----	---	----	---	----	---	----	---	---	---	---	---	----	---	----	---	----	---	---	---	---	----

7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)

1 0 | The clogged HEPA filters contributed to this event. Negative pressure

1 1 | was .1 inch w.c. versus required .125 inch w.c., filter flow remained

1 2 | within T.S. limits. Filters were replaced, resulting in negative pres-

1 3 | sure of .13 inch w.c. Engineering review of system design for maintain-

1 4 | ing required negative pressure is in progress, update report to follow.

1	5	E	28	1	0	0	29	NA	B	31	Surveillance Testing	32
---	---	---	----	---	---	---	----	----	---	----	----------------------	----

7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80

1	6	Z	33	Z	34	NA	NA	35	36
---	---	---	----	---	----	----	----	----	----

7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80

1	7	0	0	0	37	Z	38	NA	39
---	---	---	---	---	----	---	----	----	----

7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80

1	8	0	0	0	40	NA	41
---	---	---	---	---	----	----	----

7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80

1	9	Z	42	NA	43
---	---	---	----	----	----

7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80

2	0	N	44	NA	45
---	---	---	----	----	----

7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80

NAME OF PREPARER P. Pieringer/J. Raynor

PHONE 301-269-4742/4713

8307110456 830623
PDR ADOCK 05000317
S PDR

NRC USE ONLY

BALTIMORE GAS AND ELECTRIC COMPANY

P.O. BOX 1475

BALTIMORE, MARYLAND 21203

NUCLEAR POWER DEPARTMENT
CALVERT CLIFFS NUCLEAR POWER PLANT
LUSBY, MARYLAND 20657

June 23, 1983

Dr. Thomas Murley
Regional Administrator
U.S. Nuclear Regulatory Commission
Region I
631 Park Avenue
King of Prussia, PA 19406

Docket No. 50-317
License No. DPR-53

Dear Dr. Murley:

In accordance with Technical Specification 6.9 please find the attached thirty day report for LER 83-29/3L.

Should you have any questions regarding this report, we would be pleased to discuss them with you.

Very truly yours,

LBR
L. B. Russell
Plant Superintendent

LBR:JWR:mlk

cc: Director, Office of Management Information
and Program Control

Messrs: A. E. Lundvall, Jr.
J. A. Tiernan

IE22
111