

CONTROL BLOCK:

--	--	--	--	--	--

 (1) (PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

CON'T

0	1
7	8

REPORT SOURCE

L	6	0	5	0	0	0	2	5	9	7	0	8	2	3	8	2	8	0	9	2	1	8	2	9
60	61	DOCKET NUMBER					68	69	EVENT DATE					74	75	REPORT DATE					80			

0 2 | During normal operation while performing SI 4.11.A.1.g. Building Hydraulic

0 3 | Performance Verification, it was determined that unit 1, Station II cable tray

0 4 | fixed spray system did not meet technical specification requirements as shown in

0 5 | Table 3.11.A. There was no effect on public health and safety. A firewatch was

0 6 | established per T.S. 3.11.A.2 for about 18 hours. There are no redundant systems.

0 7 |

0 8 |

7 8 9

SYSTEM CODE 0 9		CAUSE CODE A B		CAUSE SUBCODE X		COMPONENT CODE Z F I L T E R						COMP. SUBCODE Z		VALVE SUBCODE Z	
7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22
LER/RO REPORT NUMBER 17		EVENT YEAR 8 2		SEQUENTIAL REPORT NO. 0 6 4		OCCURRENCE CODE 0 3		REPORT TYPE L		REVISION NO. 0		ACTION TAKEN X		FUTURE ACTION X	
23	24	25	26	27	28	29	30	31	32	33	34	35	36	37	38
SHUTDOWN METHOD Z		HOURS 0 0 0 0		ATTACHMENT SUBMITTED Y		NPRD-4 FORM SUB. N		PRIME COMP. SUPPLIER L		COMPONENT MANUFACTURER F 1 3 5		EFFECT ON PLANT Z		REVISION NO. 0	
39	40	41	42	43	44	45	46	47	48	49	50	51	52	53	54

1 0 Cause was an apparent restriction in the supply line strainer (Fisher Governor Fre-Flo
1 1 260C). A patrolling firewatch was established in accordance with T.S. 3.11.A.2.
1 2 The strainer was cleaned and flushed and the system retested. Test for this
1 3 station will be performed within 18 months to determine any further change in
1 4 performance.

FACILITY STATUS				% POWER				OTHER STATUS				METHOD OF DISCOVERY				DISCOVERY DESCRIPTION			
1	5	F	28	0	9	6	29	NA				B	31	Surveillance test					
ACTIVITY CONTENT				AMOUNT OF ACTIVITY				LOCATION OF RELEASE											
1	6	7	33	7	34	NA				NA									
PERSONNEL EXPOSURES				PERSONNEL INJURIES				LOSS OF OR DAMAGE TO FACILITY				PUBLICITY							
NUMBER				TYPE				DESCRIPTION				ISSUED							
1	7	0	0	0	17	2	38	0	0	0	40	2	42	N		44			
DESCRIPTION				DESCRIPTION				DESCRIPTION				DESCRIPTION							
NA				NA				8209300070 820921 PDR ADOCK 05000259 S PDR				NRC USE ONLY							

PHONE: (205) 729-0838

LER SUPPLEMENTAL INFORMATION

BFRO-50- 259 / 82064 Technical Specification Involved 3.11.A.9

Reported Under Technical Specification 6.7.2.b.(2) Date Due NRC 09/22/82

Event Narrative:

Unit 2 was in a refueling outage; unit 3 was operating at 95-percent power. Units 2 and 3 were unaffected by this event. With unit 1 operating at 96-percent power, during the performance of surveillance instruction (SI) 4.11.A.1.g, Building Hydraulic Performance Verification, it was determined the Station II cable tray fixed spray system did not meet technical specification requirements as shown in Table 3.11.A. There was no effect on public health and safety. A patrolling firewatch was established in accordance with Technical Specifications 3.11.A.2. There are no redundant systems.

The strainer (Fisher Governor Co., Fre-Flo 260C) to this station was removed, cleaned, and flushed and the station retested and found to meet technical specification requirements. This station will therefore be retested within 18 months (technical specification frequency is once/3 years) in order to determine any further changes in performance.

* Previous Similar Events:

NONE

Retention: Period - Lifetime; Responsibility - Document Control Supervisor

*Revision: JRP