

(PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

0	1	N C M G S 1												2	0	0	0	0	0	0	0	0	0	0	3	4	1	1	1	1	4			5									
7	8	L I C E N S E C O D E												14	L I C E N S E N U M B E R												15	L I C E N S E T Y P E												30	C A T		58

CON'T

0 1 REPORT SOURCE L (6) 0 5 0 0 0 3 6 9 (7) 0 9 2 2 8 2 (8) 1 0 2 2 8 2 (9)

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (10)

0 2 While in mode 1, motor control center (MCC) 1EMXD lost power due to an automatic
0 3 overcurrent trip of its feeder breaker. The loss of 1EMXD resulted in several
0 4 essential systems/components being temporarily inoperable due to loss of power.
0 5 This violates TS's 3.6.5.6; 3.6.4.2; 3.6.1.8; 3.3.3.9; 3.3.3.1; 3.4.5; and 3.6.4.
0 6 3 which are reportable pursuant to T.S.6.9.1.13(b) and (d). Because of the avail-
0 7 ability of redundant systems/components and the brief duration of the power loss
0 8 (8 minutes), health and safety of the public were unaffected.

SYSTEM CODE		CAUSE CODE	CAUSE SUBCODE	COMPONENT CODE				COMP. SUBCODE	VALVE SUBCODE				
0	9	E	B	X	Z	C	K	T	B	R	K	A	Z
7	8	9	10	11	12	13	14	15	16	17	18	19	20
LER/RO REPORT NUMBER		EVENT YEAR	SEQUENTIAL REPORT NO.	OCCURRENCE CODE		REPORT TYPE		REVISION NO.					
17	8	2	0	7	1	0	3	L	0				
21	22	23	24	25	26	27	28	29	30	31	32		
ACTION TAKEN	FUTURE ACTION	EFFECT ON PLANT	UTDOWN METHOD	HOURS	ATTACHMENT SUBMITTED	NPRD-4 FORM SUB.	PRIME COMP. SUPPLIER	COMPONENT MANUFACTURER					
E	F	Z	Z	0	0	0	Y	N	L	I	2	0	2
33	34	35	36	37	38	39	40	41	42	43	44	45	46

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)

1 0 Discussions with operators on duty and review of the alarm typer printout revealed

1 1 no equipment operation that could have caused the trip. Measurements of the feeder

1 2 breaker load currents revealed no cause for the trip, and a spurious trip is

1 3 suspected. The breaker was reset and closed, restoring power to 1EMXD. The trip

1 4 terminals of the Power Shields on the 600 VAC essential auxiliary power system

7 8 will be modified to protect the SCR from transients. 90

FACILITY STATUS		% POWER	OTHER STATUS	METHOD OF DISCOVERY	DISCOVERY DESCRIPTION							
1	5	E	28	0	7	5	29	N/A	A	31	Alarms	32

ACTIVITY CONTENT RELEASED OF RELEASE AMOUNT OF ACTIVITY (35) LOCATION OF RELEASE (36)

1 6 Z (33) Z (34) N/A N/A

PERSONNEL EXPOSURES			39	
NUMBER	TYPE	DESCRIPTION		
1 7	0 0 0 (37) Z (38)	N/A		

PERSONNEL INJURIES		DESCRIPTION	
NUMBER			
1	8	0	0
0	0	0	40
		N/A	

		8	9	11	12	
LOSS OF OR DAMAGE TO FACILITY TYPE DESCRIPTION		(43)				
1	9	7	(42)	N/A	B211040146 B21022 PDR ADOCK 050005	

7 8 9 10 N/A S 00000389 PDR NRC USE ONLY

PUBLICITY
ISSUED DESCRIPTION (45)

2 0 N (44) N/A

NAME OF PREPARER Phillip B. Nardoci PHONE: (704) 373-7432

NAME OF PREPARER Phillip B. Nardoci

PHONE: (704) 373-7432

8211040148 821022
PDR ADOCK 05000369
S PDR