

LICENSEE EVENT REPORT

CONTROL BLOCK										(PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)									
1										2									
3										4									
5										6									
7										8									
9										10									
11										12									
13										14									
15										16									
17										18									
19										20									
21										22									
23										24									
25										26									
27										28									
29										30									
31										32									
33										34									
35										36									
37										38									
39										40									
41										42									
43										44									
45										46									
47										48									
49										50									
51										52									
53										54									
55										56									
57										58									
59										60									
61										62									
63										64									
65										66									
67										68									
69										70									
71										72									
73										74									
75										76									
77										78									
79										80									
81										82									
83										84									
85										86									
87										88									
89										90									
91										92									
93										94									
95										96									
97										98									
99										100									

On October 28, 1981, while performing OI II-1.3.5, Reactor Coolant Leak Detection, it was determined that there was approximately 1.5 GPM unidentified leakage. Technical Specification 3.4.6.2.b specifies a limit of 1 GPM. At 0415 hours, Action Statement 3.4.6.2.b was entered. At 0630 hours an inspection revealed service water leakage from the fifth and sixth primary coils of No. 14 Containment Fan Coil Unit (CFCU) at a rate of 0.8 GPM. At 0630 hours No. 14 CFCU was declared inoperable and Action Statement 3.6.2.3.a was entered. Action Statement 3.4.6.2.b was terminated.

The leaks in the fifth and sixth primary coils on No. 14 CFCU were satisfactorily repaired with Belzona Metal Filler. The CFCU was tested satisfactorily and returned to service. At 0648 hours, October 30, 1981, No. 14 CFCU was declared operable and Action Statement 3.6.2.3.a was terminated. This cooler will be replaced during a future outage; however, no supplementary report will be issued.

Facility Status: E, Power: 0, Other Status: N/A, Method of Discovery: A, Discovery Description: Leak Detection, Activity Content: Z, Amount of Activity: N/A, Location of Release: N/A, Personnel Exposures: 0, Personnel Injuries: 0, Loss of or Damage to Facility: Z, Publicity: N.

8111230493
PDR ADOCK 05000272
S PDR

Frank Dickey

PHONE 609-935-5100