

LER No.: 50-366/1982-020
Licensee: Georgia Power Company
Facility: Edwin I. Hatch
Docket No.: 50-366

Narrative Report
for LER 50-366/1982-020.

On February 18, 1982, while the reactor was in hot standby, operations personnel were performing HNP-2-3702. 2C41-A003B was found depressurized. Maintenance personnel found a leak on the accumulator valve stem. The valve stem was replaced and the system was recharged and put back into service. This event was reported by Deviation Report No. 2-32-62.

On February 24, 1982, maintenance personnel was performing HNP-2-6310 and found 2C41-A003B depressurized again. After further investigation, maintenance found that the accumulator bladder had a small rupture, causing it to lose pressure. The bladder was replaced and the system recharged and put back into service. This was reported by Deviation Report No. 2-82-66.

The redundant "A" loop was operable. These are non-repetitive events for this unit. Safe plant operation was not affected by these incidents. There was no effect on public health and safety due to these events.