

LICENSEE EVENT REPORT

EXHIBIT A

[illegible]

NAME OF PREPARED: Patrick Rogers

PHONE 501/964-3100

8204300357

LER REPORT NUMBER 50-313/82-006/03L-0

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (cont'd)

Only a small degradation was necessary to cause flow to be below specifications. As a result, normal operational accumulation of dust in the system caused the flow measured by the surveillance to decrease to below the minimum flow rate. Inspection revealed that the prefilters were not excessively dirty. The diameter of the suction restriction was increased from 7 3/4 inches to 8 1/12 inches. The system was re-tested, proved operable and returned to service within the time requirements of T.S.3.9.2.