

50.55(e) Report

RECEIVED  
NRC

1982 MAY -3 PM 1:24

ARIZONA



PUBLIC SERVICE COMPANY

P. O. BOX 21666 · PHOENIX, ARIZONA 85026

April 27, 1982  
ANPP-20819-GHD/BSK

U. S. Nuclear Regulatory Commission  
Region V  
Creekside Oaks Office Park  
1450 Maria Lane - Suite 210  
Walnut Creek, California 94596-5368

Attention: Mr. T. W. Bishop, Chief  
Reactor Construction and  
Engineering Support Branch

Subject: Final Report - DER 82-10  
A 50.55(e) Report Relating to Code Material Identification  
Numbers Obliterated On Eight (8) Pipe Supports in Unit 2  
Containment and MSSS  
File: 82-019-026  
D.4.33.2



Reference: (A) Telephone Conversation between J. Eckhardt and  
G. Duckworth on March 18, 1982  
(B) Telephone Conversation between J. Eckhardt and  
G. Duckworth on April 19, 1982 (Time Extension  
to April 30, 1982)

Dear Sir:

Attached, is our final written report of the deficiency referenced above,  
which has been determined to be Not Reportable under the requirements of  
10CFR50.55(e).

Very truly yours,

*E. E. Van Brunt Jr.*

E. E. Van Brunt, Jr.  
APS Vice President  
Nuclear Projects  
ANPP Project Director

EEVBJr/GHD:skc

Attachment

cc: See Attached Page 2

8205110619 820427  
PDR ADOCK 05000529  
S PDR

1E27  
5 1/6  
82-110

U. S. Nuclear Regulatory Commission  
Attention: Mr. T. W. Bishop, Chief  
ANPP-20819-GHD/BSK  
April 27, 1982  
Page 2

cc: Richard DeYoung, Director  
Office of Inspection and Enforcement  
U. S. Nuclear Regulatory Commission  
Washington, D. C. 20555

J. A. Roedel  
D. B. Fasnacht  
G. C. Andognini  
A. C. Rogers  
B. S. Kaplan  
W. E. Ide  
J. Vorees  
J. A. Brand  
A. C. Gehr  
W. J. Stubblefield  
W. G. Bingham  
R. L. Patterson  
R. W. Welcher  
R. M. Grant  
D. R. Hawkinson  
L. E. Vorderbrueggen

R. L. Greenfield  
Assistant Attorney General  
Bataan Memorial Building  
Santa Fe, New Mexico 87503

Ms. Patricia Lee Hourihan  
6413 South 26th Street  
Phoenix, Arizona 85040

FINAL REPORT - DER 82-10  
DEFICIENCY EVALUATION 50.55(e)  
ARIZONA PUBLIC SERVICE COMPANY (APS)  
PVNGS UNIT 2

I. Description of Deficiency

Pipe Supports fabricated by Corner & Lada were received/ installed with material identification obliterated by galvanizing. This condition does not meet ASME III, Sub-section NF-2150 Winter 1975 Addenda requirements.

II. Analysis of Safety Implications

Engineering review of the Code showed that Summer 1979 Addenda provides that identification of the material to the Material Manufacturer's Certificate of Compliance is not required after the component support manufacturer has verified that the material meets NF requirements.

This condition is evaluated as Not Reportable since, should the condition have remained undetected, it would not represent a safety significant condition.

III. Corrective Action

Specification Change Notice No. 2913 has been issued against Design Specification 13-PM-209A to incorporate Summer 1979 Addenda as applicable to Section NF-2150. The following NCR's will be dispositioned as Use-As-Is:

PC-3487	PC-3491
PC-3488	PC-3492
PC-3489	PC-3493
PC-3490	PC-3494

Bechtel Engineering has verified that the typical Corner & Lada Certificate of Compliance satisfies either the requirements of Code Case N-225 or the Code change 1979 Summer Addenda.