

THE CINCINNATI GAS & ELECTRIC COMPANY



May 11, 1982  
QA-1739

E. A. BORGMANN  
SENIOR VICE PRESIDENT

U. S. Nuclear Regulatory Commission  
Region III  
799 Roosevelt Road  
Glen Ellyn, Illinois 60137

Attention: Mr. J. G. Keppler  
Regional Administrator

RE: WM. H. ZIMMER NUCLEAR POWER STATION UNIT I  
10CFR50.55(e) - ITEM M-41 - SUPPRESSION POOL  
PUMP SUCTION STRAINERS - DOCKET NO. 50-358,  
CONSTRUCTION PERMIT NO. CPPR-88,  
W.O. #57300 JOB E-5590 FILE NO. NRC-8, ITEM M-41

Gentlemen:

This letter constitutes a final report regarding the subject deficiency, initially reported to the NRC by Mr. H. R. Sager of CG&E on April 22, 1982, under the requirements of 10CFR50.55(e).

Zurn Industries, vendor of the subject equipment, notified CG&E on November 24, 1981, of a deficient condition involving the lack of heat treatment of bolting material (SA 564 Gr. 630) used to fasten the perforated strainer plates together and attach the assembled strainer to the suction line flange.

 
The strainers are located in the Suppression Pool area of the plant. During an occurrence such as a seismic event, the bolting material may fail, possibly causing the strainers to disassemble. Such an incident would conceivably allow oversized debris to enter a pump suction line and cause possible damage to essential equipment.

Six (6) of the subject strainers are utilized at Zimmer. All have been shipped to the vendor for rework and are expected to be returned to the site prior to June 30, 1982.

We trust the above will be found acceptable as a final report under 10CFR50.55(e).

Very truly yours,

THE CINCINNATI GAS & ELECTRIC COMPANY

By 

E. A. BORGMANN  
SENIOR VICE PRESIDENT

8205250043 820511  
PDR ADOCK 05000358  
S PDR

FKP:ac

cc: NRC Resident Inspector  
Attn: W. F. Christianson  
NRC Office of Inspection & Enforcement  
Washington, D.C. 20555

MAY 21 1982 51/0  
IE27