

# LICENSEE EVENT REPORT

CONTROL BLOCK: 

1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28	29	30	31	32	33	34	35	36	37	38	39	40	41	42	43	44	45	46	47	48	49	50	51	52	53	54	55	56	57	58	59	60	61	62	63	64	65	66	67	68	69	70	71	72	73	74	75	76	77	78	79	80
---	---	---	---	---	---	---	---	---	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----	----

 (PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

0	1
---	---

 N C B E P 2 0 0 - 0 0 0 0 0 - 0 0 3 4 1 1 1 1 4 5  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80  
LICENSEE CODE LICENSE NUMBER LICENSE TYPE CAT 58

CON'T  

0	1
---	---

 REPORT SOURCE L 0 5 0 - 0 3 2 4 7 0 3 0 1 8 2 8 0 3 2 9 8 2 9  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80  
DOCKET NUMBER EVENT DATE REPORT DATE

## EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (10)

0 2 During plant operation, while performing the channel functional test and calibration  
0 3 of the HPCI steam leak detection isolation system instrumentation, PT-2.1.3PC, it was  
0 4 discovered that HPCI room ambient temperature switch, 2-E41-TS-N602A, would not  
0 5 respond to an applied test signal. In accordance with technical specifications the  
0 6 HPCI System was declared inoperable. At the time of this event the LPCI and ADS  
0 7 systems were operable. This event did not affect the health and safety of the public.  
0 8 Technical Specifications 3.3.2, 3.5.1, 6.9.1.9b  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80

0 9 SYSTEM CODE S F 11 CAUSE CODE E 12 CAUSE SUBCODE G 13 COMPONENT CODE I N S T R U 14 COMP. SUBCODE Y 15 VALVE SUBCODE Z 16  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80  
LER/RO REPORT NUMBER 17 EVENT YEAR 8 2 21 22 SHUTDOWN METHOD Z 21 HOURS 0 0 0 22 ATTACHMENT SUBMITTED N 23 NPD-4 FORM SUB. Y 24 PRIME COMP. SUPPLIER N 25 COMPONENT MANUFACTURER S 0 5 4 26  
ACTION TAKEN C 18 FUTURE ACTION Z 19 EFFECT ON PLANT Z 20  
33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80

## CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)

1 0 This event was due to electronic failure of the switch module. The module,  
1 1 Model No. 86PTGR-D186, was replaced, the PT was satisfactorily completed and the  
1 2 HPCI System was declared operable. It is felt that the present monthly functional  
1 3 test and once per three month calibration of this instrument is sufficient in the  
1 4 detection of future similar events.  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80

1 5 FACILITY STATUS E 28 % POWER 0 8 3 29 OTHER STATUS NA 30 METHOD OF DISCOVERY B 31 Periodic Test 32  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80  
ACTIVITY CONTENT RELEASED OF RELEASE Z 33 Z 34 AMOUNT OF ACTIVITY NA 35 LOCATION OF RELEASE NA 36  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80  
PERSONNEL EXPOSURES NUMBER 0 0 0 37 TYPE Z 38 DESCRIPTION NA 39  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80  
PERSONNEL INJURIES NUMBER 0 0 0 40 DESCRIPTION NA 41  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80  
LOSS OF OR DAMAGE TO FACILITY TYPE Z 42 DESCRIPTION NA 43  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80

1 9 PUBLICITY ISSUED N 44 DESCRIPTION NA 45  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80  
8204160192 820329  
PDR ADOCK 05000324  
S PDR  
M. J. PASTVA, JR.  
919-457-9521  
NAME OF PREPARER PHONE