

(PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

(PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

047-9256

LER #: 50-321/1982-010
Licensee: Georgia Power Company
Facility Name: Edwin I. Hatch
Docket #: 50-321

Narrative Report
for LER 50-321/1982-010

During normal power operation on 3-11-82 at 1140 EST, it was reported that 1P41-F437A RHR Service Water Pump 1A Cooling Water Valve was not locked in the open position. The valve was verified as being open and immediately locked open as required by HNP-1-1117. A complete valve lineup was performed per HNP-1-1117 with no other discrepancies.

Subsequent research of this matter revealed that the valve had last been operated on 2-26-82. On this date the 1A RHR/SW pump was being returned to service following repair of a seal leak and flushing of the motor cooling coils. The clearance sheet required the valve to be opened but did not indicate that it should be locked.

To prevent a reoccurrence of this, an alpha-numerical MPL list of locked valves has been supplied to the Shift Foreman for quick reference in determining whether or not a valve should be locked.

Also, operating personnel have been reminded of the importance of locking valves in the proper positions. Shift Foremen have been instructed to indicate on the clearance sheet, when restoring valves to service, any requirement to lock such valves.