

(PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

CONTAINER BLOCK										PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION											
M N P I N 1 0 0 - 0 0 0 0 0 0 - 0 0 0 4 1 1 1 1 4										L I C E N S E C O D E L I C E N S E N U M B E R L I C E N S E T Y P E L A T S E											
L 0 5 0 0 0 2 8 2 0 9 1 2 7 8 0 9 2 6 7 8										D O C K E T N U M B E R E V E N T D A T E R E P O R T D A T E											
EVENT DESCRIPTION AND PROBABLE CONSEQUENCES																					
At 1549, with both units at full power, a lightning strike on the Spring Creek																					
transmission line caused breaker 6H5 to open. No. 10 Bank Transformer then tripped on																					
sudden pressure. Two of the three sources of offsite power were now lost and the																					
safeguards buses were now powered from No. 11 Cooling Tower Transformer through bus																					
ties. The diesel generators started automatically and ran unloaded (no loading was																					
required). The second source of offsite power was restored at 1624 the same day. Not																					
repetitive. No effect on public health and safety. Tech Spec 3.7.B.1 applies.																					
SYSTEM CODE CAUSE CODE CAUSE SUBCODE COMPONENT CODE COMP SUBCODE VALVE SUBCODE																					
E A B A T R A N S F Z Z																					
EVENT YEAR SEQUENTIAL REPORT NO. OCCURRENCE CODE REPORT TYPE REVISION NO.																					
7 8 0 1 8 0 1 T 0																					
ACTION TAKEN FUTURE ACTION EFFECT ON PLANT SHUTDOWN METHOD HOURS ATTACHMENT SUBMITTED NPD-4 FORM SUB PRIME COMP. SUPPLIER COMPONENT MANUFACTURER																					
Z F Z Z 0 0 0 0 N N A W 1 2 0																					
CAUSE DESCRIPTION AND CORRECTIVE ACTIONS																					
No. 10 Bank Transformer should not have tripped on sudden pressure due to the																					
external fault. A Design Change in transformer protection relaying is being pursued																					
to prevent recurrence.																					
FACILITY STATUS POWER OTHER STATUS METHOD OF DISCOVERY DISCOVERY DESCRIPTION																					
E 1 0 0 NA A Operator Observation																					
ACTIVITY CONTENT RELEASED OF RELEASE AMOUNT OF ACTIVITY LOCATION OF RELEASE																					
Z Z NA NA																					
PERSONNEL EXPOSURES NUMBER TYPE DESCRIPTION																					
0 0 0 Z NA																					
PERSONNEL INJURIES NUMBER DESCRIPTION																					
0 0 0 NA																					
LOSS OF OR DAMAGE TO FACILITY TYPE DESCRIPTION																					
Z NA																					
PUBLICITY ISSUED DESCRIPTION																					
N NA																					
NAME OF PREPARED A A Hunstad																					
7810180013 612-388-4767																					