

CONTROL BLOCK

(PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

01 N C M G S 1 2 0 0 - 0 0 0 0 0 - 0 0 3 4 1 1 1 1 4 5  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

CONT

01 REPORT SOURCE L 6 0 5 0 0 0 3 6 9 7 0 4 1 3 8 3 8 0 5 1 2 8 3 9  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (10)

02 While in mode 6, analysis of a representative fuel pool ventilation system (VF)  
03 carbon filter sample per T.S.4.9.11.2(b) indicated the sample failed to meet  
04 the penetration criteria of methyl iodide of less than 1 percent. The VF System  
05 was declared inoperable per T.S.3.9.11 which is reportable per T.S.6.9.1.11(d),  
06 and similar to RO-369/82-43. Until a final determination of VF carbon adsorber  
07 operability is made the system will remain inoperable, and fuel movement and  
08 crane operation with loads suspended. Health and safety of the public were  
09 unaffected.

09 F D 11 X 12 Z 13 F I L T E R 14 Z 15 Z 16  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)

10 Analysis of a sample (with run time of 714.9 hours) by vendor "B" failed the  
11 test (6.54 percent penetration). Analysis of a sample (longer run time of  
12 1192.6 hours) by vendor "A" passed (0.6 percent penetration). Another sample  
13 will be analyzed by a third vendor to determine if it was vendor error or filter  
14 failure. If consensus analysis is failure, bed will be reloaded. A followup  
15 report will be submitted.

15 H 28 0 0 0 29 N/A 30 B 31 Routine Surveillance 32  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

16 Z 33 Z 34 N/A 35 N/A 36  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

17 0 0 0 37 Z 38 N/A 39  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

18 0 0 0 40 N/A 41  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

19 Z 42 N/A 43  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

20 N 44 N/A 45  
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

NAME OF PREPARER Phillip B. Nardoci

PHONE: (704) 373-7432

8305250404 830512  
PDR ADDCK 05000369  
PDR

**DUKE POWER COMPANY**

P.O. BOX 33189  
CHARLOTTE, N.C. 28242

HAL B. TUCKER  
VICE PRESIDENT  
NUCLEAR PRODUCTION

May 12, 1983

REGION II  
ATLANTA, GEORGIA

TELEPHONE  
(704) 373-4531

83 MAY 20 10:00

Mr. James P. O'Reilly, Regional Administrator  
U. S. Nuclear Regulatory Commission  
Region II  
101 Marietta Street, NW, Suite 2900  
Atlanta, Georgia 30303

 
Re: McGuire Nuclear Station Unit 1  
Docket No. 50-369

Dear Mr. O'Reilly:

Please find attached Reportable Occurrence Report RO-369/83-19. This report concerns T.S. 3.9.11, "The Fuel Handling Ventilation Exhaust System shall be operable". This incident was considered to be of no significance with respect to the health and safety of the public.

A followup report will be submitted when results of the third analysis are received and final corrective actions determined.

Very truly yours,



Hal B. Tucker

PBN:jfw  
Attachment

cc: Document Control Desk  
U. S. Nuclear Regulatory Commission  
Washington, D. C. 20555

Records Center  
Institute of Nuclear Power Operations  
1100 Circle 75 Parkway, Suite 1500  
Atlanta, Georgia 30339

Mr. W. T. Orders  
NRC Resident Inspector  
McGuire Nuclear Station

OFFICIAL COPY

IE 22