

LICENSEE EVENT REPORT

CONTROL BLOCK: ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ (1) (PLEASE PRINT OR TYPE ALL REQUIRED INFORMATION)

0 1 F L S L S 2 2 0 0 - 0 0 0 0 0 - 0 0 3 4 1 1 1 1 4 5
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

CON'T
0 1 REPORT SOURCE L 8 0 5 0 0 0 3 8 9 7 0 5 1 4 8 3 8 0 6 1 3 8 3 9
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

EVENT DESCRIPTION AND PROBABLE CONSEQUENCES (10)

0 2 On May 14, 1983 while in Mode 3, an operator observed that all of the
0 3 position indication lights on PORV 1475 were out. This condition is not
0 4 in accordance with T.S. 3.3.3.6. This condition existed on May 15, 1983
0 5 when the plant was cooled down and entered Mode 4. The condition was then
0 6 not in accordance with T.S.3.4.9.3. Position indication was restored with
0 7 no adverse affect on the plant. This is the first event of this type. The
0 8 health and safety of the public were not in jeopardy.
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

0 9 SYSTEM CODE C B 11 CAUSE CODE B 12 CAUSE SUBCODE B 13 COMPONENT CODE I N S T R U 14 COMP SUBCODE E 15 VALVE SUBCODE Z 16
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

17 LER/RO REPORT NUMBER 8 3 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

ACTION TAKEN A 18 Z 19 EFFECT ON PLANT Z 20 SHUTDOWN METHOD Z 21 HOURS 0 0 0 0 22 ATTACHMENT SUBMITTED N 23 NRC-4 FORM SUB N 24 PRIME COMP SUPPLIER N 25 COMPONENT MANUFACTURER G O 4 2 26
33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

CAUSE DESCRIPTION AND CORRECTIVE ACTIONS (27)

1 0 Upon investigation it was found that a magnet on the valve shaft which
1 1 gives position indication had lost its magnetic property due to the high
1 2 temperatures in the environs. The magnet was replaced with one capable
1 3 of retaining this property at elevated temperatures. The indication was
1 4 tested satisfactorily and placed back in service.
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

1 5 FACILITY STATUS B 23 % POWER 0 0 0 0 29 OTHER STATUS N/A 30 METHOD OF DISCOVERY A 31 Operator Observation 32
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

1 6 ACTIVITY CONTENT Z 33 Z 34 N/A 35 AMOUNT OF ACTIVITY N/A 36 LOCATION OF RELEASE N/A 37
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

1 7 PERSONNEL EXPOSURES 0 0 0 37 Z 38 N/A 39
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

1 8 PERSONNEL INJURIES 0 0 0 40 N/A 41
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

1 9 LOSS OF OR DAMAGE TO FACILITY Z 42 N/A 43
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

2 0 PUBLICITY N 44 N/A 45
7 8 9 10 11 12 13 14 15 16 17 18 19 20 21 22 23 24 25 26 27 28 29 30 31 32 33 34 35 36 37 38 39 40 41 42 43 44 45 46 47 48 49 50 51 52 53 54 55 56 57 58 59 60 61 62 63 64 65 66 67 68 69 70 71 72 73 74 75 76 77 78 79 80 81 82 83 84 85 86 87 88 89 90 91 92 93 94 95 96 97 98 99 100

NAME OF PREPARER J. F. Brannin

PHONE 305/465-3550 ext 3427

8306210081 830613
PDR ADOCK 05000389
S PDR

IE22
1/1

USNRC REGION
ATLANTA, GEORGIA



FLORIDA POWER & LIGHT COMPANY

83 JUN 16 P 8:58

June 13, 1983
PNS-LI-83-412-1

Mr. James P. O'Reilly
Regional Administrator, Region II
U. S. Nuclear Regulatory Commission
101 Marietta Street N.W., Suite 2900
Atlanta, Georgia 30303

Dear Mr. O'Reilly:

REPORTABLE OCCURRENCE 389-83-08

ST. LUCIE UNIT 2

DATE OF OCCURRENCE: MAY 14, 1983

TECHNICAL SPECIFICATION 3.3.3.6 and 3.4.9.3

POWER OPERATED RELIEF VALVE INDICATION

The attached Licensee Event Report is being submitted in accordance with Technical Specification 6.9 to provide 30-day notification of the subject occurrence.

Very truly yours,

J. W. Williams, Jr.
Vice President
Nuclear Energy

JWW/PLP/js

Attachment

cc: Director, Office of Inspection and Enforcement (30)
Harold F. Reis, Esquire
File 933.1 SL

OFFICIAL COPY

IE 22